


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1 ✓
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

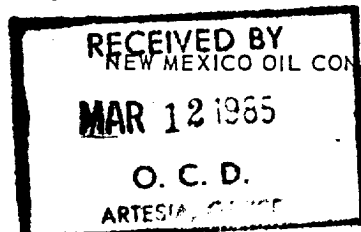

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
B-21 78

### SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TXO Production Corp. ✓	8. Farm or Lease Name Empire St Com
3. Address of Operator 900 Wilco Bldg Midland TX 79701	9. Well No. 1
4. Location of Well UNIT LETTER <u>M</u> <u>660</u> FEET FROM THE <u>south</u> LINE AND <u>660</u> FEET FROM THE <u>west</u> LINE, SECTION <u>20</u> TOWNSHIP <u>17-S</u> RANGE <u>28-E</u> NMPM.	10. Field and Pool, or Wildcat Empire (Pen)
15. Elevation (Show whether DF, RT, GR, etc.) 3563 GL	11. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TOH w/2 3/8" tbg & pkr  
TIH w/4 1/2" CIBP & set @9850' Dump 35' cmt  
TIH I free piont 4 1/2" csg  
TIH & set 20 sx plug @ 9550'  
TIH & Set 20 sx plug @ 9400'  
TIH & cut csg @ free pt (TOC approx 8600')  
TIH & set 20 sx plug in csg stub  
Set 50 sx plug @ 7800'  
Set 50 sx plug @ 7000'  
Set 50 sx plug @ 5300'  
Set 50 sx plug @ 2500'  
Set 25 sx plug @ surface

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Engineer DATE 3-8-85

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE MAR 20 1985

CONDITIONS OF APPROVAL, IF ANY:

1. Fully plugged in sufficient time to witness

Plugging