

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Oil Cons.
N.M. DIV-Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
ARCO Permian

3. Address and Telephone No.

P.O. Box 1089, Eunice, NM 88231

505-394-1649

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Unit Letter H, 2400' FNL & 700' FEL

Section 1, T18S, R27E

5. Lease Designation and Serial No.

NM-0557371

6. If Indian, Allottee or Tribe Name

EMPIRE ABO UNIT

7. If Unit or Lease Designation

NM-70945

8. Well Name and No.

Empire Abo Unit "J" 203

9. API Well No.

30-015-22656

10. Field and Pool, or exploratory Area

Empire Abo

11. County or Parish, State

Eddy

NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice



TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other Workover
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRUPU. NDWH. NUBOP. RU wireline unit. RIH w/SV and set in SN @ 6034'. POH. GIH & chemically cut 2-3/8" tbg in second jt. above pkr. POH w/wireline & chemical cutter. RDWL unit. POH w/tbg. GIH w/overshot, API SN. & workstring to top of fish. Swab well down to SN. If well begins to flow kill well w/1 bbl. 2% KCL wtr. GIH catch fish. RIs pkr @ 6039. POH. RIH w/4-3/4" big & scraper to PBTD @ 6163'. POH. GIH & perf w/2 JSPF 5627 to 5634, 5642, 5646, 5658 to 5674, 5700, 5704 to 5713, 5732 to 5734, 5748 to 5752, 5758 to 5763, 5769 to 5772, 5782 to 5786, 5789 to 5810, 5840 to 5842, 5848 to 5852, 5856 to 5858, 5876 to 5898, 5905 to 5911, 6004 to 6006, 6030 to 6036, 6042 to 6048, and 6058 to 6074'. POH. GIH w/PPI tools & breakdown perfs from 6074 to 5627' w/50 gals/ft. 15% HCL NEFE. POH. GIH w/bull plugged MA, perf sub, API SN & 2-3/8" tbg. Land SN @ +/- 6122'. NDBOP. NUWH. Swab for test. RDP. RTP.

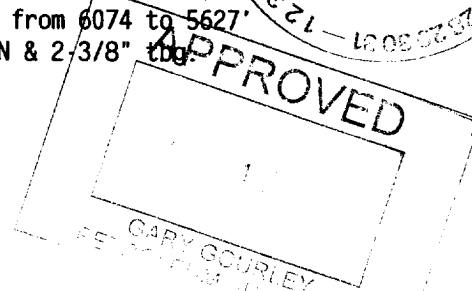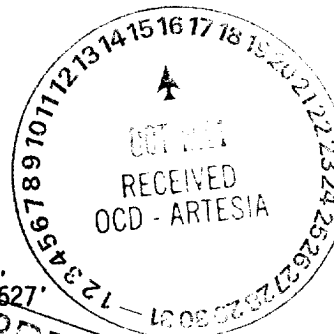

14. I hereby certify that the foregoing is true and correct

Signed

[Signature]

Title Sr. Administrative Assistant

Date 08/23/01

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

RECEIVED
2001 AUG 27 AM 9:04
BUREAU OF LAND MGMT.
FOREST OFFICE