

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	
OPERATOR	☒

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

OCT 30 1984

O. C. D.
ARTESIA, OFFICE

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	
648	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Hondo Oil & Gas Company	8. Farm or Lease Name Hondo 22 State
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER <u>H</u> , <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>990</u> FEET FROM THE <u>East</u> LINE, SECTION <u>22</u> TOWNSHIP <u>19S</u> RANGE <u>28E</u> N.M.P.M.	10. Field and Pool, or Wildcat Winchester Wolfcamp North
15. Elevation (Show whether DF, RT, GR, etc.) 3382.5' GR	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

Propose to cmt squeeze present Wolfcamp perms and add perforations in the Upper Wolfcamp & treat in the following manner:

1. RU, kill well, install BOP & POH w/compl assy.
2. Establish injection rate into Wolfcamp perms 9166-98'. Sting into pkr & cmt squeeze perms 9166-98' w/100 sx Cl H Neat cmt. Spot 10-20' cmt on top of pkr @ 9070'.
3. Perf Upper Wolfcamp @ 9012-16' w/1 JSPF. RIH w/trtr pkr, set @ 8950' & acidize w/1000 gals 15% HCL. Swab test. If perms are non-commercial, set cmt retr & squeeze cmt perms & spot cmt on top of retr.
4. If lower perms are commercial, set RBP @ 8990'. Perf Wolfcamp @ 8836-44' & 8894-8922' w/1 JSPF. Set trtg pkr above perms & acidize 8836-8922' w/3000 gals 15% HCL. Swab test. POH w/pkr & RBP.
5. RIH w/compl assy, return to production.


18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Leslie A. Clements TITLE Drig. Engr. DATE 10/26/84

Original Signed By
Leslie A. Clements

APPROVED BY Supervisor District II TITLE DATE OCT 30 1984

CONDITIONS OF APPROVAL, IF ANY:

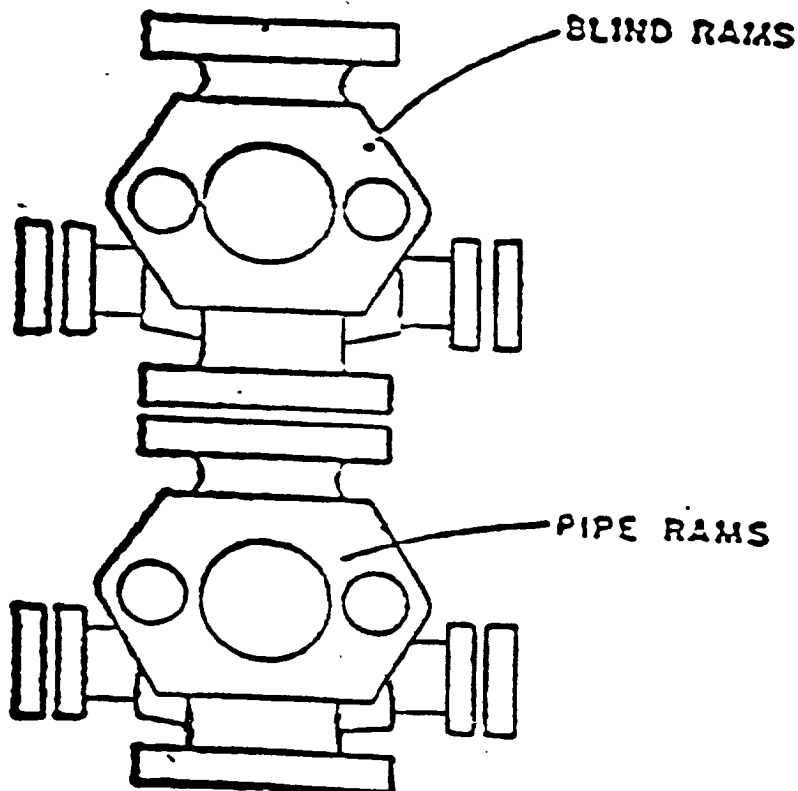

ARCO Oil & Gas Company

Division of Atlantic Richfield Company

Blow Out Preventer Program

Lease Name Hondo 22 State

Well No. 1

Location 1980' FNL & 990' FEL
Sec 22-19S-28E, Eddy County

BOP to be tested when installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.