

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED BY

OCT 18 1983

O. C. D.
ARTESIA, OFFICEForm C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease

State ☐Fee ☒

5. State Oil & Gas Lease No.

SUNDARY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO PUMP OR PUMP LIFT TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.1. OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. Name of Operator

Anadarko Production Company

3. Address of Operator

P. O. Drawer 130, Artesia, New Mexico 88210

4. Location of Well

UNIT LETTER F 1830 FEET FROM THE North LINE AND 1980 FEET FROMTHE West LINE, SECTION 12 TOWNSHIP 19S RANGE 25E NMPM.

15. Elevation (Show whether DF, RT, CR, etc.)

3398' GL

7. Unit Agreement Name

8. Farm or Lease Name

Glass

9. Well No.

1

10. Field and Pool, or Wildcat

Wildcat Atoka

12. County

Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐PLUG AND ABANDON ☒
CHANGE PLANS ☐REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Move in, rig up pulling unit and install BOP.
2. Trip out of hole with packer & tubing.
3. Run free point test and cut 4 1/2" casing off @ cement top (approx 5130' KB).
4. Pull 4 1/2" casing.
5. Trip in hole with tubing open-ended and tag CIBP @ 9020'. entire
6. Circulate hole with 10% brine and salt gel mud (will keep hole loaded with mud during plugging)
7. Spot 400' Class H cement with 3% CaCl from 9020' to 8620'; this plug will cover top of CIBP and Atoka perfs.
8. Pull up and wait for plug to harden; tag top of plug.
9. Pull up and spot 200' Class H cement with 3% CaCl from 7025' to 6825'.
0. Pull up and wait for plug to harden; tag top of plug.
1. Pull up and spot 200' Class H cement with 3% CaCl from 5230' to 5030'; this plug will cover 4 1/2" casing stub.
2. Pull up and wait for plug to harden; tag top of plug.
3. Pull up and spot 200' Class H cement with 3% CaCl from 2600' to 2400'; this plug will cover base of San Andres.
4. Wait for plug to harden; tag top of plug.
5. Pull up and spot 200' Class H cement with 3% CaCl from 1330' to 1130'; this plug will cover 8-5/8" casing shoe.

continues on page 2

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mike Burwell TITLE Field Foreman DATE October 17, 1983REMOVED BY Mike Walker TITLE OIL AND GAS INSPECTOR DATE OCT 19 1983

CONDITIONS OF APPROVAL, IF ANY:

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED BY

OCT 18 1983

O. C. D.
ARTESIA, OFFICEForm C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

3a. Indicate Type of Lease

State ☐Fee ☒

3. State Oil & Gas Lease No.

SUNDY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO RE-OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL OR TO RE-OPEN FOR SUCH PROPOSALS.)OIL WELL ☐ GAS WELL ☒ OTHER ☐

7. Unit Agreement Name

8. Form or Lease Name

Glass

9. Well No.

1

10. Field and Pool, or Wildcat

Wildcat Atoka

UNIT LETTER F 1830 FEET FROM THE North LINE AND 1980 FEET FROMTHE West LINE, SECTION 12 TOWNSHIP 19S RANGE 25E NMPM.

11. Elevation (Show whether DF, RT, GR, etc.)

3398' GL

12. County

Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

16. Wait for plug to harden; tag top of plug.
 17. Pull up and spot 100' Class H cement with 3% CaCl from 100' to surface.
 18. Cut off all casing and anchors below surface; set P & A marker; clean & level location.

I, hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNED Mike BraswellTITLE Field ForemanDATE October 17, 1983

APPROVED BY

TITLE

DATE

Subject	GLASS #1 - P&A		Page No.	Of
File			By	Date

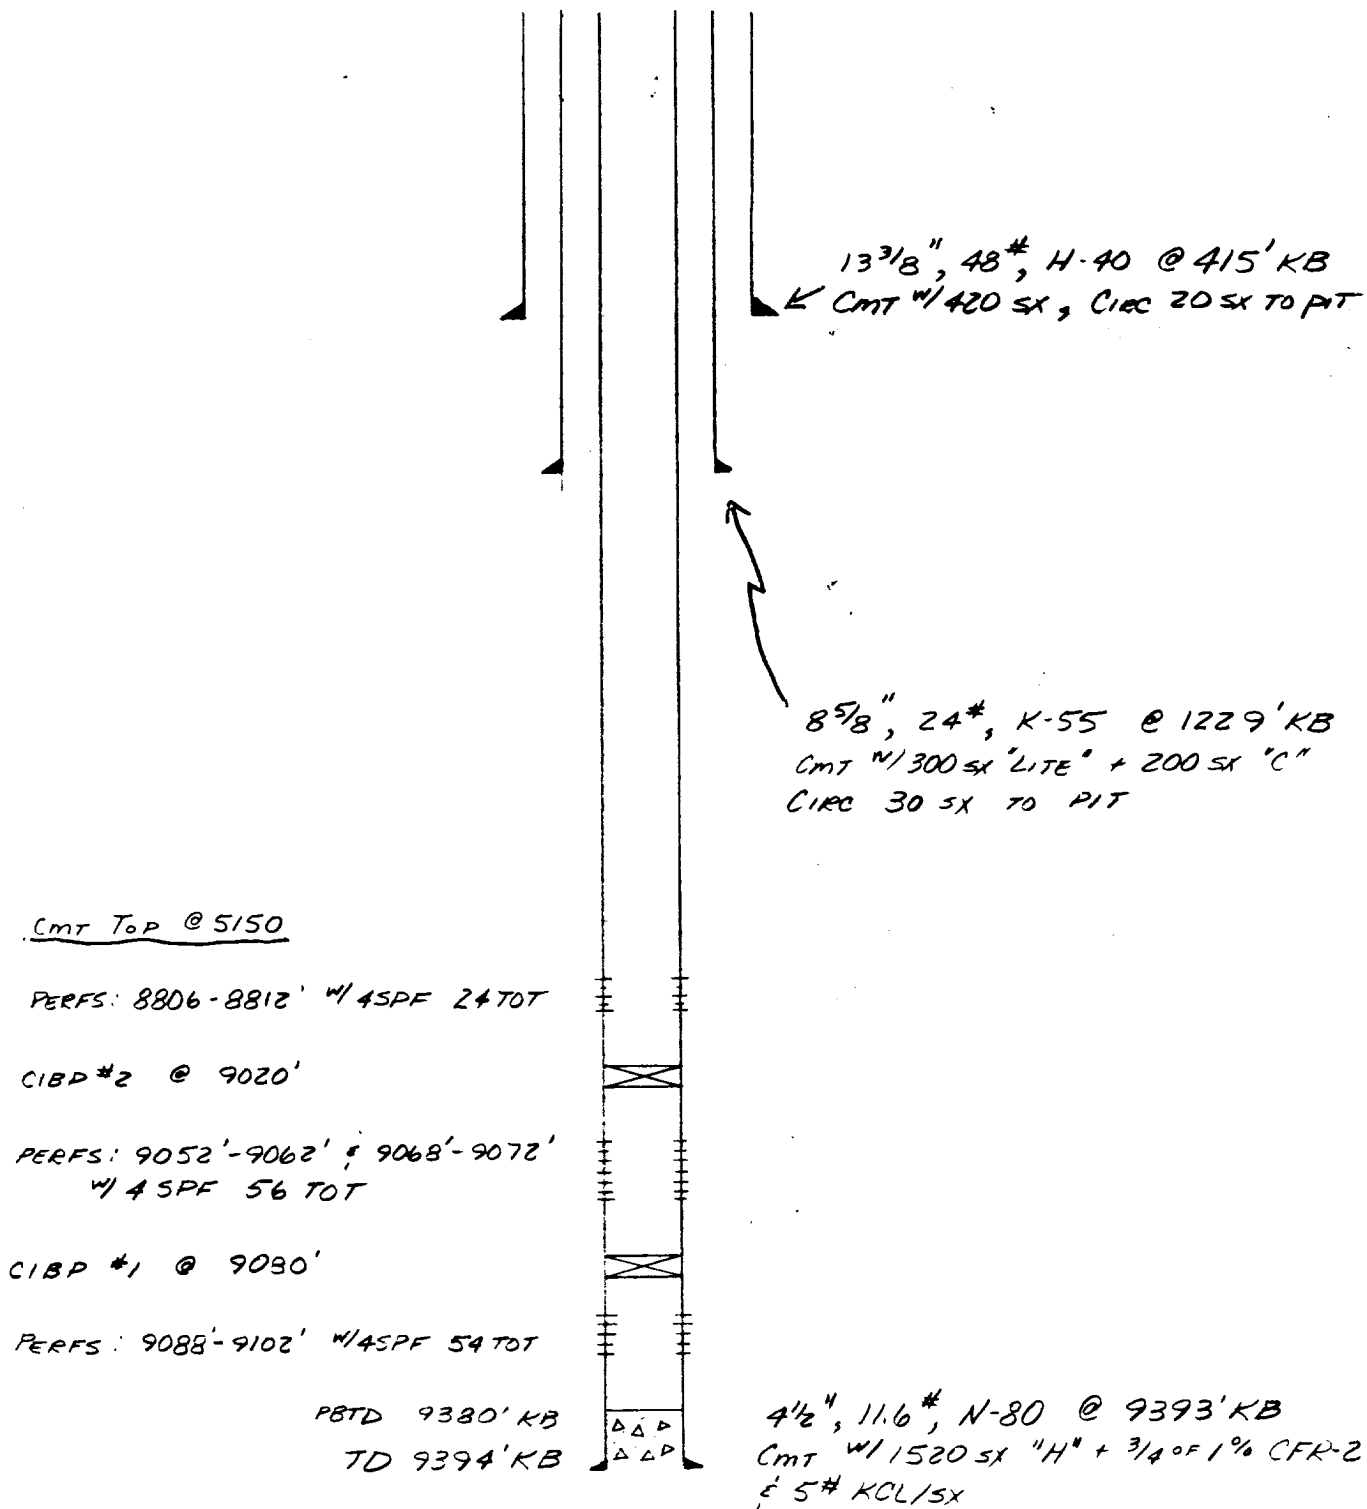

Subject	GLASS #1 - PFA	Page No.	Of
File		By	Date

