

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

## OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO. 30-015-26037
Indicate Type of Lease STATE FEE <input checked="" type="checkbox"/>
State Oil & Gas Lease No.
Lease Name or Unit Agreement Name Anderson 10J
Well No. 2
Pool name or Wildcat Und. Cemetary Morrow

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
Type of Well: OIL WELL GAS WELL OTHER P&A'd	
Name of Operator Nearburg Producing Company	
Address of Operator 3300 N A St., Bldg 2, Suite 120, Midland, TX 79705	
Well Location Unit Letter J : 1980 Feet From The East Line and 1980 Feet From The South Line Section 10 Township 20S Range 25E NMPM Eddy County	
Elevation (Show whether DF, RKB, RT, GR, etc.) 3417' GR	

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

### SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Nearburg Producing Company requests to plug and abandon the above referenced well.

- 1.) MIRIJ and set CIBP @ 9400' w/ 35' cmt or spot 25 sx plug.
- 2.) Perf @ 6975' and squeeze w/ 100' of cmt inside & outside of Csg
- 3.) Cut casing @ 5500' & pull spot 50 sx sub plug 50' & 50' out of sub. WOC tag.
- 4.) Spot 50 sx plug @ 4166' - 3997'.
- 5.) Spot 50 sx plug @ 2988 - 2435'. 2235' to 2335' - 100' plug
- 6.) Spot 50 sx plug @ 1410' - 1241'. Tag (8-5/8" base 1360').
- 7.) 30' sx surface plug.
- 8.) Install dry hole marker.

- 5414 gel mud consisting of 10# Brine w/ 25# of gel  
Per bbl must be placed between all plugs  
- Contact OGD 24 Hrs Prior to Any work Done

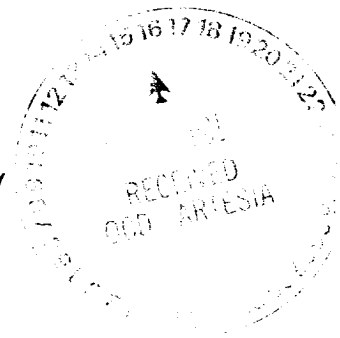

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kim Stewart TITLE Regulatory Analyst DATE 07-11-01

TYPE OR PRINT NAME Kim Stewart

TELEPHONE NO. 915/686-8235

(This space for State Use)

APPROVED BY [Signature] TITLE Field Rep ID DATE 8-27-01

CONDITIONS OF APPROVAL, IF ANY: