

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Nearburg Producing Company

3. Address and Telephone No.

P.O. Box 823085 Dallas, TX 75382-3085 214-739-1778

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2106 FNL 1830 FEL SEC.30 T-20-S R-26-E

5. Lease Designation and Serial No.
NM-NM 98029
N.M.-N.M.8691 and

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Willow Draw #1

9. API Well No.

30-015-10605

10. Field and Pool, or Exploratory Area

Wildcat Cisco/Canyon

11. County or Parish, State

Eddy N.M.

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- (1) Set 5 1/2 CIBP at 8400' Cap w/30' cement
- (2) Load hole w/mud
- (3) Cut and pull 5 1/2 casing from free point approx 6500' + or -
- (4) Spot 100' cement plug at 5 1/2 stud W.O.C. and tag
- (5) Spot 100' cement plug in open hole at Approx 4500'
- (6) Spot 100' cement plug at 8 5/8 shoe 50' in and 50' out 2438' W.O.C. and tag.
- (7) Spot 100' cement plug at 13 3/8 shoe 50' in and 50' out 530' W.O.C.
- (8) Spot 50' cement at surface set P.A. Marker

SEE ATTACHED FOR
CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct

Signed

Alexis C. Swoboda

Title

Supervisor - mgr.

Date

4-21-97

(This space for Federal or State office use)

(ORIG. SGD.) ALEXIS C. SWOBODA

Approved by

Conditions of approval, if any:

Title

PETROLEUM ENGINEER


Date

MAY 06 1997

BEFORE

COMPANY: Nearburg Producing Co ny
LEASE & WELL NO. Willow Draw #1
FORMATION: _____
COUNTY & STATE: Eddy, N.M.

RAYMOND MALDONADO
SUPERVISOR, P & A OPERATIONS
BUS: (505)393-9171
FAX (505)393-3848
MOBILE (505)390-0540
MOBILE (505)390-0540

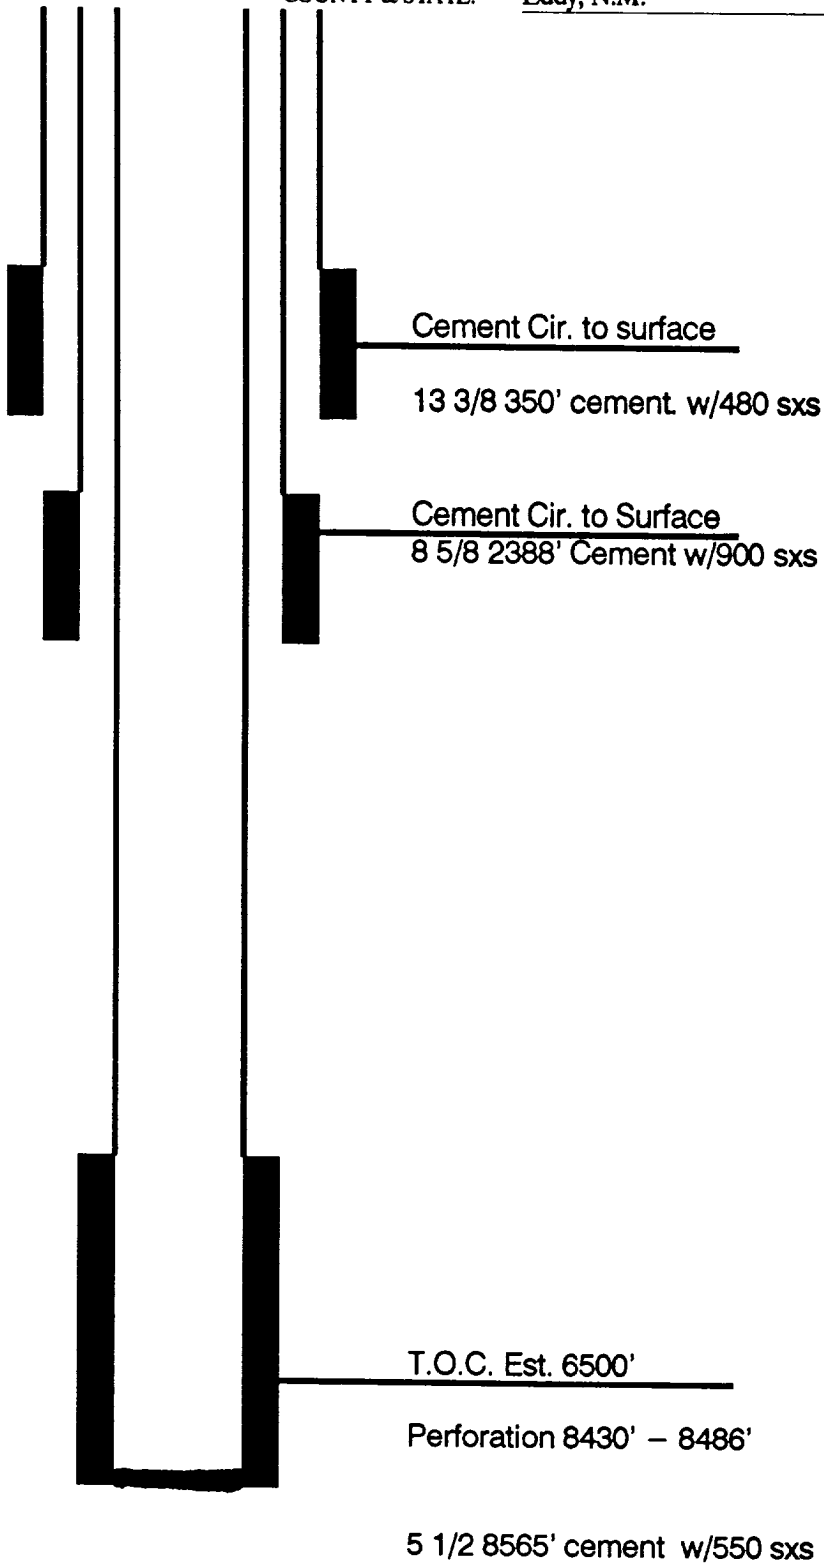

AFTER

COMPANY: Nearburg Producing Co ny
LEASE & WELL NO. Willow Draw #1
FORMATION: _____
COUNTY & STATE: Eddy, N.M.

RAYMOND MALDONADO
SUPERVISOR, P & A OPERATIONS
BUS: (505)393-9171
FAX (505)393-3848
MOBILE (505)390-0540
MOBILE (505)390-0540



Spot 50' Surface plug

Cement Cir. to surface

13 3/8 350' cement w/480 sxs

Spot 100' cement plug at 13 5/8 shoe 50' in & 50' out & tag

Cement Cir. to Surface

8 5/8 2388' Cement w/900 sxs

Spot 100' cement plug at 8 5/8 shoe 50' in & 50' out and tag



Spot 100' cement plug at approx. 4500'



Spot 100' cement plug at 5 1/2 stub and tag

T.O.C. Est. 6500'

Set 5 1/2 CIBD at 8400' cap w/35' cement
Perforations 8430' - 8486'

5 1/2 8665' cement w/550 sxs