


STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S	
LAND OFFICE	
OPERATOR	

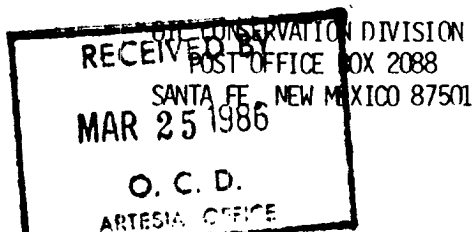

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT-" (FORM C-101) FOR SUCH PROPOSALS)

1. OIL WELL <input type="checkbox"/>	GAS WELL <input type="checkbox"/>	OTHER Dryhole
2. Name of Operator Read & Stevens, Inc. ✓		
3. Address of Operator Post Office Box 1518, Roswell, New Mexico 88202		
4. Location of Well UNIT LETTER I 890 FEET FROM THE East LINE AND 1980 FEET FROM THE South LINE. SECTION 24 TOWNSHIP 23S RANGE 27E NMPM		
5. Elevation (Show whether DF, RT, GR, etc.) 3100.7' GL		
7. Unit Agreement Name		
8. Farm or Lease Name Cass Draw		
9. Well No. 2		
10. Field and Pool, or Wildcat Wildcat Delaware		
12. County Eddy		

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK	<input type="checkbox"/>	PLUG AND ABANDON	<input checked="" type="checkbox"/>
TEMPORARILY ABANDON	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>		
OTHER	<input type="checkbox"/>		

SUBSEQUENT REPORT OF:

REMEDIAL WORK	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
COMMENCE DRILLING OPNS.	<input type="checkbox"/>	PLUG AND ABANDONMENT	<input type="checkbox"/>
CASING TEST AND CEMENT JOB	<input type="checkbox"/>		
OTHER	<input type="checkbox"/>		

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1). Notify NMOC @ 748-1283, 24 hours prior to plugging.
- 2). Set 5 1/2" CIBP @ 2400', dump 35' Class "C" cement on top of plug.
- 3). Circulate hole with salt gel mud, +9#/gal, +36 vis.
- 4). Spot 100' plug, 350'-450', 25sx Class "C" cement.
- 5). Spot 30' plug, 0'-30', 10sx Class "C" cement.
- 6). Install Dryhole Marker, remove anchors, clean location and prepare for inspection.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED B. H. H. H. TITLE Drilling and Production Manager DATE March 24, 1986

APPROVED BY M. J. Williams TITLE OIL AND GAS INSPECTOR DATE MAR 31 1986

CONDITIONS OF APPROVAL, IF ANY: