

C/SF

UNITED STATES DEPARTMENT OF THE INTERIOR

Form 9-331
(May 1963)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R-24.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug but use "APPLICATION FOR PERMIT" for such proposals.)

RECEIVED BY
NOV 28 1983
O. C. D.
ARTESIA, OFFICE

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. NAME OF OPERATOR TOM L. INGRAM ✓
3. ADDRESS OF OPERATOR P.O. BOX 1757, ROSWELL, N.M. 88201
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface 330' FSL, 760' FWL, SEC. 14
5. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)
3122 GR

5. LEASE DESIGNATION AND SERIAL NO. N.M. - 24777
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME Federal "z"
9. WELL NO. 1
10. FIELD AND POOL, OR WILDCAT Wildcat - *Delaware*
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 14, Twp. 26-S, Rge. 30-E
12. COUNTY OR PARISH EDDY 13. STATE N.M.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐
PULL OR ALTER CASING ☒
MULTIPLE COMPLETE ☐
ABANDON* ☒
CHANGE PLANS ☐


SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other) ☐
REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Propose to plug and abandon well as follows:

Set CIBP at 5665' with 35' Cmt.
Set 10 sx. (100') cmt. plug from 4510' - 4610' (Top of Cherry Canyon)
Set 10 sx. (100') cmt. plug at 3580' - 3680' (Top of Bell Canyon)
Cut and pull 5 1/2" Csg. at 2600'
Set 25 sx. (150') cmt. plug in and out of 5 1/2" Csg. Stub
Set 25 sx. (100') cmt. plug at 1000'
Set 25 sx. (100') cmt. plug at 300' - 400' In & behind 8 1/2" casing
Set 10 sx. cmt. plug at Surface 50'
Set Dry Hole Marker
Inject mud laden brine between cmt. plugs

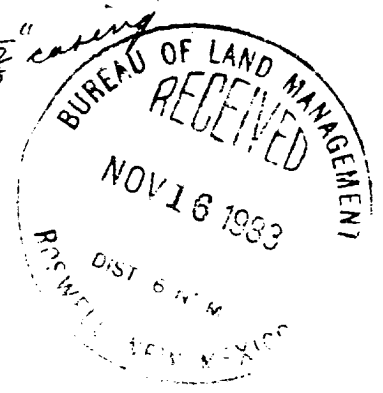

I hereby certify that the foregoing is true and correct
SIGNED *Joseph T. Lyman* TITLE Engineer DATE NOV.
APPROVED BY (Orig. Sgd.) PETER W. CHESTER TITLE DATE
CONDITIONS OF APPROVAL, IF ANY:
NOV 25 1983

*See Instructions on Reverse Side