In Lieu Form 3 (June 1	160 DEPARTMENT OF INTERIOR		FORM APPROVED Budget Bureau No 1004-0135 Expires March 31, 1993
SUNDRY NOTICE AND REPORTS ON WELLS Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION"		5.	Lease Designation and Serial No NMSF-078773
	TO DRILL" for permit for such proposals 11 -2 PM 3: 43		If Indian, Allottee or Tribe Name
	SLM SLM SUBMIT IN TRIPLICATE 210 FOR INCOME NM	7.	If Unit or CA, Agreement Designation Rosa Unit
1.	Type of Well Oil Well Gas Well Other	8.	Well Name and No. Rosa Unit #188C
2.	Name of Operator WILLIAMS PRODUCTION COMPANY	9.	API Well No. 30-039-29909
3.	Address and Telephone No. PO Box 640 Aztec, NM 87410-0640	10.	Field and Pool, or Exploratory Area BLANCO MV/BASIN DK
4.	Location of Well (Footage, Sec., T., R., M., or Survey Description) 880' FSL & 2450' FWL Sec. 34, T31, R5 NMPM	11.	County or Parish, State Rio Arriba, New Mexico

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION		
Notice of Intent	Abandonment	Change of Plans	
\mathcal{N}	Recompletion	New Construction	
X Subsequent Report	Plugging Back	Non-Routine Fracturing	
	Casing Repair	Water Shut-Off	
Final Abandonment	Altering Casing	Conversion to Injection	
	X Other Multiple zone completion	Dispose Water	
		(Note: Report results of multiple completion	
		on Well Completion or Recompletion Report	
	1	and Log form.)	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Williams Production Company, LLC. hereby requests authority to drill this as a Mesa Verde/Dakota dual as per attached plat and Operations plan.

RCVD JUL9'07 OIL CONS. DIV. DIST. 3

14.	I hereby certify that the foregoing is true and correct Signed Larry Higgins	Title Drilling C.O.M. Date 7-2-07
	(This space for Federal or State office use) Approved by Conditions of approval, if any:	Title Acting AFM Date 7/5/07

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.



District I 1625 N French Dr., Hobbs, NM 88240

State of New Mexico
Energy, Minerals & Natural Resources Department

Form C-102 Revised October 12, 2005 Instructions on back

District II 1301 W Grand Avenue, Artesia, NM 88210

OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Submit to Appropriate District Office State Lease - 4 Copies Fee Lease - 3 Copies

District III 1000 Rio Brazos Rd, Aztec, NM 87410

Santa Fe, NM 87505

2007 JUL -2 PM 4: 19
AMENDED REPORT


District IV 1220 S St Francis Dr. Santa Fe, NM 87505

WELL LOCATION AND ACREAGE DEDICATION PLATETON NM

. API Number	72319 / 71599	BLANCO MESAVERDE /	BASIN DAKOTA	
*Property Code 17033		*Property Name ROSA UNIT		
'OGRID No 120782	'Ope WILLIAMS PR	*Elevation 6712		
on let on I Section I Towned		ce Location	County	

or lot no North/South line Feet from the East/West line RIO 34 5W 2450 Ν 31N 880 SOUTH WEST ARRIBA ¹¹ Bottom Hole Location If Different From Surface UL or lot no. Section Range Lot Idn North/South line Feet from the County Feet from the East/West line 12 Dedicated Acres 13 Joint or Infill 14 Consolidation Code 320.0 Acres - W/2(MV) 320.0 Acres - W/2(DK)

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

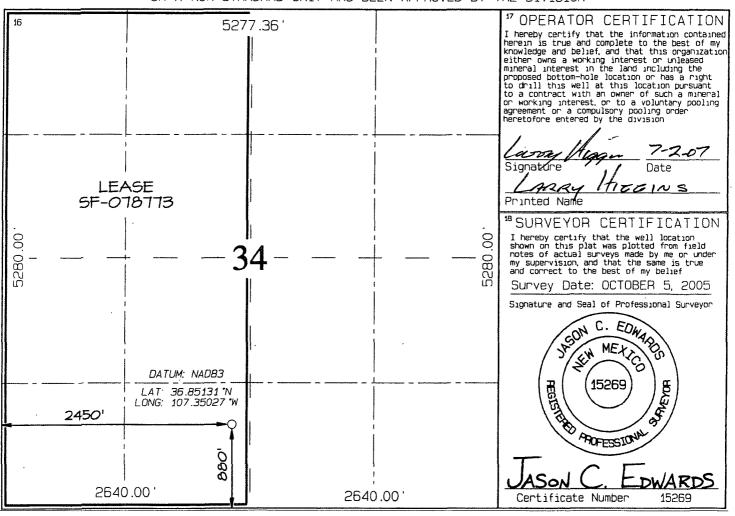



WILLIAMS PRODUCTION COMPANY

Operations Plan

(Note: This procedure will be adjusted on site based upon actual conditions)

DATE:

7/2/2007

FIELD:

Basin DK/ BlancoMV

WELL NAME:

Rosa #188C

Rio Arriba, NM

SURFACE:

USFS

BH LOCATION:

SESW Sec 34-31N-5W

MINERALS:

BLM

ELEVATION:

6,712' GR

LEASE #

SF-078773

MEASURED DEPTH: 8,301'

I. I. GEOLOGY:

Surface formation - San Jose

A. FORMATION TOPS: (KB)

Name	MD	Name	MD
Ojo Alamo	2,801	Menefee	5,771
Kirtland	2,986	Point Lookout	5,976
Fruitland	3,336	Mancos	6,271
Pictured Cliffs	3,571	Gallup	7,196
Lewis	3,846	Greenhorn	7,991
Cliff House	5,721	Graneros	8,036
		Dakota	8,171
		TD	8,301

- B. MUD LOGGING PROGRAM: Mudlogger on location at 100' above Gallup SS to TD. Mud logger to pick TD.
- C. LOGGING PROGRAM: HRI from surface casing to TD. SDL\DSN\DSEN over zones of interest.
- **D.** NATURAL GAUGES: Gauge any noticeable increases in gas flow. Record all gauges in Tour book and on morning reports.

II. DRILLING

- A. <u>MUD PROGRAM</u>: Clear water with benex to 7-5/8" casing point. Convert to a LSND mud to log and run pipe. Treat for lost circulation as necessary. Obtain 100% returns prior to cementing. Notify Engineering of any mud losses. Use air w/Air Hammer from 7-5/8in. csg.to TD.
- B. <u>BOP TESTING:</u> While drill pipe is in use, the pipe rams and the blind rams will be function tested once each trip. The anticipated reservoir is expected to be less than 1300 psi, so the BOPE will be tested to 250 psi (Low) for 5 minutes and 1500 psi (High) for 10 minutes. Utilize a BOPE Testing Unit with a recording chart and appropriate test plug for testing. The drum brakes will be inspected and tested each tour. All tests and inspections will be recorded in the tour book as to time and results.

A. CASING PROGRAM:

CASING TYPE	OH SIZE (IN)	DEPTH (MD) (FT)	CASING SIZE (IN)	WEIGHT(LB)	GRADE
Surface	14 3/4	300	10 3/4	40.5	K-55
Intermediate	9 7/8	4,046	7 5/8	26.4	K-55
Longstring	6 3/4	8,301	5 1/2	17	N-80

B. FLOAT EQUIPMENT:

- 1. <u>SURFACE CASING:</u> 10 3/4" notched regular pattern guide shoe. Run (1) standard centralizer on each of the bottom (4) joints of Surface Casing.
- 2. INTERMEDIATE CASING: 7 5/8" cement nose guide shoe with a self-fill insert float. Place float collar one joint above the shoe. Install (1) Turbulent centralizer on each of the bottom (3) joints and one standard centralizer every (3) joints to 2,500 ft. Run (1) Turbulent centralizer at 2,700 ft., 2,500 ft., 2,300ft., 2,000ft., 1,500 ft., and 1,000 ft. (NTL-FRA 90-1).
- 3. <u>PRODUCTION LINER / CASING:</u> 5-1/2" whirler type cement nose guide shoe with a latch collar on top of 20' bottom joint. Place marker joint above 5,400'. Place centralizers as needed across selected production intervals.

C. CEMENTING:

(Note: Volumes may be adjusted onsite due to actual conditions)

- 1. <u>SURFACE:</u> Slurry: <u>255sx</u> (356 cu.ft.) of "Type III" + 2% CaCl₂ + ½ # of cello-flake/sk (Yield = 1.39 cu.ft./sk, Weight = 14.5 #/gal.). The 100% excess should circulate cement to the surface. WOC 12 hours. Test csg to 1500psi.
- 2. <u>INTERMEDIATE:</u> Lead 700 sx (1,460) cu.ft.) of "Premium Light with 8% gel and 1/4# cello-flake/sk (Yield = 2.09 cu.ft./sk, Weight = 12.1 #/gal.). Tail 100 sx (139cu.ft.) of "Type III" with 1/4# cello-flake/sk, (Yield = 1.4 cu.ft./sk, Weight = 14.5#/gal.). Use 100% excess in Lead Slurry to circulate to surface. No excess in Tail Slurry. Total volume = 1,599 cu.ft. Bump Plug to 1,500 psi. Notify engineering if cement is not circulated to surface.
- 3. <u>PRODUCTION CASING</u>: 10 bbl Gelled Water space. Cement: 205 <u>sx</u> (436 ft³) of Premium Light HS + 1% FL-52 + .2% CD-32, 0.1% R-3, 3 #/sk CSE, ½ #/sk cello flake and 4% Phenoseal. (Yield = 2.15 ft³/sk, Weight = 12.3 #/gal.). Displace cement at a minimum of 8 BPM. The 20% excess in slurry should cover 100 ft into intermediate casing. Total volume 436ft³. WOC 12 hours

IV. IV COMPLETION

A. CBL

1. Run Cement Bond Log across all intervals to be perforated and find Top of Cement behind all casing strings if cement not circulated to surface..

B. PRESSURE TEST

1. Pressure test 5-1/2" casing to 6000 psi max, hold at 1500 psi for 30 minutes.

Rosa #188C MVDK Ops Plan

C. STIMULATION

- 1. Stimulate Dakota with approximately 10.000# of LiteProp 108™ sand in slick water..
- 2. Isolate Dakota with a RBP.
- 3. Stimulate Point Lookout with approximately 9300# of 14/30 LitePropTM in slick water.
- 4. Isolate Point Lookout with a RBP.
- 5. Perforate the Menefee/Cliff House as determined from the open hole logs
- 6. Stimulate with approximately 9300# of 14/30 LiteProp™ in slick water
- 7. Test each zone before removing bridge plugs.

D. RUNNING TUBING

- 1. <u>Dakota</u>: Run 2-1/16", 3.25#, J-55, IJ tubing with 1/2 mule shoe on bottom, SN with pump-out plug on top of adeem joint and 5 Seal Units. Land tubing approximately 100' below top Dakota perf.
- 2. <u>Mesa Verde:</u> Run 2-1/16", 2.9#, J-55, EUE tubing with a SN (1.91" ID) on top of bottom joint. Land tubing approximately 25' above the bottom Point Lookout perforations.

For Sr. Drilling Engineer