

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 04407-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

NE Hogback Unit

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Horseshoe Gallup

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 14-T30N-R16W

12. COUNTY OR PARISH

San Juan

13. STATE

N. Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Water Injection Well	
2. NAME OF OPERATOR Clinton Oil Company	
3. ADDRESS OF OPERATOR P. O. Box 2434 - Casper, Wyoming 82601	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1850' FSL and 1850' FEL	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5368' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Casing: 8-5/8" - set at 207' W/160 sacks cement
5-1/2" - set at 3701' W/130 sacks cement

Perf: 3510' - 3516' Upper Gallup
3591' - 3597' Lower Gallup

Baker Model "N" packer set at 3480'

We propose to squeeze 25 sacks of cement down tubing into perforations

Shoot off 5-1/2" casing. Pull and lay down.

Place cement plug 50' inside 5-1/2" casing stub and 50' above casing stub.

Place 50 sack cement plug from 1925' - 1775' (Pt. lookout 1820'-2271')


Place 30 sack cement plug from 920'-820' (Menefee 275'-1253')

Place 20 sack cement plug from 207'-157'

Place 10 sack cement plug from 30'-GL

Install dry hole marker

Clean up location

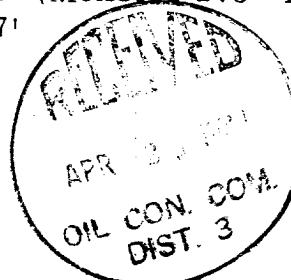

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side