Office	State of	f New Me	exico			Form (Page 1 of 6
<u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources			Revised July 18, 2013 WELL API NO.			
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OH CONGED	WELL API 30-015-228					
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.			5. Indicate	Type of Lea		
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505			STA'		FEE	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa 1	6. State Oil L-2919	& Gas Lea	se No.			
87505 SUNDRY NOT	TICES AND REPORTS O	ON WELLS		7. Lease Na	ame or Unit	Agreement N	ame
(DO NOT USE THIS FORM FOR PROPODIFFERENT RESERVOIR. USE "APPL PROPOSALS.)	OSALS TO DRILL OR TO DE	EPEN OR PLU	JG BACK TO A	SRC KZ Sta 8. Well Nu	ate		
1. Type of Well: Oil Well	Gas Well	Other		1			
2. Name of Operator				9. OGRID 7377	Number		
3. Address of Operator	OG Resources, Inc.						
	3. Address of Operator 104 South Fourth Street, Artesia, NM 88210						
4. Well Location Unit Letter G:	2310 feet from the	North	line and	1650 fee	et from the	East	line
Section 1	Township		nge 24E	NMPM	Eddy	County	
	11. Elevation (Show w	vhether DR,	RKB, RT, GR, etc.)	j	•	
		3672	GK				
12. Check	Appropriate Box to I	ndicate N	ature of Notice,	Report or C	Other Data	l	
NOTICE OF I	NTENTION TO:		l Sur	SEQUENT	r REP∩R	T OF:	
PERFORM REMEDIAL WORK		N 🛛	REMEDIAL WOR			ERING CASIN	G □
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DR				
PULL OR ALTER CASING	MULTIPLE COMPL		CASING/CEMEN	T JOB			
DOWNHOLE COMMINGLE							
CLOSED-LOOP SYSTEM OTHER:			OTHER:				
13. Describe proposed or com of starting any proposed w proposed completion or re	vork). SEE RULE 19.15.		pertinent details, an				
proposed completion of re	completion.						
EOG Resources, Inc. plans to plu	ag and abandon this well a	as follows:					
1. MIRU all safety equipment a	as needed. NU BOP. POC	OH with pro	duction equipment.				
2. Set a CIBP at 2321' with 35				n perfs. WOC	and tag.		
3. Spot a 25 sx Class "C" ceme4. Perforate at 1145'. Spot a 25				over 7" casing	rshoe WO	C and tag Do	rf @ 1014'
5. Perforate at 741'. Spot a 52					g shoe. WO	C and tag. Pe	11 @ 1014
6. Cut off wellhead and install	dry hole marker. Clean lo	cation as pe	er regulated. Per	f @ 360' and	attempt to	circ cmt. to s	<mark>urf</mark>
Wellbore schematics attached.							
	l Rig	Release Da	ite:				
Spud Date:							
		MI		GFD BY 1	/8/2022		
Spud Date: ****SEE ATTACHED CO I hereby certify that the information	OA's****		JST BE PLUG		/8/2022		
****SEE ATTACHED CO	OA's*** n above is true and comple	ete to the be	JST BE PLUG	e and belief.	/8/2022 January 13	, <u>2021</u>	
****SEE ATTACHED CO	OA's*** n above is true and comple	ete to the be	JST BE PLUG est of my knowledg	e and belief DATE	January 13	<u>, 2021</u> : _575-748-4	168_

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing


DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

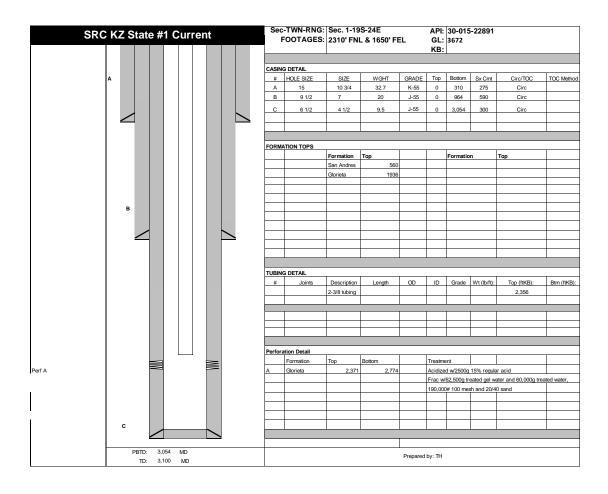

SRC KZ Sta	te #1 Propos	sed			1-19S-24E 2310' FNL & 165	50' FEL		GL:	30-015-22891 3672			
COMMENTS								KB:				
			CASING D									
			#	HOLE SIZE	SIZE	WGHT	GRADE	Тор	Bottom	Sx Cmt	Circ/TOC	TOC Method
			A	15	10 3/4	32.7	K-55	0	310	275	Circ	TOC MEDIOD
			В	9 1/2	7	20	J-55	0	964	590	Circ	
I A			С	6 1/2	4 1/2	9.5	J-55	0	3,054	300	Circ	
4th Plug: SA Top/Sur. Csg. Shoe												
/Surface Plug												
1												
			FORMATIO	ON TOPS								
					FORMATION	TOP			Fromation	TOP		
					San Andres	560						
					Glorieta	1936						
1 1 .												
3rd Plug: Int. Csg. Shoe												
В												
1			L									1
1			-									
1												1
1												
1			Perforation	n Detail						 		+
1			-		Formation	Тор	Bottom		Treatment			1
					Glorieta	2,371	2,774		Acid & frac			
			Plugs	sx	Class	T	Detter		Mara	7		
			1	3	Class	Top 2286	Bottom 2321	35	Notes Glorieta Perfs CIBP + 35	Tag Y		
			2	25	C	1755	2321	362	Glorieta Peris CIBP + 35 Glorieta Top	N N		
			3	25	С	783	1145	362	Int Csg. Shoe	Y		
			4	52	c		741		SA Top/Sur. Cog. Show/Sur. Plug	Y		
			4	52	C	0	/41	/41	SA Top/Sur. Csg. Shoe/Sur. Plug	Y		
1												
1												
1												
1 1												
1												
1 1												
1												
1												
2nd Plug: Glorieta Top			ADDITION	AL DETAIL								
1 1												
1 1												
1												
1 1												
1st Plug: Glorieta Perfs												
1 1												
Glorieta Perfs: 2371' - 2774'												
1 1												
1												
С				Pre	pared by: KJP							
PBTD:	3,054 MD						1/12/202	21				
TD:	3,100 MD						1, 12/202					

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 14620

CONDITIONS OF APPROVAL

Operator:			OGRID:		Action Type:
EOG RESOURCES INC	P.O. Box 2267	Midland, TX79702	7377	14620	C-103F

OCD Reviewer	Condition
gcordero	None