

Gallegos Canyon Unit 102E


Dakota
API # 30-045-26253
T-29N, R-13-W, Sec. 13
San Juan County, New Mexico

Estimated Formation Tops
Ojo Alamo - 210'
Fruitland - 1048'
Pictured Cliffs - 1368'
Cliffhouse - 2968'
Menefee - 3118'
Point Lookout - 3853'
Gallup - 5085'
Dakota - 5946'

Dakota Perforations

5946-5974'
6016-6065'
Fraced w/ 71,780 gal 70Q foam,
78,000# 20/40 brady snd

K.B. 5520'
G.R. 5505'

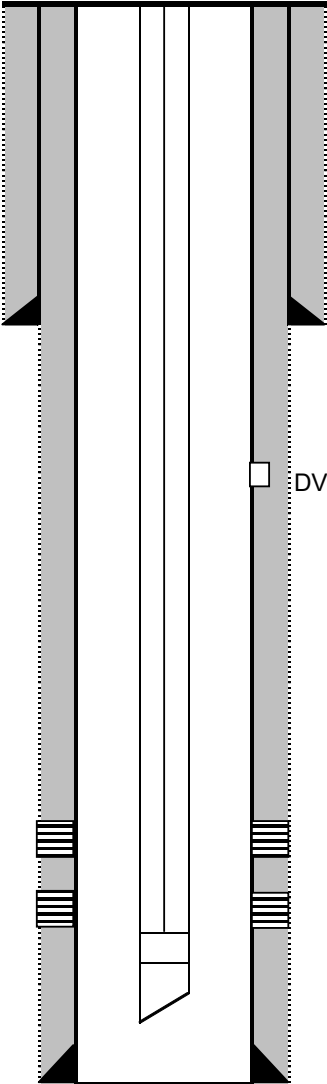

12-1/4" Hole
8-5/8", 24#, K-55 @ 326'
Cmt w/ 248 cu ft Class B
circulated to surface

DV Tool @ 3095'

3/4" Rods
8-1.25" Sinker Bars
2"x1.25"x14 RHAC

1.78" F Nipple @ 6115'
2-3/8" EOT @ 6133'

7-7/8" Hole
4 1/2", 11.6#, K-55 @ 6175"
Cmt w/ 1425
Stage 1: 1231 cu ft Class B
Stage 2: 1556 cu ft Class B
Circulated to surface both stages.

PBTD: 6170'
TD: 6175'

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 408198

CONDITIONS

Operator: SIMCOE LLC 1199 Main Ave., Suite 101 Durango, CO 81301	OGRID: 329736
	Action Number: 408198
	Action Type: [UF-WBS] Wellbore Schematic (WELLBORE SCHEMATICS)

CONDITIONS

Created By	Condition	Condition Date
mkuehling	None	12/3/2024