Operator Copy

DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS

5. Lease Serial No. NMLC069627A

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					141112000002771	
					6. If Indian, Allottee or	Tribe Name
SUBMIT IN TRIPLICATE - Other instructions to A page 2					7. If Unit or CA/Agreement, Name and/or No. 891000303F	
Type of Well     Gas Well	APR 23 2020			8. Well Name and No. POKER LAKE UNIT 240		
Name of Operator     XTO PERMIAN OPERATING	CASSIE EVANS ans@xtoenergy.co			9. API Well No. 30-015-35843-00-S1		
3a. Address 6401 HOLIDAY HILL ROAD B MIDLAND, TX 79707	3b. Phone No. (include area code) Ph: 432-218-3671			10. Field and Pool or Exploratory Area NASH DRAW		
4. Location of Well (Footage, Sec., T.	)			11. County or Parish, State		
Sec 30 T24S R30E NENW 81				EDDY COUNTY, NM		
12. CHECK THE AF	PROPRIATE BOX(ES)	TO INDICATE	NATURE O	F NOTICE,	REPORT, OR OTHI	ER DATA
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	☐ Acidize	□ Deepen	pen Produc		on (Start/Resume)	☐ Water Shut-Off
_	☐ Alter Casing	☐ Alter Casing ☐ Hydraul		□ Reclamation		■ Well Integrity
☐ Subsequent Report	□ Casing Repair	☐ New Co	New Construction		lete	☐ Other
☐ Final Abandonment Notice	☐ Change Plans ☑ Plu		g and Abandon   Tempor		rily Abandon	
	Convert to Injection Plu		g Back			
14. I hereby certify that the foregoing is	operations. If the operation re- andonment Notices must be fil- nal inspection.  Illy submits this sundry for Set open top steel pit for p d pump. ND WH and NU er, RIH workstring. Tag F vorkstring, stand back 2- ? CIBP and dump bailer rid Tag. Circulate 9.5# sal RIH WL. Perf 5-1/2? csg. T/Salt) RIH WL. Perf 5-1/2? csg. ace)  True and correct.  Electronic Submission # For XTO PERMI	sults in a multiple collect only after all request NOI to PA the application of the part o	bove well.  Function test and notify BLM BP and dumplessure test to eeze 55 sxs Cleave 25 sxs Cleave	st BOP.  M. (EOT 7,08 to bail 35? Cl. 500 psi. Class C cmt. Values C cmt. Values C carlsbad	E ATTACHED NDITIONS OF REST.  STORY  WOC &  WELL & N  System	4 must be filed once d the operator has  FOR  APPROVAL
Name (Printed/Typed) CASSIE EVANS				ATORY ANA	,	
Signature (Electronic Submission)			te 04/12/20	020		
ed for record – NMOCD gc 10/2/202	THIS SPACE FO	OR FEDERAL (	OR STATE (	OFFICE US	BE	
Approved By (BLM Approver Not.)	Specified)		itle SP	ST		Date 04/13/2020
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu-	itable title to those rights in the	subject lease	ffice Carlsbac	d		
Title 18 U.S. Section 1001 and Title 43 I States any false, fictitious or fraudulent s	J.S.C. Section 1212, make it a tatements or representations as	crime for any persor to any matter within	knowingly and its jurisdiction.	willfully to mal	ke to any department or ag	gency of the United


Accept

## Additional data for EC transaction #510486 that would not fit on the form

### 32. Additional remarks, continued

8) ND BOP and cut off wellhead 5? below surface. RDMO PU, transport trucks, and pump truck. 9) Set P&A marker. 10) Pull fluid from steel tank and haul to disposal. Release steel tank.

Poker Lake Unit #240 Current and Proposed WBD's

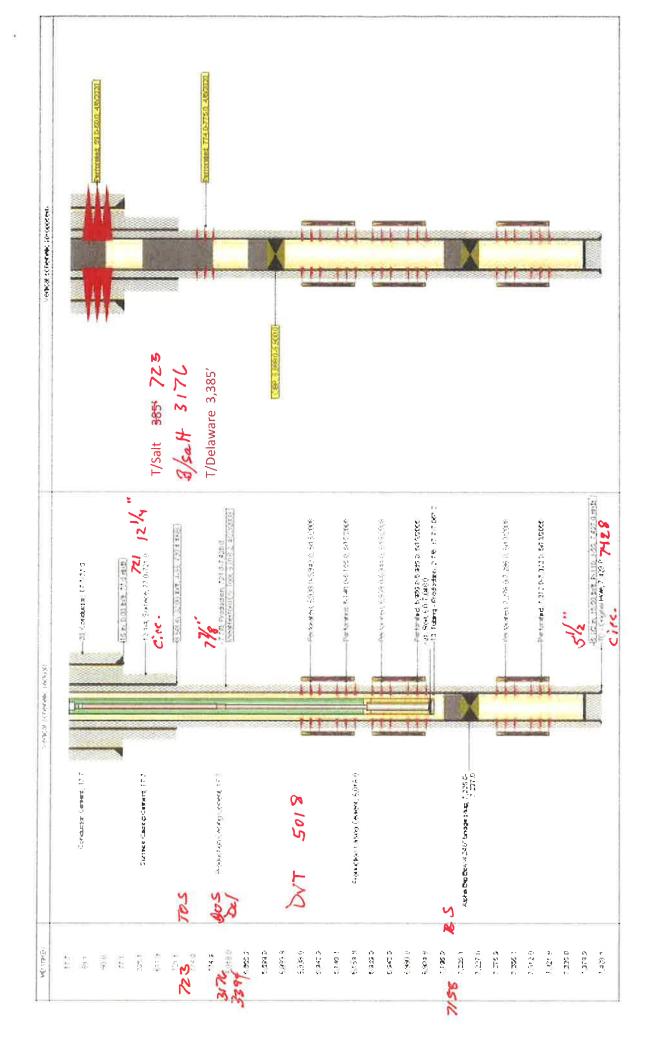

# Well and Notice Remarks

Case IID 891000303F Doc. Type ABD Doc. Number 20DLM0504SE

Well Name

Type 318230

Name POKER LAKE DELAWARE C

300153584300S1

POKER LAKE UNIT

240

Number

XTO PERMIAN OPERATING LLC Operator

Doc. Number 20DLM0504SE

Date 04/13/2020

Author DEBORAH MCKINNEY

Subject ABD

APPROVĂL

APPROVAL Category

04/13/2020 Date XTO Operating LLC respectfully submits this sundry for NOI to PA the above well.

1)MIRU plugging company. Set open top steel pit for plugging.
2)POOH laying down rods and pump. ND WH and NU 3K manual BOP. Function test BOP.
3)RU 2-7/8? x 2-3/8? crossover, RIH workstring. Tag PBTD at 7,225? and notify BLM. (EOT 7,087?).

4)POOH laying down 2-3/8? workstring, stand back 2-7/8; tbg.
5)MIRU WL. RIH WL w/ 5-1/2? CIBP and dump bailer to 5,900?. Set CIBP and dump bail 35? Class C cmt on top of bridge plug. WOC and Tag. Circulate 9.5# salt gel mud and pressure test to 500 psi.
6)POOH w/tbg. RU WL, and RIH WL. Perf 5-1/2? csg. at 775? and squeeze 55 sxs Class C cmt. WOC & Tag at least 325?. (Csg shoe, T/Salt)
7)POOH w/tbg. RU WL, and RIH WL. Perf 5-1/2? csg. at 60? and squeeze 25 sxs Class C cmt. WOC & confirm TOC at Surface. (Surface)
8)ND BOP and cut off wellhead 5? below surface. RDMO PU, transport trucks, and pump

truck

9)Set P&A marker.

10)Pull fluid from steel tank and haul to disposal. Release steel tank.

Approval subject to the following changes:

3. Tag PBTD @ 7225. Spot cmt from 7225-7055 (top of Bone Spring). WOC tag.
Add plug from 5068-4918 (DVT). WOC Tag.
Add plug from 3435-3295 (top of Delaware).
Add plug from 3435-3295 (top of Delaware).
Salt plugs from 3435-3095. WOC tag.
Salt plugs from 3435-3095. WOC tag.
6. Cement from 775-675 (Shoe and top Salt). WOC tag.

J. Amos 4/13/20

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: Ail casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.