	UNITED STATES EPARTMENT OF THE I	NTERIOR OCD ALTES	A DAVIS ON	DRM APPROVED 1B NO. 1004-0137 res: January 31, 2018	
SUNDRY	UREAU OF LAND MANA NOTICES AND REPO	RTS ON WELLS MAR 0	5 2018 5. Lease Serial N NMNM0361		
Do not use the abandoned we	is form for proposals to II. Use form 3160-3 (AP	D) for such proposals.		ttee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well ☑ Oil Well □ Gas Well □ Other				8. Well Name and No. FEDERALES BO 11	
2. Name of Operator Contact:		TINA HUERTA a@eogresources.com	9. API Well No. 30-015-242	9. API Well No. 30-015-24229-00-S1	
3a. Address 105 S 4TH STREET ARTESIA, NM 88210	<u></u>	3b. Phone No. (include area code) Ph: 575-748-4168 Fx: 575-748-4585	10. Field and Poo EAGLE CR	ol or Exploratory Area EEK	
4. Location of Well (Footage, Sec., T., R., M., or Survey Descriptio			11. County or Parish, State		
Sec 23 T17S R25E NWNW 330FNL 990FWL			EDDY COUNTY		
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICATE NATURE O	F NOTICE, REPORT, OR	OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				
Notice of Intent	Acidize	Deepen	Production (Start/Resume	e) 🔲 Water Shut-Off	
	□ Alter Casing	Hydraulic Fracturing	Reclamation	U Well Integrity	
Subsequent Report	Casing Repair	New Construction	C Recomplete	Other	
Final Abandonment Notice	Change Plans	Plug and Abandon Plug Bask	Temporarily Abandon		
13. Describe Proposed or Completed Op	Convert to Injection		U Water Disposal		
Attach the Bond under which the wor	rk will be performed or provide	, give subsurface locations and measure the Bond No. on file with BLM/BIA	red and true vertical depths of all j . Required subsequent reports mu	pertinent markers and zones. ist be filed within 30 days	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f	rk will be performed or provide l operations. If the operation re bandonment Notices must be fi inal inspection.	e the Bond No. on file with BLM/BIA sults in a multiple completion or reco led only after all requirements, includ	. Required subsequent reports mu mpletion in a new interval, a Form	1st be filed within 30 days n 3160-4 must be filed once	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ s well as follows:	. Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been compl	st be filed within 30 days n 3160-4 must be filed once	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft.	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ s well as follows:	. Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been compl	ist be filed within 30 days n 3160-4 must be filed once eted and the operator has	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ s well as follows: on equipment.	Required subsequent reports mu mpletion in a new interval, a Form ing reclamation, have been compl Rifetta value on	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE ATTACHED 3 -5 - 18	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7.	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ s well as follows: on equipment. see step 5. If well does have a	. Required subsequent reports mu mpletion in a new interval, a Form ing reclamation, have been compl RECLA valve on	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOFBURE ATTACHED	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 ir	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ s well as follows: on equipment. see step 5. If well does have a noch casing to 500 psi and circu	. Required subsequent reports mu mpletion in a new interval, a Form ing reclamation, have been compl RECLA valve on	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE ATTACHED 3 -5 - 18	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft.	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. see step 5. If well does have a nch casing to 500 psi and circu C.	. Required subsequent reports mu mpletion in a new interval, a Form ing reclamation, have been compl RECLA valve on	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE ATTACHED 3 -5 - 18	
 Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh was sx class C cement plug from 16. Back fill as needed. 	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO	e the Bond No. on file with BLM/BIA isults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. see step 5. If well does have a nch casing to 500 psi and circu C.	. Required subsequent reports mu mpletion in a new interval, a Form ing reclamation, have been compl RECLA valve on	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE AMAGNED 3-5-18 for record • NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti re on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a s true and correct. Electronic Submission # For EOG Y	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a noch casing to 500 psi and circu C. and surface casing.	Required subsequent reports mumpletion in a new interval, a Forming reclamation, have been complexity of the subsequent reports mumpletion in a new interval, a Forming reclamation, have been complexity of the subsequence o	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE AMAGNED 3-5-18 for record • NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat 14. I hereby certify that the foregoing is Com	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a strue and correct. Electronic Submission # For EOG Y mmitted to AFMSS for proc	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a nch casing to 500 psi and circu IC. and surface casing.	Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been complete RECLA valve on late an 85	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE AMAGNED 3-5-18 for record • NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a strue and correct. Electronic Submission # For EOG Y mmitted to AFMSS for proc	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a nch casing to 500 psi and circu IC. and surface casing.	Required subsequent reports mumpletion in a new interval, a Forming reclamation, have been complexity of the subsequent reports mumpletion in a new interval, a Forming reclamation, have been complexity of the subsequence o	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE AMAGNED 3-5-18 for record • NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a s true and correct. Electronic Submission # For EOG Y nmitted to AFMSS for proc ERTA	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a nch casing to 500 psi and circu IC. and surface casing.	Required subsequent reports mumpletion in a new interval, a Forming reclamation, have been complexity of the second secon	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOFDURE ATTACHED 3 -5 - 1 & for record - NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat 14. I hereby certify that the foregoing is Name (<i>Printed/Typed</i>) TINA HUE	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a s true and correct. Electronic Submission # For EOG Y mitted to AFMSS for proc ERTA	e the Bond No. on file with BLM/BIA soults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a noch casing to 500 psi and circu IC. and surface casing. E402610 verified by the BLM Well RESOURCES INC, sent to the C ressing by PRISCILLA PEREZ of Title REGUL	Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been complete RECLA valve on late an 85	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOFDURE ANTAGINED 3 -5 - 18	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat 14. I hereby certify that the foregoing is Name (<i>Printed/Typed</i>) TINA HUE	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a s true and correct. Electronic Submission # For EOG Y mitted to AFMSS for proc ERTA	e the Bond No. on file with BLM/BIA sults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a nch casing to 500 psi and circu C. and surface casing. t402610 verified by the BLM Well RESOURCES INC, sent to the C ressing by PRISCILLA PEREZ or Title REGUL Date 01/30/20	Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been complete RECLA valve on late an 85	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOF DURE AMAGNED 3-5-18 for record • NMOCD	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab determined that the site is ready for f EOG Y Resources, Inc. plans 1. MIRU all safety equipment 2. RIH with GR/JB to 1238 ft. 3. Set a CIBP at 1228 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh wa sx class C cement plug from 1 6. Back fill as needed. 7. Perforate at 1220 ft. 8. Attempt to establish circulat 14. I hereby certify that the foregoing is Con Name (<i>Printed/Typed</i>) TINA HUE Signature (Electronic S	rk will be performed or provide d operations. If the operation re bandonment Notices must be fil inal inspection. to plug and abandon this as needed. Pull producti e on the surface casing s ater, pressure test 4-1/2 in 1228 ft up to surface. WO tion between production a s true and correct. Electronic Submission # For EOG Y mmitted to AFMSS for proc ERTA Submission) THIS SPACE FO	e the Bond No. on file with BLM/BIA sults in a multiple completion or reco led only after all requirements, includ a well as follows: on equipment. the estep 5. If well does have a much casing to 500 psi and circu C. and surface casing. t402610 verified by the BLM Well RESOURCES NC, sent to the C ressing by PRISCILLA PEREZ or Title REGUL Date 01/30/20 DR FEDERAL OR STATE C	Required subsequent reports mu mpletion in a new interval, a Forn ing reclamation, have been complete RECLA valve on late an 85	Ist be filed within 30 days in 3160-4 must be filed once eted and the operator has MATION PROOFDURE ATTACHED 3 -5 - 18 for record - NMOCD	


Additional data for EC transaction #402610 that would not fit on the form


32. Additional remarks, continued

9. RIH with open ended tubing to 1228 ft and load hole with fresh water and circulate an 85 sx class C cement plug from 1228 ft up to surface. WOC.
10. Back fill as needed.
11. Cut off wellhead and install dry hole marker. Clean up location as per regulated.

Wellbore schematics attached

ł

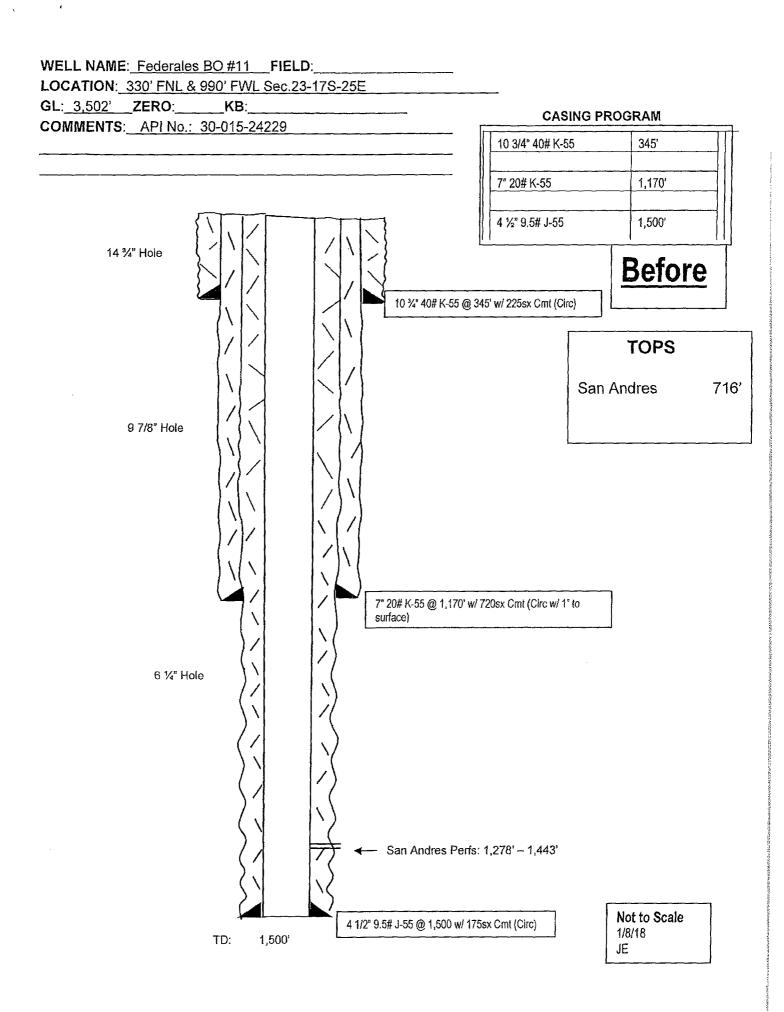

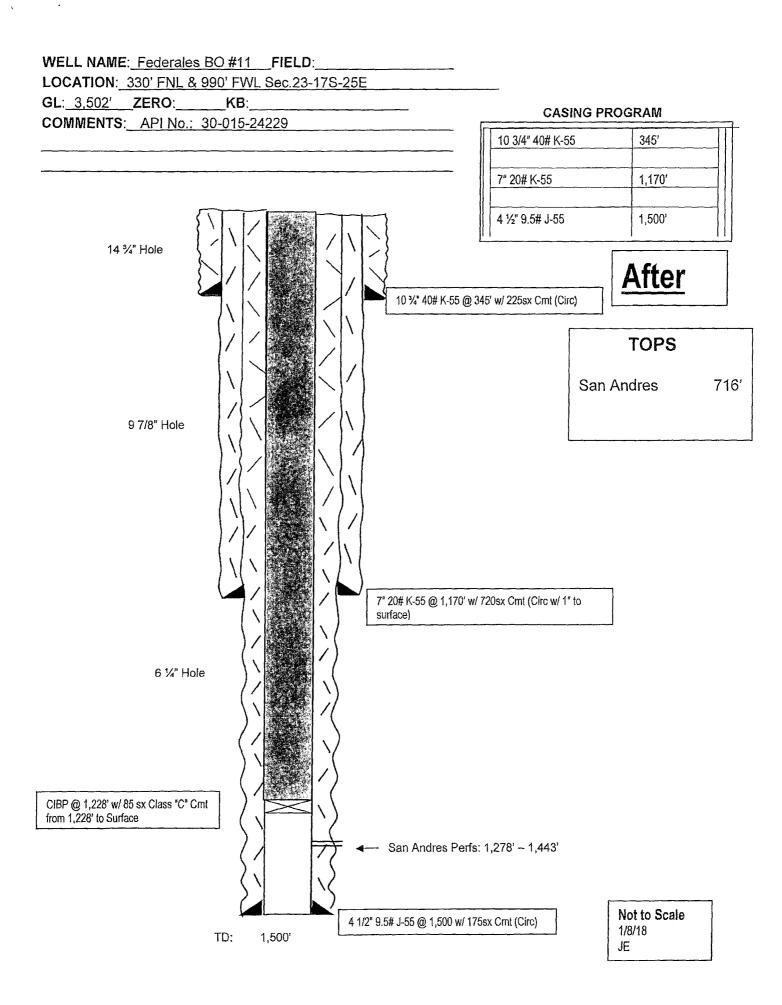

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612