

Submit 3 Copies To Appropriate District Office	Energy, Minerals and Natural Resources		Form C-103 May 27, 2004	
1625 N. French Dr., Hobbs, NM 88240				
1301 W. Grand Ave., Artesia, NM 88210 O	IL CONSERVATION DIV	VISION -	30-015-23220 5. Indicate Type of	1 0000
District III	1220 South St. Francis	Dr.	STATE	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	Santa Fe, NM 87505	; -	6. State Oil & Gas	
1220 S. St. Francis Dr., Santa Fe, NM 87505	,		o. State off & Gus	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			7. Lease Name or Unit Agreement Name Carlsbad Pecos	
PROPOSALS.) 1. Type of Well: Oil Well Gas Well			8. Well Number	
2. Name of Operator Marathon Oil Permian LLC			9. OGRID Number 372098	ſ
3. Address of Operator			10. Pool name or Wildcat	
5555 San Felipe St. Houston, TX 77056			Dublin Ranch Morrow	
4. Well Location		. 		
Unit Letter <u>G</u> : 1980 feet f				
Section 29 Township			1PM Cou	INTY EDDY
11. Ele	evation (Show whether DR, RKI 3042 GL	B, RT, GR, etc.)		
Pit or Below-grade Tank Application 🗌 or Closure			I <u></u>	
Pit typeDepth to Groundwater	Distance from nearest fresh water v	well Dista	nce from nearest surfac	e water
Pit Liner Thickness: mil Belo	w-Grade Tank: Volume	bbls; Con	struction Material	
12. Check Appropr	riate Box to Indicate Natur	e of Notice, F	Report or Other D	Data
TEMPORARILY ABANDON	AND ABANDON 🛛 RE GE PLANS 🗌 CO	MEDIAL WORK		ORT OF: ALTERING CASING PAND A
OTHER:	п от	HER:		
13. Describe proposed or completed ope of starting any proposed work). SEL or recompletion. Not, Supposed Nonco 20	ERULE 1103. For Multiple Co 4 hrs before m:	ompletions: Atta エピリ	ach wellbore diagrar	n of proposed completion
CIBP @ 11,800' w/35sx. 2. $40sx$ @ 10,033' - 9933' Tag. 3. $45sx$ @ 5748' - 5648' P, S & Tag. 4. $55sx$ @ 3017' - 2917' Tag. Note: No	rf@ 6200' + Attempt			
4. $55sx (@. 3017' - 2917' Tag. Note: Not$	thempit to 582	V		RECEIVED
				JUN 1 1 2018
P&A mud between all Plugs. Closed Loop System, all fluids to licensed fac	cility.		DIS	TRICT II-ARTESIA O.C.D.
K See Attached Cor I hereby certify that the information above is grade tank has been/will be constructed or placed acc	true and complete to the best of	MLs ^f fmy knowledge eneral permit □ o	and belief. I further r an (attached) alternat	e 1 5 9 6-11-19 certify that any pit or below- ive OCD-approved plan .
SIGNATURE	TITLE_AC	GENT	l	DATE6/6/2018
Type or print nameBrody Pinkerton E-n	nail address: _Brody@mavericl	kwellpluggers.co	om_Telephone No.	_432-458-3780
For State Use Only				
APPROVED BY:	23 TITLE STAT	A Mgr		DATE <u>6-11-18</u>

Conditions	of	Approval	(if	any)):
		••		• •	

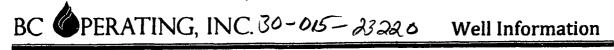

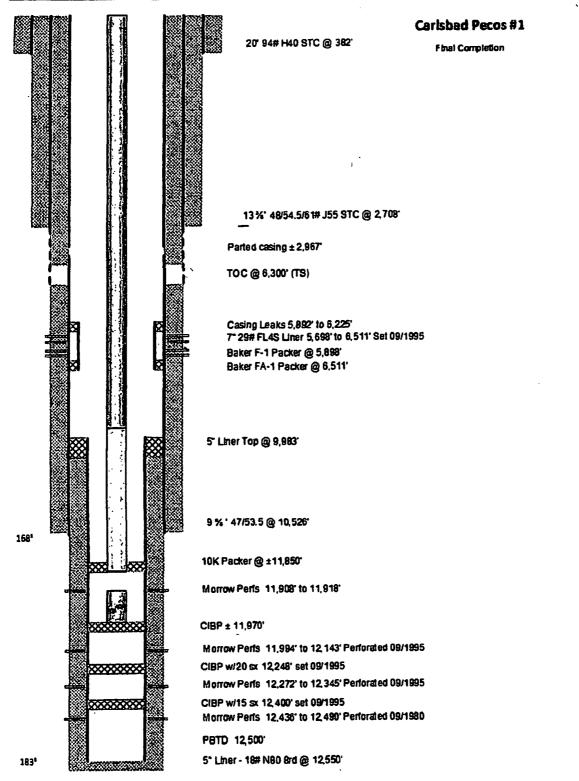

This document contains information that is confidential and proprietary to BC Operating, INC. and should not be disclosed to third parties without prior written permission from BC Operating, Inc.

Carlsbad Pecos #1

Page 9 of 13

September 15, 2016


Before PAA

1

MAVERICK WELL PLUGGERS

COMPANY: Mara Mon Oil WELL NAME: Permian LLC Calsbod Peros WELL #: 1 COUNTY: LEA LEASE ID:

		LIDEACE CAOL					
	WT/FT	GRADE	SET AT	TOC			
20"			387	S. A			
INTERMEDIATE CASING							
OD	· WT/FT	GRADE	SETAT	TOC			
13-3/8"	. 61		2704	Suct			
PRODUCTION CASING							
OD	WT/FT	GRADE	SET AT	TOC			
95/8"	53.5		10526	5.7			
TUBING							
OD	WT/FT	GRADE	SETAT	TAC			
5 "	_18		12550	9983			

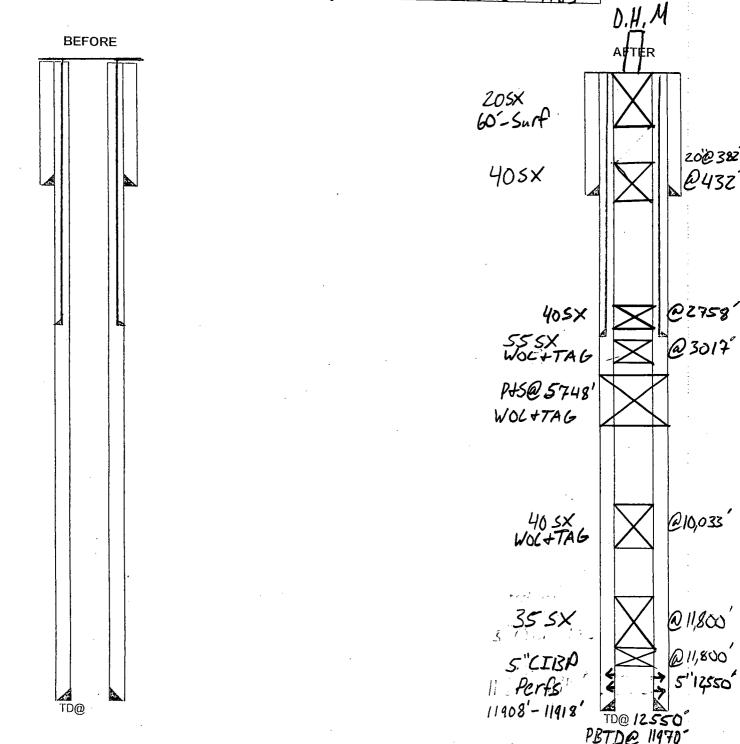

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than **3000' is allowed between cement plugs in cased hole and 2000' in open** hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3. API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)