
Submit I Copy To Appropriate District Office	State of New Mexico	Form C-103
District I - (575) 393-6161	Energy, Minerals and Natural Resource	s Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283		WELL API NO. 30-015-22434
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	5. Indicate Type of Lease
<u>District III</u> - (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE STEE
<u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		
SUNDRY NOT	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR LISE "APPL	OSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	Myox 21 SWD
PROPOSALS.)	ICATION FOR PERMIT" (FORM C-101) FOR SUCH ERVING OIL CONSERVA	Well Number #1
1. Type of Well. Oil Well	Gas Well Other ARTESIA DISTRIC	
2. Name of Operator COG Operating, LLC	SEP 1 3 2018	9. OGRID Number
3. Address of Operator	SEP 13 2010	229137 10. Pool name or Wildcat
600 W. Illinois Ave, Midland, T.	X 79701	Carre D.
4. Well Location	RECEIVED	
Unit Letter E:	1980 feet from the N line and	660 feet from the W line
Section 21	Township 25S Range 28E	NMPM County Eddy
Str. Jak Berg March	11. Elevation (Show whether DR, RKB, RT, GR	
The Contract of the Contract o	2994' GR	
12. Check	Appropriate Box to Indicate Nature of Not	tice, Report or Other Data
NOTICE OF IN	NTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	· · · · · · · · · · · · · · · · · · ·	
TEMPORARILY ABANDON		E DRILLING OPNS. P AND A
PULL OR ALTER CASING		<u> </u>
DOWNHOLE COMMINGLE	l l	
CLOSED-LOOP SYSTEM  OTHER:		m
	Detect operations (Clearly state all pertinent detail	ls, and give pertinent dates, including estimated date
of starting any proposed w	ork). SEE RULE 19.15.7.14 NMAC. For Multiple	e Completions: Attach wellbore diagram of
proposed completion or re-		,
1 C 4 5 1/11 CIPP C 34	001 01 1 1 1 1 1 1 1 1 1	4/0C + /AG
1. Set 5 ½" CIBP @ 34	80'. Circulate hole w/ MLF. Pressure test csg. S <sub>l</sub> 90-2090'. WOC & Tag (DV Tool, Bell Canyon)	pot 25 sx cmt @ 3480-3280'. WOC + TAG
2. Spot 23 3x till (@ 22)	00-800'. WOC & Tag (DV 1001, Bell Canyon)	
	nt @ 582' & circulate to surface.	•
	rify cmt to surface, weld on Dry Hole Marker.	Notify OCD 24 hts. phons
		Any work done.
		Ally Work doile.
		-
p		
Spud Date:	Rig Release Date:	
Spad Bate.	Nig Release Date.	
X-See Attached	CDA'S Mutbe	Place 6 6 9-13-19
I hereby certify that the information	above is true and complete to the best of my know	
•	•	
- 10 A11-	A()	01/10
SIGNATURE Alugar & Prior	algoments TITLE Agent	DATE 9/6/18
Type or print name Abiqui M For State Use Only	entagna al E-mail addressing bornan	dassociates.com PHONE: 432-580-7161
For State Use Only	D man address.	1110HE. 752-00 1161
	-2 1LN	<b>○</b> : <b>○</b> ~
APPROVED BY:	TITLE STATE MY	- DATE 9-13-18
Conditions of Approval (if any):	,	

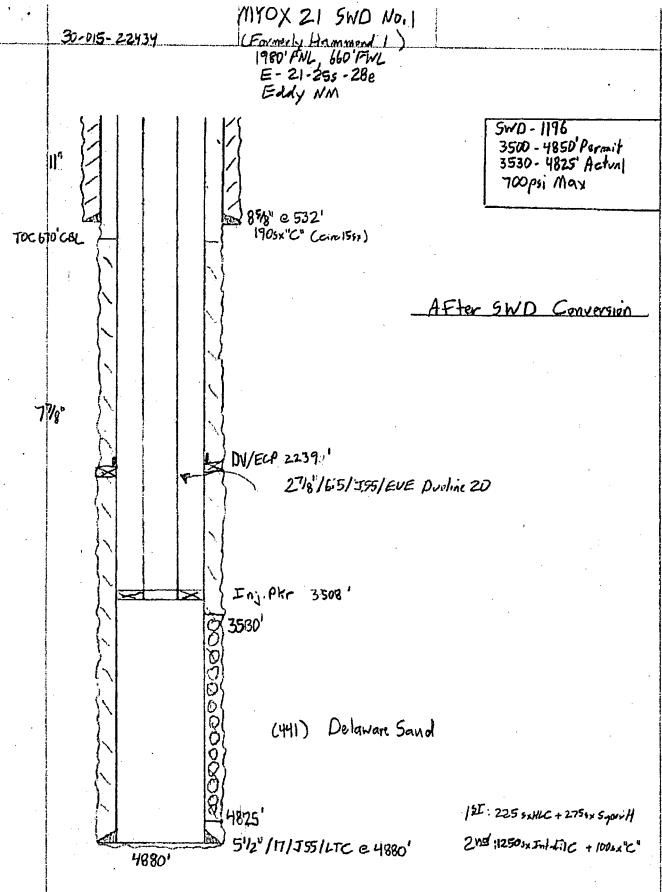

32.1171608

COG O	perating, LLC	
Author:		4
Well Name	Myox 21 SWD	#1
Field		30-015-22434
County	Eddy	
State	New Mexico	Delaware
Spud Date		1980 FNL & 660 FWL
GL	2994.2	Sec 21 T25S R28E


12

13

TD 4880'

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC	Hole
Surface Csg	8 5/8		29	532'	190	surface	11
Prod Csg	5 1/2	J-55	17	4880'	200 CuFt	670' CBL	8

SWD-1196 3500-48500' Permit 3530-4825' Actual 700 PSI May

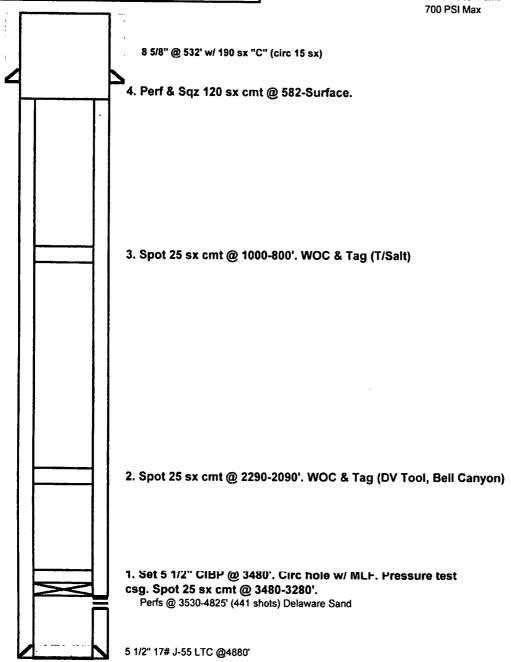

## CONDITIONS FOR PLUGGING AND ABANDONMENT

## District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
  operations are conducted. A cement evaluation tool is required in order to ensure isolation of
  producing formations, protection of water and correlative rights. A cement bond log or other
  accepted cement evaluation tool is to be provided to the division for evaluation if one has not
  been previously run or if the well did not have cement circulated to surface during the original
  casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E) Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - 1) Glorieta
  - J) Yates.
  - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

## DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)