
Submit I Copy To Appropriate District	State of New Mexic	20	Form C-103
Office District I = (575) 393-6161	Energy, Minerals and Natural Resources		Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.
District II - (575) 748-1283	OIL CONSERVATION D	IMEION	30-015-34278
811 S. First St., Artesia, NM 88210			5. Indicate Type of Lease
<u>District III</u> = (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis		STATE S FEE
District IV = (505) 476-3460	Santa Fe, NM 8750)5	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM			
87505			
	ES AND REPORTS ON WELLS	11.42111 12.5.4	7. Lease Name or Unit Agreement Name
	ALS TO DRILL OR TO DEEPEN OR PLUG I ATION FOR PERMIT" (FORM C-101) FOR S		FPR State
PROPOSALS.)		M/CTI	8. Well Number
1. Type of Well: Oil Well 🖂 🤇	Gas Well Other RECE	IVED	
2. Name of Operator			9. OGRID Number
Colgate Operating, LLC			371449
3. Address of Operator	OCT 2	3 2018	10. Pool name or Wildcat
303 West Wall Street, Suite 500	- Midland, Tx 79701		Parkway; Bone Spring
4. Well Location			
Unit Letter P : 660 feet	from the <u>South</u> line and <u>660</u> fee	RTESIA O.C.D.	et line
Section 36 Township 1		County E	
	11. Elevation (Show whether DR, RI	KB, RT, GR, etc.	<i>'</i>
	3326 GR		
12. Check A	ppropriate Box to Indicate Natu	are of Notice,	Report or Other Data
NOTICE OF INT			SEQUENT REPORT OF:
PERFORM REMEDIAL WORK [EMEDIAL WOR	
TEMPORARILY ABANDON	·- I	OMMENCE DR	ILLING OPNS. P AND A
PULL OR ALTER CASING	MULTIPLE COMPL C	ASING/CEMEN	T JOB 🔲
DOWNHOLE COMMINGLE			
CLOSED-LOOP SYSTEM	1		
OTHER:		THER:	
Describe proposed or complete	eted operations. (Clearly state all pert	tinent details, an	d give pertinent dates, including estimated date
		For Multiple Co	mpletions: Attach wellbore diagram of
proposed completion or reco			
2.0	'sx class C ent on	رام الم	
			rently full of 210 bbls of packer fluid) PU and
			VOC. PU and spot a balanced cement plug with
			spot a balanced cement plug with class C
		iss C cement fro	m 300' – 100'. ND BOP. Cut wellhead. Install
dry hole marker. Move out all surface	equipment.		Surfree
		s he.	
	Netty OCD 24 hrs . prio	1 %	
	any work done.		
Spud Date:	Rig Release Date:		
A Hack	1 PA:	wit be P	Pluscel by 10-24-19
Thompson with that the information			
i nereby certify that the information a	bove is true and complete to the best	or my knowledg	ge and belief.
, ,			
SIGNATURE MODELLY	TITLE Operatio	ng Took DAT	E 10/19/2019
SIGNATORE TIES (S)	111.E Operatio	nis reen DAT	L 10/16/2018
Type or print name Mikah Thomas	E-mail address _mthomas a colgates	onerov com Di	HONE 432-695-4272
Type of print name withan rijonias	D-man address _midiomas a consuler	coegy.com_ 11	IONE <u>432-073-4272</u>
For State Use Only			
		L	
APPROVED BY:	en TITLE State	m -	DATE 10-24-18
Conditions of Approval (if any):	2777	-) -	

Prospect:

Parkway Non- Unit


	Location:		
Footage:	660' FSL & 660' FEL		
Section:	36 , T19S, R29E		
Block:	Unit P		
Survey:			
County:	Eddy Co., NM		
Elevations:			
GL: KB: KB Calc:	3,326		
KB:	3,343'		
KB Calc:			
ck w/log?			

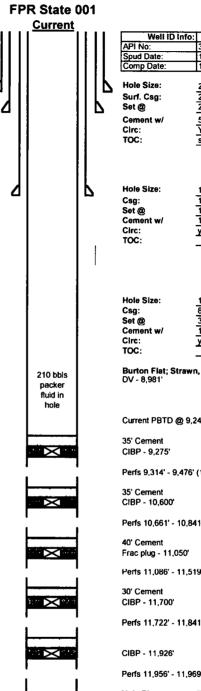

1	l ——— ı		Well ID Info:	
			API No:	30-015-34278
			Spud Date:	11/4/2005
			Comp Date:	1/16/2006
Т]		Hole Size:	26"
]		Surf. Csg:	20", 94# J-55
	1			261'
	1	12	Set @	
	1		Cement w/	550 Sx
	1 1		Circ:	Yes
			TOC:	surface
			Hole Size: Csg: Set @ Cement w/	17 1/2 13 3/8", 54# 8RD 1,562' 11,005 sx
			Circ:	yes
			TOC:	ycs
		1	100:	- · · · ·
	į			
	1		Hole Size:	12 1/4"
			Csg:	8 5/8", 32#
			Set @	3,514
			Cement w/	1,450 sxs
			Circ:	yes
			TOC:	,,,,,
	210 bbls packer fluid in hole		Burton Flat; Strawn DV - 8,981'	ı, East
			Current PBTD @ 9,2	40'
		·	35' Cement CIBP - 9,275'	
	' '	1	Perfs 9,314' - 9,476'	(15 shots)
	\times		35' Cement CIBP - 10,600'	
	·		Perfs 10,661' - 10,84	1' (20 shots)
	\times		40' Cement Frac plug - 11,050'	
	 		Peris 11,086' - 11,51	9' (18 shots)
	× ×		30' Cement CIBP - 11,700'	
	·		Perfs 11,722' - 11,84	1' (112 shots)
			CIBP - 11,926'	
	' ' I		Perfs 11,956' - 11,96	9' (60 shots)
				7 7/8"
	 		Csg:	5 1/2", 17# LT&C
			Set @	12,189'
ٳ	l l		Cement :	1700 Sx
	PBTD 11,9 TD 12,1	926' 190'	Circ:	Yes

Prospect: Parkway Non- Unit

	Location:
Footage:	660' FSL & 660' FEL
Section:	36 , T19S, R29E
Block:	Unit P
Survey:	
County:	Eddy Co., NM
Elevations:	
GL:	3,326
KB:	3,343'
KB Calc:	
ck w/log?	

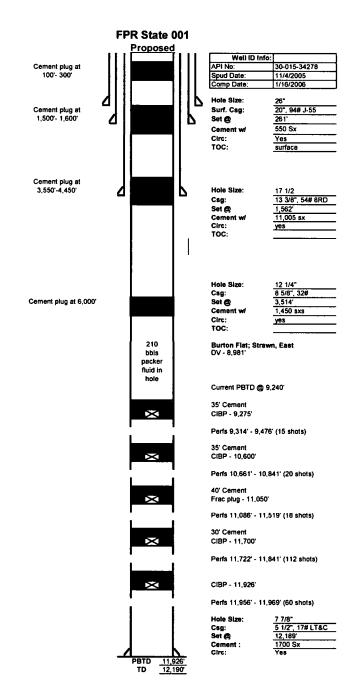

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
 operations are conducted. A cement evaluation tool is required in order to ensure isolation of
 producing formations, protection of water and correlative rights. A cement bond log or other
 accepted cement evaluation tool is to be provided to the division for evaluation if one has not
 been previously run or if the well did not have cement circulated to surface during the original
 casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)