

	ر ب		
Submit 1 Copy To Appropriate District State of New Mexico			Form C-103
<u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources		Revised July 18, 2013
625 N. French Dr., Hobbs, NM 88240 <u>District II</u> - (575) 748-1283 11 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION		WELL API N 30- 015-	
		ISION 5 Indiante T	
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	Aztec NM 87410		E FEE
<u>istrict IV</u> – (505) 476-3460 Santa Fe, NM 87505		6. State Oil &	c Gas Lease No.
87505			
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			ne or Unit Agreement Name
			un 15
1. Type of Well: Oil Well Gas Well Other		8. Well Num	ber 9
2. Name of Operator		9. OGRID N	
OXY USA Inc.			16696
3. Address of Operator P.O. Box 50250 Midland, TX 79710			e or Wildcat
4. Well Location			anyon le kurare
	260 feet from the <u>south</u>	line and 650 feet	from the <u>east</u> line
Section 15	Township 245 Range	RE NMPM	from the <u>east</u> line County Edd 4
	11. Elevation (Show whether DR, RKB		<u> </u>
	2933		<u> (</u>
12 Check An	propriate Box to Indicate Nature	of Notice Depart or Oth	aan Data
		of Notice, Report of Off	her Data
NOTICE OF INT		SUBSEQUENT I	REPORT OF:
PERFORM REMEDIAL WORK			
	MMENCE DRILLING OPNS.] PANDA	
	MULTIPLE COMPL		J ,
	_		
DTHER: 13 Describe proposed or complete	OTH operations (Clearly state all north		
of starting any proposed work	ed operations. (Clearly state all pertine). SEE RULE 19.15.7.14 NMAC. For	• Multiple Completions • Atta	dates, including estimated date
proposed completion or recon	pletion.		
TD-6890' PBTD-6833' Per		ly OCD 24 hrs. prior is)
TD-6890' PBTD-6833' Per	fs-5064-6652'	ony work done.	
10-3/4" 40.5# csg @ 548' w/ !	540sx, 14-3/4" hole, TOC-Surf-Circ		A OIL CONSERVATION
7-5/8" 26.4-29.7# csg @ 2892' w/ 900sx, 9-7/8" hole, TOC-Surf-Circ 4-1/2" 11.6# csg @ 6890', DVT @ 5585' w/ 1070sx, 6-3/4" hole, TOC-2000'-CBL			ARTESIA DISTRICT
			OCT 2 5 2019
	1&P 25sx cmt to 4765' - い ○ C +	Tag	RECEIVED
 2. M&P 30sx cmt @ 3045-2 3. Perf @ 598' sqz 130sx cm 	-		RE-CEAS & Except
	igs - Above ground steel tanks will be	utilized	
oud Date:	Rig Release Date:		
	Rig Release Date.	· · · · · · · · · · · · · · · · · · ·	·
F See Attached	CoAi math	2 Plurced by	10/28/23
ereby certify that the information abo	ove is true and complete to the best of		
$\Lambda \square$			
GNATURE In She	TITLESr. Regu	latory AdvisorDA	ATE 10/23/19
pe or print name <u>David Stewart</u>	_	wid_stewart@oxy.comPH	
	D-man address. <u> </u>	the site waite oxy.com Ph	UTTE. <u>432-003-3717</u>
or State Use Only	^.		/)
PPROVED BY:	TITLE STAH	Mgr	DATE 10/28/19
onditions of Approval (if any):			7
	•		

-

OXY USA Inc. - Proposed Harroun 15 #9 API No. 30-015-30713

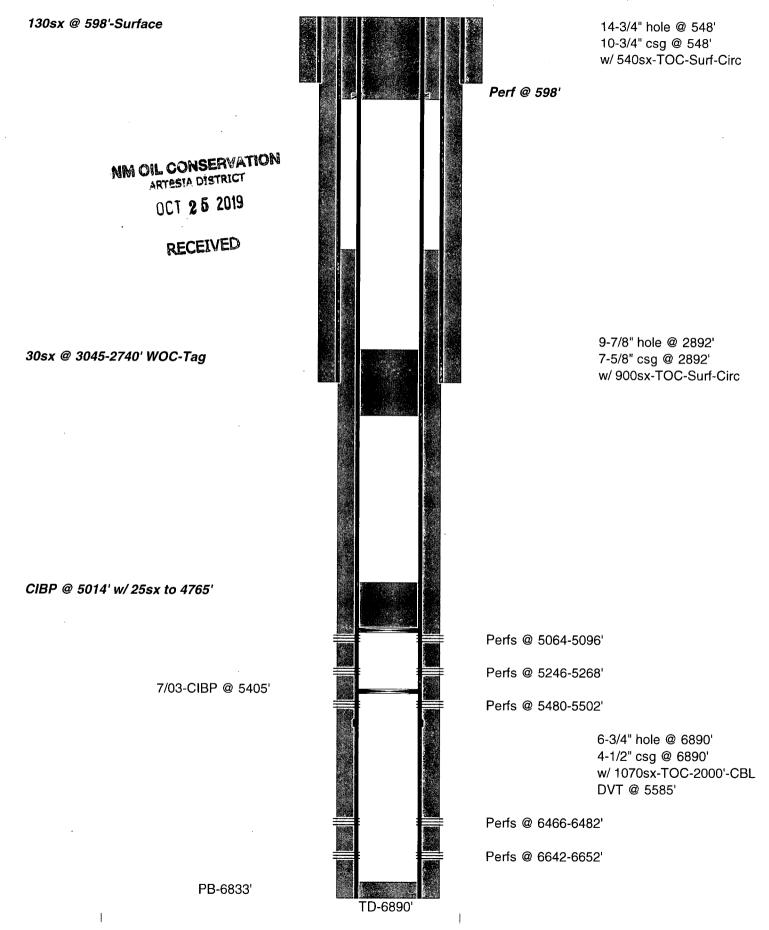

OXY USA Inc. - Current Harroun 15 #9 API No. 30-015-30713

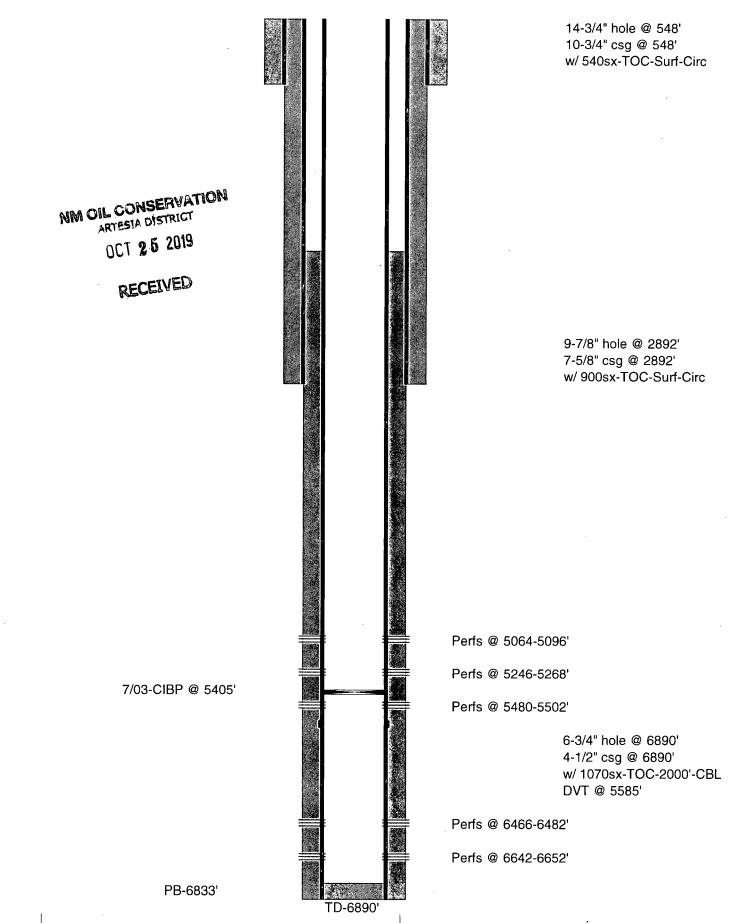

1

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than **3000' is allowed between cement plugs in cased hole and 2000' in open** hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3.API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)