
<b>€</b> Y	Submit 1 Copy To Appropriate District Office District I – (575) 393-6161  State of New Mexico Pistrict I – (575) 393-6161  RECEIVED ergy, Minerals and Natural Received and Natur	esources Revised July 18, 2013
	1625 N. French Dr., Hobbs, NM 88240  District II – (575) 748-1283  FFD 9 1 2018 CONSERVATION FROM	WELL API NO. 30-015-21593
	District II – (575) 748-1283 811 S. First St., Artesia, NM 8821 FEB 2 1 200 L CONSERVATION DIV District III – (505) 334-6178 1000 Rio Brazos Rd., Artes N 87505 District IV – (505) 47	Or. STATE FEE
	<u>District IV</u> – (505) 47 120 NM 87505 1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No.
	SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BA DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUC	7. Lease Name or Unit Agreement Name CK TO A COLONIA A COM
	PROPOSALS.)	8. Well Number #001
	1. Type of Well: Oil Well Gas Well Other  2. Name of Operator	9. OGRID Number
	OXY USA WTP LP	192463
	3. Address of Operator PO BOX 4294, HOUSTON, TX 77210	10. Pool name or Wildcat  CARLSBAD; STRAWN (GAS)
	4. Well Location	
	Unit Letter K : 1650 feet from the SOUTH	line and 1980 feet from the WEST line
	Section 18 Township 22S Range	
	11. Elevation (Show whether DR, RKB)	, R1, GR, etc.)
	12. Check Appropriate Box to Indicate Nature	of Notice, Report or Other Data
	NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
	PERFORM REMEDIAL WORK PLUG AND ABANDON REM	MEDIAL WORK ALTERING CASING
		MMENCE DRILLING OPNS. □ P AND A □
	PULL OR ALTER CASING   MULTIPLE COMPL   CAS DOWNHOLE COMMINGLE	SING/CEMENT JOB
	CLOSED-LOOP SYSTEM	
	OTHER: OTH	
	<ol> <li>Describe proposed or completed operations. (Clearly state all pertine of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For</li> </ol>	ent details, and give pertinent dates, including estimated date. Multiple Completions: Attach wellbore diagram of
	proposed completion or recompletion	
	TD-11,790' PBTD-11,320' Notify Perfs-10,688' – 10,704'; CIBP @11350' w/ 30'cmt to 11320'; Closed-Off Perfs 11,407' – 11,456'	CD 24 Ins. prior to  Try Work stories.  *** SEE ATTACHED COA'S - Revised  *** SEE ATTACHED COA'S - Revised
	13-3/8" 48# csg @ 360' w/ 375sx, 17-1/2" hole, TOC-Surf-Circ	ATTACHED CON
	9-5/8" 36# & 40# csg @ 5273' w/ 1825sx, 12-1/4" hole, TOC-Surf-Circ. 5-1/2" 17# & 20# csg @ 11,790' w/ 1100sx, 8-3/4" hole, TOC-~8200'.	*** SEL
	1. POOH with tubing. RIH & set CIBP @ 10638', Tag - dump bail 35' class h cmt to 10638'	MUST BE PLUGGED BY
_	2. M&P 45sx class h cmt from 10180' to 9840' WOC-Tag 3. M&P 55sx class h cmt from 8733' to 8238' WOC-Tag	W. 01
320	4. Perf at 6902', sqz 265sx class c cmt from 6952' to 6270' WOC-Tag 5. Perf at 5298', sqz 80sx class c cmt from 5323' to 5123' WOC-Tag	
44	6. Perf at 3453', sqx 475sx class c cmt from 3503' to 2035' WOC-Tag  7. Perf at 360', sqx 165sx class c cmt from 410' to Surface	e de la companya del companya de la companya del companya de la co
410	10# MLF between plugs - Above ground steel tanks will be utilized	
	Spud Date: Rig Release Date:	
	Spud Date: Rig Release Date:	
	I hereby certify that the information above is true and complete to the best of i	
	r increase certary that the information above is true and complete to the best of the	my knowledge and belief.
	SIGNATURE SILLI LUE TITLE REGULAT	ORY ADVISOR DATE 2/20/20
	Type or print name LESLIE REEVES E-mail address: LES	SLIE_REEVES@OXY.COM PHONE: 713-497-2492
	For State Use Only	
	APPROVED BY: TITLE STAFF	M. DATE 2/24/20
	Conditions of Approval (if any):	/ <del>/ /</del>

OXY USA WTP LP - Current Colonia A Com #001 API No. 30-015-21593

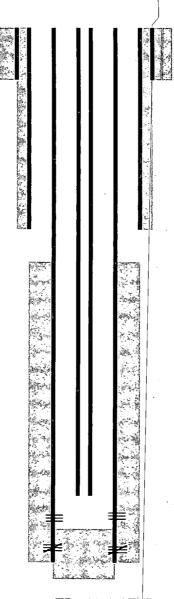

Spud 05/03/1994

17-1/2" hole @ 360' 13-3/8" 48# csg @ 360' w/ 375 sx-TOC-Surf-Circ.

12-1/4" hole @ 5273' 9-5/8" 36# & 40# csg @ 5273' w/ 1825 sx-TOC-Surf-Circ.

8-3/4" hole @ 11790' 5-1/2" 17# & 20# csg @ 11790' w/ 1100 sx-TOC-8200'

2-7/8" tbg @ 10642'

Perfs 10688' - 10704'

Closed off Perfs 11407' - 11456'

PBTD - 11320'

TD - 11790' TVD

OXY USA WTP LP - Proposed Colonia A Com #001 API No. 30-015-21593

Perf at 360' sqz 165sx class c cmt from 410' to Surface

Perf at 3453', sqz 475sx class c cmt from 3503' to 2035' WOC-Tag

Perf at 5238', sqz 80sx class c cmt from 5323' to 5123' WOC-Tag


Perf at 6902', sqz 265sx class c cmt from 6952' to 6270' WOC-Tag

M&P 55sx class h cmt from 8733' to 8238' WOC-Tag

M&P 45sx class h cmt from 10180' to 9840' WOC-Tag

RIH and set CIBP @ 10638', Tag - dump bail 35' classt h cmt to 10603'

PBTD - 11320'

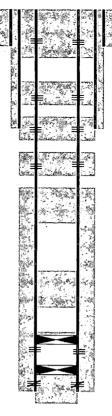

Spud 05/03/1994

17-1/2" hole @ 360' 13-3/8" 48# csg @ 360' w/ 375 sx-TOC-Surf-Circ.

12-1/4" hole @ 5273' 9-5/8" 36# & 40# csg @ 5273' w/ 1825 sx-TOC-Surf-Circ.

8-3/4" hole @ 11790' . 5-1/2" 17# & 20# csg @ 11790' w/ 1100 sx-TOC-8200'

Perfs 10688' - 10704'

CIBP @11350' w/ 30' cmt to 11320' Closed off Perfs 11407' - 11456'

TD - 11790' TVD

## CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E)Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.
  - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

## DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION