

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

RECEIVED Operator MAR 09 2020

EDWARD OGDARTESIA

5. Lease Serial No. NMMN82992
Indian, Allottee or Tribe Name
7. If Unit or CA/Agreement, Name and/or No. 8910123910
8. Well Name and No. BURTON FLAT DEEP UNIT 32
9. API Well No. 30-015-24820-00-S1
10. Field and Pool or Exploratory Area E AVALON
11. County or Parish, State EDDY COUNTY, NM

SUBMIT IN TRIPLICATE - Other instructions on page 2
1. Type of Well [] Oil Well [x] Gas Well [] Other
2. Name of Operator DEVON ENERGY PRODUCTION COMPANY Contact: ARMON RADFAR Email: Armon.Radfar@dvn.com
3a. Address 333 WEST SHERIDAN AVENUE OKLAHOMA CITY, OK 73102
3b. Phone No. (include area code) Ph: 405-552-5014
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec.35 T20S R28E SWSW 330FSL 330FWL

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

Table with 2 columns: TYPE OF SUBMISSION and TYPE OF ACTION. Includes checkboxes for Notice of Intent, Subsequent Report, Final Abandonment Notice, Acidize, Deepen, Production (Start/Resume), Water Shut-Off, etc.

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomplate in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

- 1. MIRU P&A unit.
2. Pull 2-7/8" production tubing assembly from ~5450'.
3. Set CIBP @ 5400'. Tag. Circ 10# salt gel. Spot 25 sx Cl C from 5400'-5150'. (Perfs at @ 5426'; T. Bone Spring @ 5289')
4. Spot 55 sx Cl C from 2825'-2275'. WOC & tag. (T. Delaware @ 2765'; DV tool @ 2537'; Shoe @ 2332')
5. Spot 25 sx Cl C from 1250'-1000'. WOC & tag. (B. Salt @ 1190')
6. Spot 25 sx Cl C from 700'-450'. WOC & tag. (Shoe @ 626'; T. Salt @ 606')
7. Pump Cl C in/out from 140' to surface.
8. Cut wellhead off 3' BGL. Set dry hole marker.

GC 3/13/20 Accepted for record - NMOCD

SEE ATTACHED FOR CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct.
Electronic Submission #500161 verified by the BLM Well Information System For DEVON ENERGY PRODUCTION COM LP, sent to the Carlsbad Committed to AFMSS for processing by DEBORAH MCKINNEY on 01/22/2020 (20DLM0363SE)
Name (Printed/Typed) ARMON RADFAR Title ENGINEER
Signature (Electronic Submission) Date 01/21/2020

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By [Signature] Title SAET Date 2-17-20
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office CFO

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

[Handwritten signature]

DEVON ENERGY PRODUCTION COMPANY LP

Well Name: BFDU 32	Field: Carlsbad North - CC
Location: 30-015-24820-2301WE SEC 35-T20S-R28E	County: Eddy State: New Mexico
Elevation: 5266' @	Spud Date: 6/16/1984 Compl Date: 8/7/1984
API#: 30-015-24820 Prepared by: [Signature]	Date: 1/21/20 Rev:

CURRENT WELLBORE


17-1/2" Hole ✓
 13-3/8", 48#, K-55 @ 626' ✓
 Cmt'd w/600 sx to surface ✓

12-1/4" Hole ✓
 8-5/8", 24#, J-55, @ 2332' ✓
 Cmt'd w/2565 sx to surface ✓

DV tool @ 2537'

Perforations (Bone Spring)
 5426'-5450' ✓

7-7/8" Hole ✓
 5-1/2", 15.5#, J-55, @ 5700' ✓
 Cmt'd w/1800 sx cmt to surface (calc)

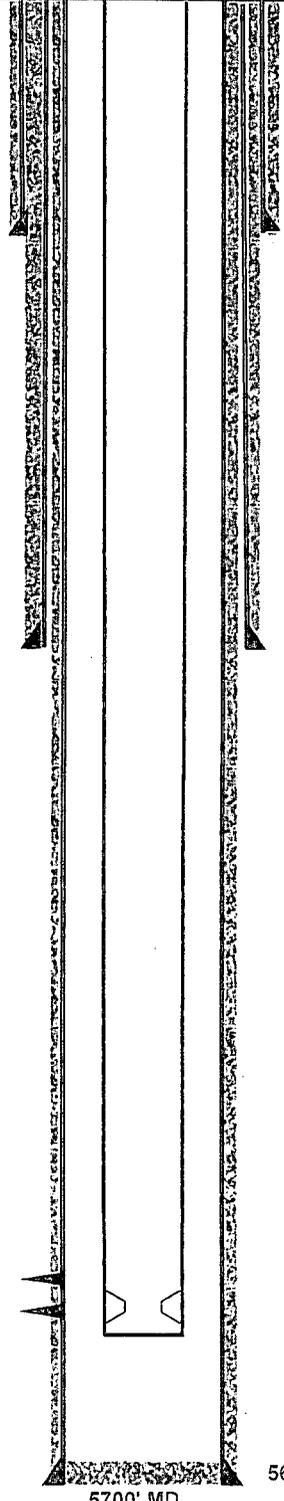

Tubing string: (9/26/04)
 169 Jts, 2-7/8", 6.5#, prod tubing
 SN @ 5450'

5636' PBSD

	APD	Actual
Rustler	285	
Yates	650	
C-Rect	1005	1230
Del	2745	2640
BS	5295	5293

5700' MD

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

Permanent Abandonment of Federal Wells
Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.