

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT - " for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> <i>WTW</i>		5. LEASE DESIGNATION AND SERIAL NO. LC-029419-A	
2. NAME OF OPERATOR The Wiser Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P.O. Box 2568 Hobbs, New Mexico 88241		7. UNIT AGREEMENT NAME Skelly Unit	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FSL & 660' FEL Unit I		8. WELL NAME AND NO. 51	
		9. API WELL NO. 30-015-05348	
		10. FIELD AND POOL, OR WILDCAT Grayburg Jackson 7 Rivers-QN-GB-SA	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22-T17S-R31E	
14. PERMIT NO	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3851' DF	12. COUNTY OR PARISH Eddy	13. STATE NM

16. Check Appropriate Box to indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>

(Other) Plug and Abandon

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT * <input type="checkbox"/>

(Other) \_\_\_\_\_

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS: (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Wiser requests approval to Plug and Abandon the well by the procedure listed below.


Surface Casing: 13-3/8" set @ 202'

Perfs: 3219'-3606'

Production Casing: 8 5/8" set @ 3620'

1. TIH to 3122' and pump 25 sks. cmt. on plug. WOC. Tag.
2. Circulate abandonment mud.
3. POH to 1670'. Pump 30 sks. plug. WOC. Tag.
4. POH to 700'. Pump 30 sks. plug. WOC. Tag.
5. POH to 250' and circ. cmt. to surface.
6. Install dry hole marker.

APPROVAL SUBJECT TO  
GENERAL REQUIREMENTS AND  
SPECIAL STIPULATIONS ATTACHED

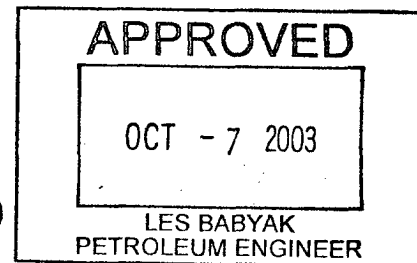

18. I hereby certify that the foregoing is true and correct.

SIGNED [Signature] TITLE Agent for Wiser Oil DATE Sept. 12, 2003

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_

Accepted for record - NMOC

\*See Instruction On Reverse Side

WELL NAME: SU #51

FIELD: Greyburg Jackson 7-RVS-Qn-GB-SA

LOCATION: Unit 1 - 22 - 17S - 31E

COUNTY: Eddy

1980 FSL

660 FEL

TD: 3803

PBD: 3610

GL ELEV: 3851

COMPL: 1/27/1955

## SURFACE CASING

DEPTH	SIZE	WT
202	13 3/8	
GRADE	SACKS	TOC
	230	

Cmt from surface to 250'

9-14-84 2 holes @ 815 cmt w/ 500 sxs C + 2% cc. Circ 40 sxs.

Cmt from 600'-700'

Cmt from 1570'-1670'

Cmt from 3025' to 3122'  
CIBP @ 3122

Perfs 3219'-3606'

CIBP @ 3610 + 1 sx cmt

DATE	FROM	TO	PERFORATIONS		SPF	HOLES
				h		
1/27/1955	3560	3606	46			
7/11/1967	3219	3461	242		1	13
			0			
			0			
			0			
			0			
			0			
			0			
			0			
			0			

PRODUCTION CASING					
DEPTH	SIZE	WT	GRADE	SACKS	TOC
3620	8 5/8	32		1775	

OPEN HOLE			
FROM	TO	DATE	h
3620	3820	7/10/1967	200

gsm  
9/19/2003