District P

1625 N French Dr., Hobbs, NM 88240

District III

1301 W Grand Avenue, Artesia, NM 88210

District IIII

1000 Rio Brazos Road, Aztec, NM 87410

District IV

1220 S St. Francis Dr, Santa Fe, NM 87505

52 ·

State of New Mexico Energy Minerals and Natural Resources

Form C-101 May 27, 2004



Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

submit	to	appropriate	District	Office

☐ AMENDED REPORT

APPL	ICATI	ON FO				E-ENTI	ER, DI	EEPEN	, PLUGE			DD A ZONE		
			•	me and Addre		دس سند نہیں	. 0		;	OGRID Number				
				um Corporation Fourth Street	on	FEB	222	2008		3	025575 API Number			
				Mexico 8821		OCD	-ART	ESIA	30-	30-015-36145 *Well No				
³ Prope	erty Code				Proper Artesia Airp	ty Name ort CF Co	Name rt CF Com 3H							
			9 Proposed Poo Chester	1			¹⁰ Proposed Pool 2 .							
	_				⁷ Surfac	e Locat	ion							
UL or lot no	Section	Townshi	p Range	Lot	ı	from the	North/S	outh line	Feet from the	F	East/West line	County		
E	10	_17S	25E			940'		North	660'		West	Eddy		
, , , , , , , , , , , , , , , , , , ,		T 1			om Hole Lo					1 -				
UL or lot no H	Section 10 ·	Townshi 17S		Lot		from the 980'		outh line orth	Feet from the 660'		East/West line East	County Eddy		
					lditional V		ormatio			·				
1	Type Code w well		12 Well Type G	Code	13 Ca	ible/Rotary R		14	Lease Type Cod P	е	15 Gro	ound Level Elevation 3559'		
¹⁶ M	fultiple N		¹⁷ Proposed TVD 5150' - N		1	Formation olfcamp	-	N	19 Contractor ot Determine	d		²⁰ Spud Date ASAP		
Depth to Grou					e from nearest	resh water	well				arest surface v			
	25'	10 YY 10	2_mils thick Cl	NV Det V		f a mile	Dr.	ulling Met	and:		1100'	<u></u>		
	ed-Loop Sys		Z_IIIIIS UIICK CI	у 🗀 ги 🗸	olume	0018	s Drilling Method: Fresh Water ⊠ Brine □ Diesel/Oil-based □ Gas/Air □							
Close	2d-1200p 3ys	teni 🗀		21 Propos	sed Casing	and Ce				Diesei	/OII-Oased L	Uas/All		
Hole S			Casing Size		g weight/foot		Setting D			f Cemen		Estimated TOC		
17.:		<u> </u>	13.375	Casiii	48#	 	350'		 	0 sx		Surface		
12.2			9.625		36#		1100			5 sx		Surface		
8.7:		F	Pilot Hole	<u> </u>			5400' MVD							
8.7	5		7"	23	# + 26#	5	5250' N	MD	87	5sx		TOC- 600'		
6.2	5	4	.5" Liner		11.6#	8	3983' N	MD	55	0 sx		TOC- 4800'		
Yates Petro casing will perforate as MUD PRO	be the blowed bleum Condesset and and stimula DGRAM: OGRAM	poration of cemental	eeded for prod FW/Spud M O# BOPE wil	any. Use add drill and tes shut off grauction. ud; 350'-11	ditional sheets at the Wolfca avel and cav 00' FW Gel	of necessary mp and it ings. If of /Air Mist	intermed commerc t; 1100'-	diate form cial, prod	nations. Ap luction casir Brine.	proxim ig will	nately 350'			
²³ I hereby ce	rtify that the	e informa	tion given above	is true and co	omplete to the			OIL C	ONSERV	ATIC	N DIVIS	SION .		
constructed	according)	6 NMO	D guidelines [], a general p		R	oved by:				TO A RUTE			
Signature: Printed name	Cy Cowar	J' '				Title.			BRYAN (DISTRIC	<u>s. AK</u> T II (EOLOC	IST		
Title Regula			Tyran b				val Date	325				B2 52010		
E-mail Addre	ess:_cy@yp	cnrn com					er peer					THE STATE OF THE S	16	
Date. 2/2108	3		Phone: (575) 748-4372	2	Condi	tions of A	pproval A	tached 🗌			ENTERIA	Ŋ	

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> 1301 W. Grand Avenue, Artesia, NM 88210

<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico

Energy, Minerals & Natural Resources Department

OIL CONSERVATION DIVISION

1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-102 Revised October 12, 2005

Submit to Appropriate District Office

State Lease - 4 Copies Fee Lease - 3 Copies

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT ² Pool Code ¹ API Number 96086 Wildcat Wolfcamp Well Number ⁴ Property Code ⁵ Property Name Artesia Airport CF Com 3H OGRID No. . 8 Operator Name ⁹ Elevation 025575 Yates Petroleum Corporation 3559 Surface Location UL or lot no. Section Township Range Lot Idn Feet from the North/South line Feet from the East/West line County 1940' Е 10 17S 25E North West Eddy 660' ¹¹ Bottom Hole Location If Different From Surface UL or lot no. Section Township Range Feet from the North/South line East/West line County 1980' North 660' East 10 17S 25E Eddy Η 12 Dedicated Acres ¹³ Joint or Infill ⁴ Consolidation Code ¹⁵ Order No. 320 N/2

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

NM-100834	3	FEE (086)	17 OPERATOR CERTIFICATION I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary fooling agreement or a compulsory pooling order heretofore interest by the division
660°		Rottom 660'	Signature Date Cy Cowan, Regulatory Agent Printed Name
	,		IsSURVEYOR CERTIFICATION I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief. Date of Survey
		·	Signature and Seal of Professional Surveyor REFER TO ORIGINAL PLAT Certificate Number

DISTRICT I 1625 N. French Dr., Hobbe, NM 88240

DISTRICT III

DISTRICT II 811 South Prat, Artesia, NM 88210

1000 Rio Brazos Rd., Aztec, NM 87410

DISTRICT IV 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico

Energy. Minerals and Natural Resources Departmen

Form C-102 Revised March 17, 1999 Instruction on back Submit to Appropriate District Office

State Lease - 4 Copies Fee Lease - 3 Copies

OIL CONSERVATION DIVISION

P.O. Box 2088 Santa Fe, New Mexico 87504-2088

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT

API Number	Pool Code 96086	Pool Name Widcat Wolfcamp						
Property Code	rty Name DRT "CF" COM.	Well Number 3						
. OGRID No.	Elevation							
025575								


Surface Location

UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
Ε	10	175	25E		1940	NORTH	660	WEST	EDDY

Bottom Hole Location If Different From Surface

1	UL or lot No. Section To		Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
ļ	н	10	175	25E		1980	NORTH	660	EAST	EDDY
Dedicated Acres		s Joint o	r Infill Co	nsolidation (Code Or	der No.				L
	320)							


NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

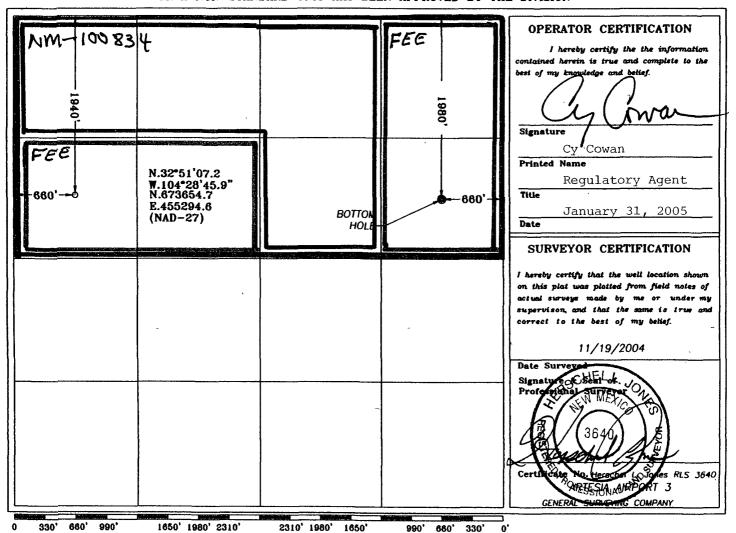




Yates Petroleum Corporation

Typical 3.000 psi Pressure System
Schematic
Annular with Double Ram Preventer Stack

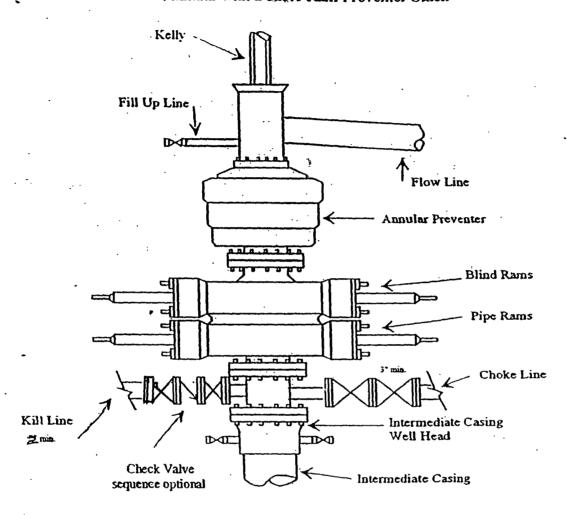

Typical 3,000 psi choke manifold assembly with at least these minimun features

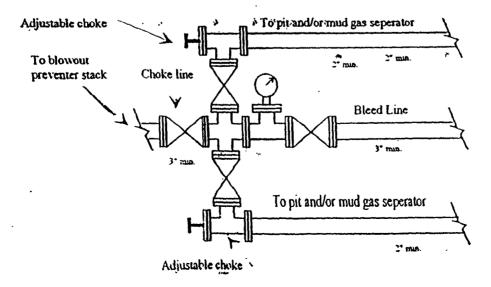


YATIES PETROLEUM

Legals:

ARTESIA AIRPORT CF COM. #3 8,600' WOLFCAMP WELL SECTION 10, T-17-S, R-25-E 1980' FNL 660' FEL EDDY COUNTY, NEW MEXICO

"CONTINGENCY PLAN"

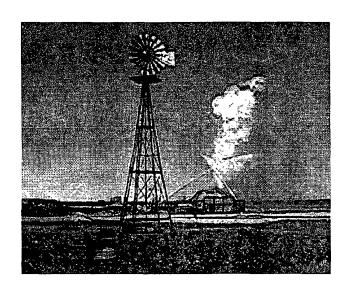

CALLAWAY SAFETY EQUIPMENT CO, INC. 3229 N. INDUSTRIAL DR. HOBBS, NEW MEXICO 88240 (505) 392-2973

Table of Contents

- I. H2S Contingency Plan Section
 - A. Scope
 - B. Objective
 - C. Discussion of Plan
- II. Emergency Procedures Section
 - A. Emergency Procedures
 - B. Emergency Reaction Steps
 - C. Simulated Blowout Control Drills
- III. Ignition Procedures Section
 - A. Responsibility
 - B. Instructions
- IV. Training Program Section
 - A. Training Requirements
- V. Emergency Equipment Section
 - A. Emergency Equipment Requirements
- VI. Check Lists Section
 - A. Status Check List
 - B. Procedural Check List
- VII. Briefing Procedure Section
 - A. Briefing Procedures
- VIII. Evacuation Plan Section
 - A. General Plan
 - B. Emergency Assistance Telephone List
- IX. Maps and Plats Section
 - A. Map showing Well site
 - B. Map showing Public within Radius of Exposure and Evacuation Routes
 - B. Emergency Call List of Residents and Businesses

X. General Information Section

- A. Drilling / Re-entry Permits
- B. 100 ppm Exposure Radius Chart
- C. 500 ppm Exposure Radius Chart
- D. Toxic Effects of Hydrogen Sulfide Poisoning
- E. Use of Self Contained Breathing Apparatus
- F. Rescue-First Aid for Hydrogen Sulfide Poisoning

H2S CONTINGENCY PLAN SECTION

Scope

This contingency plan establishes guidelines for all company employees and contract employees whose work activities may involve exposure to Hydrogen Sulfide gas (H2S).

Objective

- 1. Prevent any and all accidents and prevent the uncontrolled release of H2S into the atmosphere.
- 2. Provide proper evacuation procedures to cope with emergencies.
- 3. Provide immediate and adequate medical attention should an injury occur.

Discussion of Plan

Implementation: This plan, with all details, is to be fully implemented prior to drilling below 1000'.

Emergency Response Procedure: This section outlines the conditions and denotes steps to be taken in the event of an emergency.

Emergency Equipment and Procedure: This section outlines the safety and emergency equipment that will be required for the drilling of this well.

Training Provisions: This section outlines the training provisions that must be adhered to prior to drilling below 1000'.

Emergency Call Lists: Included are the telephone numbers of all persons that would need to be contacted should an emergency occur.

Briefing: This section deals with the briefing of all people involved in the drilling operation.

Public Safety: Public Safety Personnel will be made aware of the drilling of this well.

Check Lists: Status Check Lists and Procedural Check Lists have been included to insure adherence to the plan.

General Information: A general information section has been included to supply support information.

II. EMERGENCY PROCEDURES SECTION

Emergency Procedures

- I. In the event of any evidence of H2S level above 10 ppm, take the following steps immediately:
 - A. Secure breathing apparatus.
 - B. Order non-essential personnel out of the danger zone.
 - C. Take steps to determine if the H2S level can be corrected or suppressed and if so, proceed with normal operations.
- II. If uncontrollable conditions occur, proceed with the following:
 - A. Take steps to protect and / or remove any public downwind of the rig including partial evacuation or isolation. Notify necessary public Safety personnel and Yates Petroleum Corporation, Drilling Superintendent, Jim Krogman of the situation.
 - B. Remove all personnel to the Safe Briefing Area.
 - C. Notify public safety personnel for help with maintaining roadblocks and implementing evacuation.
 - D. Determine and proceed with the best possible plan to regain control of the well. Maintain tight security and safety procedures.

III. Responsibility

- A. The Company Approved Supervisor shall be responsible for the total implementation of the plan.
- B. The Company Approved Supervisor shall be in complete command during any emergency.
- C. The Company Approved Supervisor shall designate a back up Supervisor in the event that he / she is not available.

Emergency Reaction Steps

I. Drilling or Tripping

A. All Personnel

- When alarm sounds, don escape unit and report to upwind Safe Briefing Area
- 2. Check status of other personnel (Buddy System).
- 3. Secure breathing apparatus.
- 4. Await order from Supervisor

B. Drilling Foreman

- 1. Report to the upwind Safe Briefing Area.
- Don breathing apparatus and return to the point of release with the Tool Pusher or Driller (Buddy System).
- 3. Determine the concentration of H2S.
- 4. Assess the situation and take appropriate control measures.

C. Tool Pusher

- 1. Report to the upwind Safe Briefing Area.
- Don breathing apparatus and return to the point of release with the Drilling Foreman or Driller (Buddy System).
- 3. Determine the concentration of H2S.
- 4. Assess the situation and take appropriate control measures.

D. Driller

- 1. Don escape unit.
- 2. Check monitor for point of release.
- Report to the Safe Briefing Area.
- 4. Check the status of other personnel (in a rescue attempt, always use the buddy system).
- 5. Assign the least essential person to notify the Drilling Foreman and Tool Pusher, in the event of their absence.
- 6. Assume the responsibility of the Drilling Foreman and Tool Pusher until they arrive, in the event of their absence.

- E. Derrick Man
 - Remain in the Safe Briefing Area until otherwise instructed by Supervisor.
- F. Mud Engineer
 - 1. Report to Safe Briefing Area.
 - When instructed, begin check of mud for pH level and H2S level.
- G. Safety Personnel
 - 1. Don appropriate breathing apparatus.
 - 2. Check status of all personnel.
 - 3. Await instructions from Drilling Foreman
- II. Taking a Kick
 - A. All personnel report to Safe Briefing Area.
 - B. Follow standard BOP procedures.
- III. Open Hole Logging
 - A. All unnecessary personnel should leave the rig floor.
 - B. Drilling Foreman and Safety personnel should monitor the conditions and make necessary safety equipment recommendations.
- IV. Running Casing or Plugging
 - A. Follow "Drilling or Tripping" procedures.
 - B. Assure that all personnel have access to protective equipment.

Simulated Blowout Control Drills

All drills will be initiated by activating alarm devices (air horn). One long blast, on air horn, for Actual and Simulated Blowout Control Drills. The Drilling Foreman or Tool Pusher will perform this operation at least one time per week for each of the following conditions, with each crew:

Drill 1 Bottom Drilling

Drill 2 Tripping Drill Pipe

In each of these drills, the initial reaction time to shutting in the well shall be timed as well as the total time for the crew to complete its entire pit drill assignment. The times must be recorded on the IADC Driller's Log as "Blowout Control Drill".

Drill No.:				
Reaction time	to shut-in:	minutes,		seconds.
Total time to	complete ass	ignment:	minutes,	seconds.

I. Drill Overviews

- A. Drill No. 1--Bottom Drilling
 - 1. Sound the alarm immediately
 - Stop the rotary and hoist the kelly joint above the rotary table.
 - 3. Stop the circulatory pump.
 - 4. Close drill pipe rams.
 - Record casing and drill pipe shut-in pressures and pit volume increases.
- B. Drill No. 2--Tripping Drill Pipe
 - 1. Sound the alarm immediately
 - Position the upper tool joint just above the rotary table and set slips.
 - 3. Install a full opening valve or inside blowout preventer tool in order to close the drill pipe.
 - 4. Close the drill pipe rams.
 - 5. Record the shut-in annular pressure.

II. Crew Assignments

A. Drill No. 1-Bottom Drilling

1. Driller

- a. Stop the rotary and hoist Kelly joint above the rotary table.
- b. Stop the circulatory pump.
- c. Check flow.
- d. If flowing, sound the alarm immediately.
- e. Record the shut-in drill pipe pressure.
- f. Record all data reported by the crew.
- g. Determine the mud weight increase needed or other courses of action.

2. Derrickman

- a. Open choke line valve at BOP.
- b. Signal Floor Man #1 at accumulator, that choke line is open.
- c. Close choke and upstream valve after pipe tams have been closed.
- d. Read the shut-in annular pressure and report readings to Driller.

3. Floor Man #1

- a. Close the pipe tams after receiving the signal from the Derrickman.
- b. Report to Driller for further instructions.

4. Floor Man #2

- a. Notify the Tool Pusher and Operator Representative of the H2S alarms.
- b. Check for open fires and if safe to do so, extinguish them.
- c. Stop all welding operations.
- d. Turn off all non-explosion proof lights and instruments.
- e. Report to Driller for further instructions.

5. Tool Pusher

- a. Report to the rig floor.
- b. Have a meeting with all crews.
- c. Compile and summarize all information.
- d. Calculate the proper kill weight.
- e. Ensure that proper well procedures are put into action.

6. Operator Representative

- a. Notify the Drilling Superintendent.
- b. Determine if an emergency exists and if so, activate the contingency plan.

B. Drill No. 2-Tripping Pipe

1. Driller

- a. Sound the alarm immediately when mud volume increase has been detected.
- b. Position the upper tool joint just above the rotary table and set slips.
- c. Install a full opening valve or inside blowout preventor tool to close the drill pipe.
- d. Check flow.
- e. Record all data reported by the crew.
- f. Determine the course of action.

2. Derrickman

- a. Come down out of derrick.
- b. Notify Tool Pusher and Operator Representative.
- c. Check for open fires and, if safe to do so, extinguish them.

3. Floor Man #1

- a. Pick up full opening valve or inside blowout preventers and stab into tool joint above rotary table (with Floor Man #2).
- b. Tighten valve with back-up tongs.
- c. Close pipe rams after signal from Floor Man #2.
- d. Read accumulator pressure and check for possible highpressure fluid leaks in valves or piping.
- e. Report to Driller for further instructions.

4. Floor Man #2

- a. Pick-up full opening valve or inside blowout preventers and stab into tool joint above rotary table (with Floor Man #1).
- b. Position back-up tongs on drill pipe.
- c. Open choke line valve at BOP.
- d. Signal Floor Man #1, at accumulator, that choke line is open.
- e. Close choke and upstream valve after pipe rams have been closed.
- f. Check for leaks on BOP stack and choke manifold.
- g. Read annular pressure.
- h. Report readings to the Driller.

5. Tool Pusher

- a. Report to rig floor.
- b. Have a meeting with all crews.
- c. Compile and summarize all information.
- d. Calculate proper kill weight.
- e. See that proper well kill procedures are put into action.

6. Operator Representative

- a. Notify Drilling Superintendent.
- b. Determine if an emergency exists, and if so, activate the contingency plan.

III. IGNITION PROCEDURES SECTION

Responsibility

The decision to ignite the well is the responsibility of the DRILLING FOREMAN in concurrence with the STATE POLICE. In the event the Drilling Foreman is incapacitated, it becomes the responsibility of the RIG TOOL PUSHER. This decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope of controlling the blowout under the prevailing conditions.

If time permits, notify the main office, but do not delay if human life is in danger. Initiate the first phase of the evacuation plan.

Instructions for Igniting the Well

- 1. Two people are required for the actual igniting operation. Both men must wear self-contained breathing apparatus and attach a safety rope. One man must monitor the atmosphere for explosive gases with the Explosimeter, while the Drilling Foreman is responsible for igniting the well.
- 2. The primary method to ignite is a 25mm flare gun with a range of approximately 500 feet.
- 3. Ignite from upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best suited for protection and which offers an easy escape route.
- 5. Before igniting, check for the presence of combustible gases.
- 6. After igniting, continue emergency actions and procedures as before.
- 7. All unassigned personnel will limit their actions to those directed by the Drilling Foreman.

NOTE: After the well is ignited, burning Hydrogen Sulfide will convert to Sulfur Dioxide, which is also highly toxic. Do not assume the area is safe after the well is ignited.

IV. TRAINING PROGRAM SECTION

Training Requirements

When working in an area where Hydrogen Sulfide gas (H2S) might be encountered, definite training requirements must be carried out. The Company-Supervisor will insure that all personnel, at the well site, have had adequate training in the following:

- 1. Hazards and characteristics of H2S.
- 2. Physical effects of Hydrogen Sulfide on the human body.
- 3. Toxicity of Hydrogen Sulfide and Sulfur Dioxide.
- 4. H2S detection.
- 5. Emergency rescue.
- 6. Resuscitators.
- 7. First aid and artificial resuscitation.
- 8. The effects of H2S on metals.
- 9. Location Safety.

Service company personnel and visiting personnel must be notified in the zone contains H2S. Each service company must provide adequate training and equipment for their employees before they arrive at the well site.

V. EMERGENCY EQUIPMENT SECTION

Emergency Equipment Requirements

- I. Signs
 - A. Located at the location entrance with the following information:

CAUTION - POTENTIAL POISON GAS HYDROGEN SULFIDE NO ADMITTANCE WITHOUT AUTHORIZATION

- II.* Fresh air breathing equipment
 - A. Air line units for all rig personnel on location.
 - B. Cascade system with hose lines to rig floor and one to the derrickman and other operation areas. Spare cascade (trailer) on location.
- III. Wind Socks or Wind Streamers
 - A. Two 10" windsocks located at strategic locations at a height visible from the rig floor.
 - B. Wind streamers (if preferred) to be placed at various locations on the well site to insure wind consciousness at all times. (Corners of location).
- IV. Hydrogen Sulfide detector and alarms.
 - A. 1 four channel H2S monitor with alarms.
 - B. 4 Sensors, located at floor, bell nipple, shale shaker and pits.0
 - * C. Hand operated detectors with tubes.
 - * D. H2S monitor tester.
- V. Condition sign and flags
 - A. One each of green, yellow and red condition flags to be displayed to denote conditions:

GREEN Normal Conditions
YELLOW Potential Danger
RED Danger, H2S Present

- B. The condition flag shall be posted at the location entrance.
- VI.* Auxiliary rescue equipment
 - A. Stretcher
 - B. Two 100' lengths of 5/8" nylon rope.
- VII.* Mud Inspection devices
 - A. Garrett Gas Train or Hach Tester for inspection of Hydrogen Sulfide concentration in the mud system.
- VIII. Fire Extinguishers
 - A. Adequate fire extinguishers shall be located at strategic locations.
- IX. Blowout prevention equipment
 - A. The well shall have hydraulic BOP equipment for the anticipated BHP.
 - B. Equipment must be tested upon installation.
- X.* Combustible gas detectors
 - A. There shall be one combustible gas detector on location at all times.

- XI. BOP Testing
 - A. BOP, Choke Line and Kill Line will be tested as specified by operator
- XII. Audio System
 - A. Radio communications shall be available at the rig.
 - B. Radio communications shall be available at the riq floor or trailer.
 - C. Radio communications shall be available on vehicles.
- XIII. Special control equipment
 - A. Hydraulic BOP equipment with remote control on ground.
 - B. Rotating head at surface casing point.
- XIV. Evacuation Plan
 - A. Evacuation routes should be established prior to spudding each well.
 - B. Should be discussed with all rig personnel.
- XV. Designated Areas
 - A. Parking and visitor area.
 - All vehicles are to be parked at a pre-determined safe distance from the wellhead.
 - 2. Designated smoking area.
 - B. Safe Briefing Area
 - Two Safe Briefing Areas shall be designated on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds or they are at a 180 degree angle if wind directions tend to shift in the area.
 - 2. Personal protective equipment should be stored in both protection centers or if a moveable trailer is used, it should be kept upwind of existing winds. When wind is from the prevailing direction, both protection centers should be accessible.
 - *Additional equipment will be available at Callaway Safety Equipment Co., Inc., 3229 N. Industrial, Hobbs, New Mexico (505) 392-2973
 - Additional personal Hydrogen Sulfide monitors on location for all hands.
 - Automatic Flare igniter installed on rig.

VI. CHECK LIST SECTION

Status Check List

NOTE:	: Date each item as they are implemented.	
1.	Sign at location entrance	
2.	Two (2) windsocks (in required locations)	
3.	Wind streamers (if required)	
4.	30 minute pressure demand air packs on location for all rig personnel and mud loggers.	
5.	Air packs, inspected and ready for use.	
6.	Spare bottles for each air pack (if required)	
7.	Cascade system and hose line hook up	
8.	Cascade system for refilling air bottles	
9.	Choke manifold hooked up and tested (Before drilling out surface casing)	
10.	Remote Hydraulic BOP control (hooked up and tested before drilling out surface casing)	
11.	BOP Preventer tested (before drilling out surface casing)	
12.	Mud engineer on location with equipment to test mud for Hydrogen Sulfide	
13.	Safe Briefing Areas set up	
14.	Condition sign and flags on location and ready	
15.	Hydrogen Sulfide detection system hooked up	
16.	Hydrogen Sulfide alarm system hooked up	
17.	Stretcher on location at Safe Briefing Area	
18.	1 - 100' length of 5/8" nylon rope on location	
19.	1 - 20 # or 30 # ABC fire extinguisher in safety trailer in addition to those on rig	
20.	Combustible gas detector on location and tested	

D

21.	All rig crews and supervisors trained (as required)	
22.	Access restricted for unauthorized personnel	
23.	Drills on H2S and well control procedures	
24.	All outside service contractors advised of potential Hydrogen Sulfide on well	
25.	NO SMOKING sign posted	
26.	Hand operated H2S detector with tubes on location	
27.	25 mm flare gun with flares	
28.	Automatic Flare igniter installed on rig	

Procedural Check List

Perform the following on each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to insure that it has not been tampered with.
- Check pressure on supply air bottles to see that they are capable of recharging.
- 4. Make sure all of the Hydrogen Sulfide detection systems are operative.

Perform the following each week:

- 1. Check each piece of breathing equipment to make sure that the demand regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you get air.
- 2. Blowout preventer skills.
- 3. Check supply pressure on BOP accumulator stand-by source.
- 4. Check all work/escape units for operation: demand regulator, escape bottle air volumes, and supply bottle air volume.
- Check breathing equipment mask assembly to see that straps are loosened and turned back.
- 6. Check pressure on breathing equipment air bottles to make sure they are charged to full volume.
- 7. Check breathing equipment air bottles to make sure all demand regulators are working. This requires that the bottles be opened and the mask assembly be put on tight enough so that when you inhale, you get air.
- 8. Confirm pressure on all supply air bottles.
- 9. Perform breathing equipment drills with on-site personnel.

Check the following supplies for availability:

- a. Stretcher
- b. Safety belts and ropes
- c. Emergency telephone lists
- d. Spare air bottle
- e. Spare oxygen bottles (if resuscitator required)
- f. Hand operated H2S detectors and tubes
- 10. Test the Explosimeter to verify batteries are good.

VII. BRIEFING PROCEDURE SECTION

Briefing Procedures

The following scheduled briefings will be held to insure the effective drilling and operation of this project:

Pre-Spud Meeting

Date: Prior to spudding the well

Attendance: Drilling Supervisor

Drilling Engineer
Drilling Foreman
Rig Pushers
Rig Driller
Mud Engineer

All Safety Personnel Service Companies

Purpose: Review and discuss the well program, step by step, to insure

complete understanding of assignments and responsibilities.

VIII. EVACUATION PLAN SECTION

General Plan

The direct lines of action prepared by CALLAWAY SAFETY EQUIPMENT CO., INC. to protect the public from hazardous gas situations are as follows:

- 1. When the company approved supervisor (Drilling Foreman, Tool Pusher, Driller) determine Hydrogen Sulfide gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan. Escape routes are noted on the Area map.
- 2. Company safety personnel or designee will notify the appropriate local government agency that a hazardous condition exists and evacuation needs to be implemented.
- Company approved safety personnel that have been trained in the use of Hydrogen Sulfide detection equipment and self-contained breathing equipment will be utilized.
- 4. Law Enforcement personnel (State Police, Sheriff's Department, local Police Department and local Fire Department) will be called to aid in setting up and maintaining roadblocks. Also, they will aid in evacuation of the public if necessary.

NOTE: Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

5. After the discharge of gas has been controlled, "Company" safety personnel will determine when the area is safe for re-entry.

See Emergency Reaction Plan

EMERGENCY ASSISTANCE TELEPHONE LIST

PUBLIC SAFETY				
Artesia P.D. Eddy County Sheriff's D New Mexico State Police Artesia Fire Department New Mexico OCD (Tim Gum New Mexico D.O.T. U.S. Dept. of Labor YATES PETROLEUM CORPORA)	(505) (505) (505) (505) (505)	746-5000 746-9888 748-9718 885-5050 748-1283 827-5100 248-5302	or 911 or 911
TAIDS FEIROLEON CORFORA	IION			
Jim Krogman	Drilling Superintendent	(505)	748-4215 365-8340 746-2674	(mobile)
Tim Bussell	Assistant Drilling Sup.	(505)	748-4221 365-5695 746-2121	(mobile)
POTENTIALLY AFFECTED AR	EAS			
Artesia Municipal Airpo		(505)	746-3206	
FLETC (Gloria Vaught) SAFETY CONTRACTOR	Safety Chief	(505)		(work) (cellular) (security)
Callaway Safety Equipme	nt	• •	392-2973 561-5049	•

Affected Public Notification List

(within a 65' radius of exposure @ 100 ppm)

The geologic zones that will be encountered during drilling are known to contain hazardous quantities of H2S. The accompanying map illustrates the affected areas of the community. The residents within this radius will be notified via a hand delivered written notice describing the activities, potential hazards, and conditions of evacuation, evacuation drill siren alarms and other precautionary measures.

Evacuee Description: Residents

Notification Process: A continuous siren audible to all residents will

be activated; signaling evacuation of previously


notified and informed residents.

Evacuation Plan: All evacuees will migrate lateral to the wind

direction.

The Oil Company will identify all homebound or highly susceptible individuals and make special evacuation preparations, interfacing with the local fire and emergency medical services as necessary.

IX. MAPS AND PLATS SECTION



3229 INDUSTRIAL DR HOBBS, NEW MEXICO 88240

SAM D CALLAWAY

505 392-2973

AIRPORT CF COM. #3

To whom it may concern,

Based on information from prior wells drilled in this area, there were no reportable quantities of Hydrogen Sulfide (H2S) associated with these wells.

However, as a precautionary measure, a mock survey of the well to be drilled was done utilizing 100 ppm and 500 ppm readings at the wellhead with a 2100 mcf/day back pressure flow rate. The results of these mock surveys showed the radius of exposure was significantly less than the 3000' utilized under NM OCD Rule 118 for a wildcat well or a well with no other comparable data to utilize for a survey purposes.

Callaway Safety Equipment

Location	Date	Sample Point	H2S Tube (PPM) or Tutwiler (PPM)	Estimated Zero Back pressure FLOW RATE cubic fect/day	Estimated Zero Back pressure FLOW RATE met/day	Estimated Zero Back pressure FLOW RATE mmcf/day	100 ppm Radius of Exposure-feet from source	500 ppm Radius of Exposure-feet from source
Airport CIF Com #3	3 3/8/2005 wildcat 100		100	2,100,000	2,100	2.10	37.94	17.34
		<u> </u>						
							ļ	
		 					 	
		 						·····
		<u> </u>				-		· · · · · · · · · · · · · · · · · · ·
		ļ					ļl	· · · · · · · · · · · · · · · · · · ·
		 					 	
		+						
		 						
							†	
								
		1	1			1	1 1	

3229 Industrial Drive Hobbs, NM 88240 505-392-2973

Callaway Safety Technician


AY SAFETY

5853924998

T G G

84

3229 Industrial Drive Hobbs, NM 88240 505-392-2973

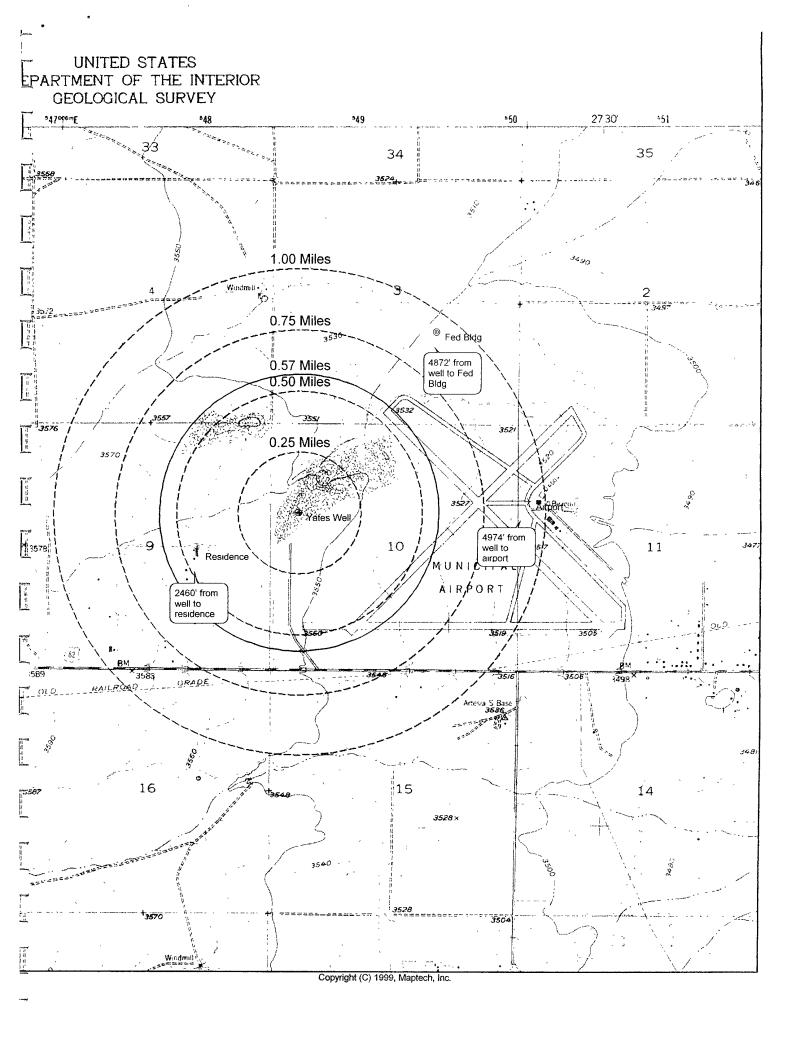

3800 3750 3700 3650 3600

Miles

Total distance: 2460 feet

round distance:

2461 feet

Climbing: Descending: Elevation change: Min/Max:


23 feet -7 feet

16 feet 3549/3572 Latitude: Longitude: Elevation:


Grade:


032° 51' 7.96" N 104° 28' 48.02" W


3556 feet 0%

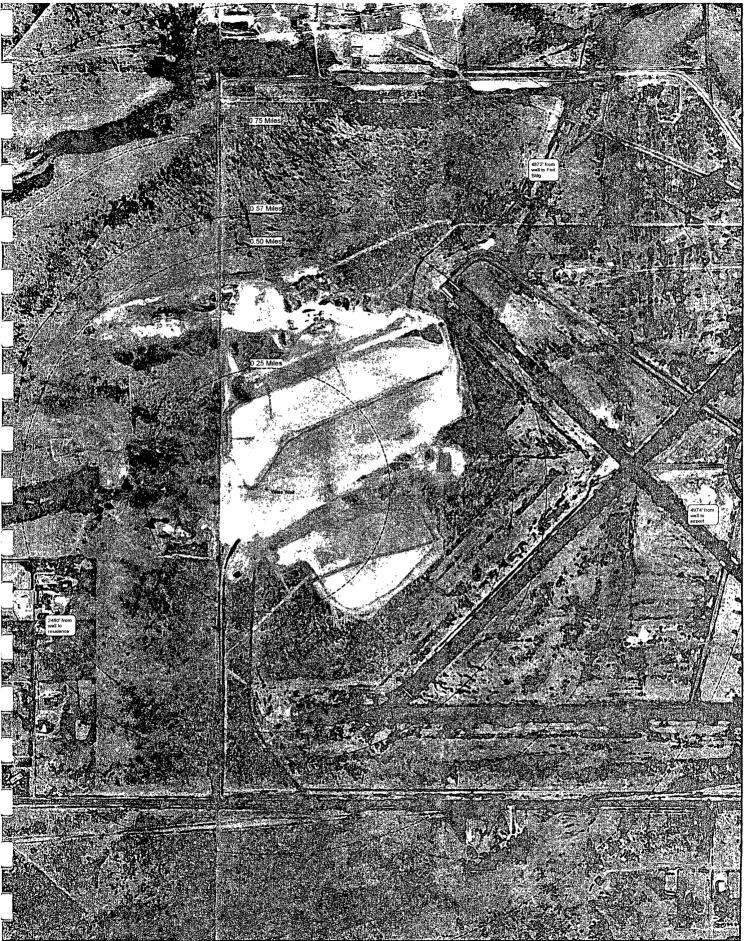

Copyright (C) 2002, Maptech, Inc

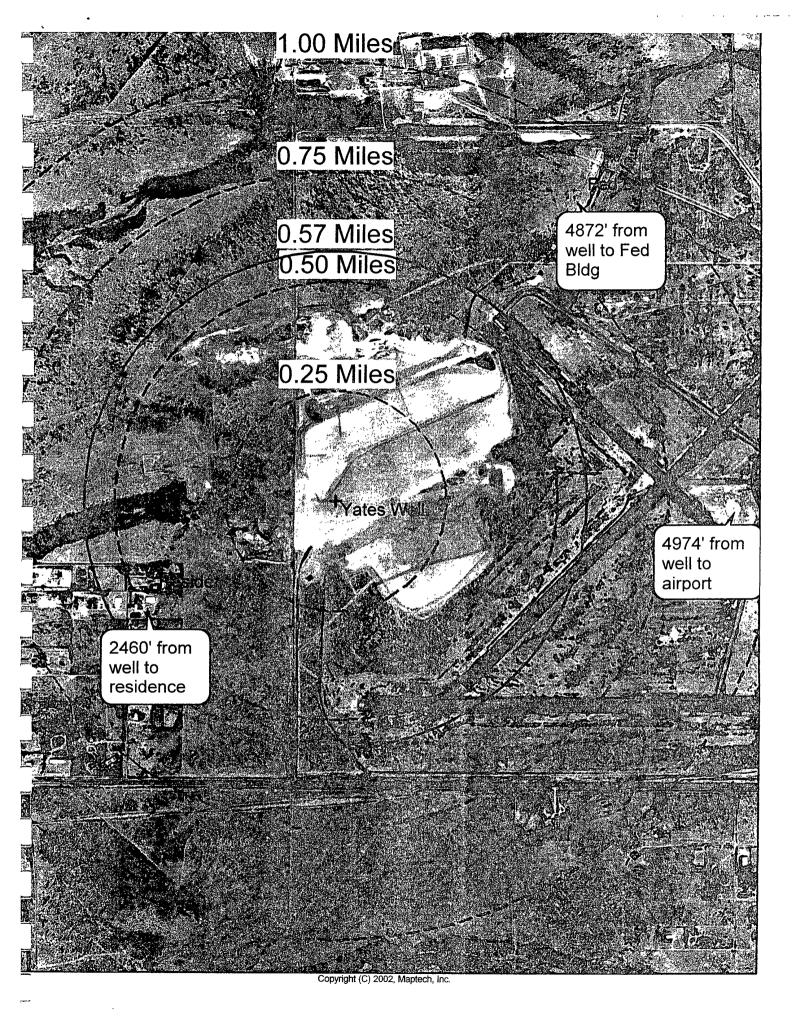

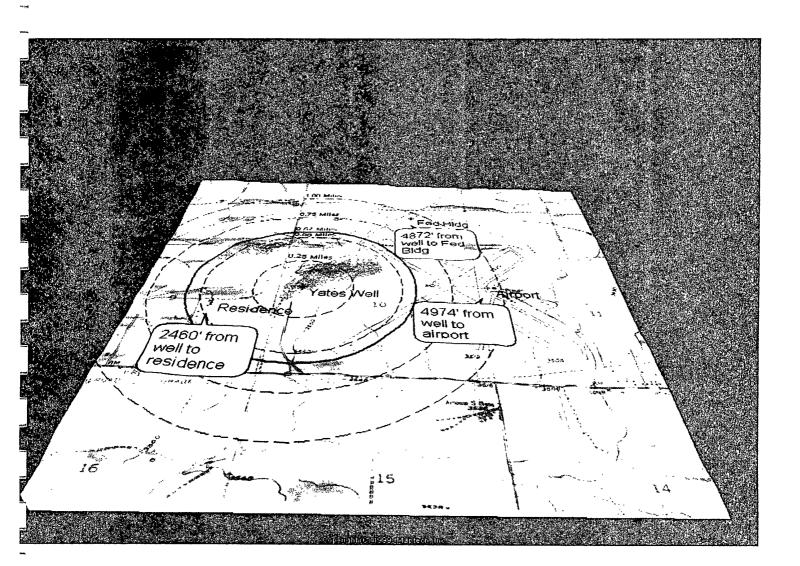

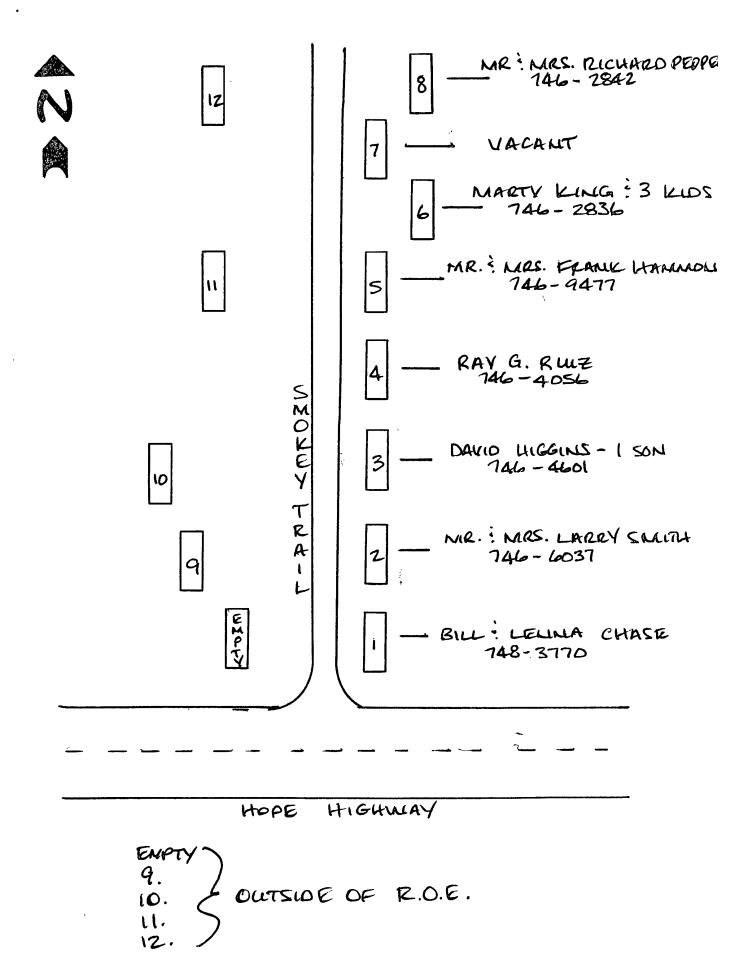

X. GENERAL INFORMATION SECTION

Form 3160-5 (September 2001)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

RECEIVED

FORM APPROVED OMB NO. 1004-0135 Expires January 31, 2004

	WEL	L COMP	LETION	OR REC	COMPLE	TION RE	PORT	AND LO	IG.	2 1 /L GOTS		5. Lease Se NM9094		
la. Type	of Well	Oil We	∐ X Gas	Well [Dry	Other			× 2 4 1					or Tribe Name
b. Туре	of Completion:		New Well	_	ork Over] Деерег	, [Plug Back	, 🗆 p	riff.Resvr,	. -			ement Name and No.
2. Name	of Operator										=- -	93196 R. Lease Na		Well No
Perenc	•													ederal #1
Addres	SS						3a.	Phone No.	(include	area code) -	API Well		,,,
	a Drive, S on of Well <i>(Rep</i>					Fodoval w			682-85	53	_		<u>5-3313</u>	
4. Locani										j	ال حــــــــــــــــــــــــــــــــــــ	D. Field and Wilder		Exploratory
TH Sain	760	rsı and	ניז יי 1760 פו	EL (DI	. P)			ו משב	WOO	ر ا	1		R., M., o	or Block and
At top p	rod, interval re	ported bel	ow 972'	FSL an	nd 760'	fel	_	Kek;		Ò	1:		31, TI	6S, R25B
At total	depth 985	'FNL a	and 804	FEL ((ULA)			733	3		- 1	ddv		NM
14. Date S	Spudded	15. Da	te T.D. Read	ched			ate Com	pleted		. A. Dund	1	7. Elevatio	ns (DF,	RKB, RT, GL)*
04 (0	r (04	1	04 (04				D & A		Ready	to Prou.	l	25001	~	
	26/04 Depth: MD		24/04 345 l	9 Plug B	ack T.D.:	MD	3/07	345	. 20. 1	Depth Bri	lee Ph	36001		656
10. 10.2.	TVD		090			TVD		090		- op - 11	-6	_	m m **	656
21. Type	Electric & Othe			n (Submit	copy of eac	:h)			22. Wa	s well core	d? [No	X Yes (Submit analysis)
	_								1	s DST run	_	X No		Submat report
	, Platform and Liner Rec							 	Dir	ectional Su	rvey?	No	<u> </u>	es (Submit copy)
			т			Stage Cer	nenter	No.of SI	ks. &	Shirry '	√ol.			<u> </u>
Hole Size	Sizze/Grade	Wt.(#ft.)			om (MD)	Dept		Type of C	Cernent	(BBI	.)	Cement		Amount Pulled
17-1/2"	13-3/8	48#	0		1591			448 Cla		108		Surf		Circ. 212 sx
12-1/4" 8-3/4"	9-5/8" 7"	40# 26#	0		103' 090'			475 Cla			164 Surface 175 2010			Circ. 26 ex
0-3/4	,	2017	 	 	030			707 C12	155 C	1/-		201	<u>U - </u>	CBL
														,
								ļ						
24. Tubm	g Record													-
Size	Depth Set (MD) P	acker Depth (MD)	Size	Depth Se	t (MD)	Packer De	epth (MD)	Siz	e	Depth St	t (MD)	Packer Depth (MD)
2-3/8*	4488	i_	4488'	<u>i_</u> _				٠		ــــــــــــــــــــــــــــــــــــــ	i			
25. Produ	Formation		Т		Pottom	26. Perfo					Τ,	Ve. Heles	1	D 6 Gran
A)	Abo		Top 4904		1950		erforated	57' MD		Size	 '	40. FIGES	╅╌,	Perforated liner
B)			4704		2330		J OZ.	37 190	$\neg \vdash \neg$		†		 	reflorated Timer
C)			·····	_									1	,
D)								_					1	
27. Acid, 1	Fracture, Treatr	nent, Cem	ent Squeeze	, Etc.										
	Depth Interval							Amount and	Type of N	iateriai				
509	1-8257' M)	65000	gals (15% NEF	HCl a	cid							
														
														
28 Product	ion - Interval A												···	t
Date First	Test Test	Hours	Test	Oil	Gas	Water	Toil	 r	Gas	Pro	duction	Method		
Produced 03/07/04	Date	Tested 4	Production		MCF 350	BBL 2	Gravit	N/A	Gravity .68:	- 1			Flow	ina
Choke	Tbg. Press.	Csg	24	Oil	Gas	Water	Gas: 0		Well	L			L LUW	`
Size 16/64	Flwg. SI 1650	Press	Hr.	BBL	MCF 2100	BBL	Ratio	0	Status	:I Wait	ina	on Pipe	line	
	tion-Interval B					<u> </u>			<u>.</u>			<u> </u>		
Date First Produced	Test Date	Hours Tested	Test Production	Oil	Gas MCF	Water BBL	Oit Gravit	у	Gas Gravity	Pro	duction	Method		
Choke Size	Tbg Press Flwg SI	Csg. Press.	24 Hr.	Oil BBL	Gas MCF	Water BBL	Gas. C Ratio		Well Status	L				J
(See instruction	and spaces for odd	tional data of	reverse side)	ــــــــــــــــــــــــــــــــــــــ	J	<u></u>	<u> </u>							



Laboratory Services, Inc.

4016 Fiesta Drive Hobbs, New Mexico 88240

Telephone: (505) 397-3713

FOR:

Metering & Testing Services Inc.

Attention: Mr. Tom Duncan

2807 West County Road

Hobbs, New Mexico 88240

SAMPLE:

IDENTIFICATION: Thames Federal 31 #1

Perenco LLC COMPANY:

LEASE: PLANT:

SAMPLE DATA: DATE SAMPLED: 3/10/04 12:00 pm

3/11/04

ANALYSIS DATE: PRESSURE - PSIG 100

SAMPLE TEMP. °F ATMOS. TEMP. °F

70

GAS (XX) SAMPLED BY: LIQUID ()

Al Lewis ANALYSIS BY: Vickie Biggs

REMARKS:

COMPONENT ANALYSIS

		MOL	
COMPONENT		PERCENT	GPM
Hydrogen Suttide	(H2S)	0.000	
Nitrogen	(N2)	0.650	
Carbon Dioxide	(CO2)	4.009	
Methane	(C1)	85.676	
Ethane	(C2)	5.563	1.484
Propane	(C3)	2.084	0.573
I-Butane	(IC4)	0.306	0. 10 6
N-Butane	(NC4)	0.582	0. 18 3
I-Pentane	(IC5)	0.185	ರಿ .06 8
N-Pentane	(NC5)	0.164	0.059
Hexane Plus	(C6+)	0.781	0.339
		100.000	2.806

1096 BTU/CU.FT. - DRY AT 14,650 DRY 1093 AT 14.650 WET 1074 AT 14.73 AT 14.73 1099 DRY 1080 WET

SPECIFIC GRAVITY -CALCULATED

0.681 MEASURED

MOLECULAR WT. 19.7710

Toxic Effects of Hydrogen Sulfide Poisoning

Hydrogen Sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 20 ppm, which is .002% by volume. Hydrogen Sulfide is heavier than air (specific gravity - 1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen Sulfide is almost as toxic as Hydrogen Cyanide and is between five and six times more toxic than Carbon Monoxide. Toxicity data for Hydrogen Sulfide and various other gases are compared below in Table I. Physical effects at various Hydrogen Sulfide levels are shown in Table II.

Table I
Toxicity of Various Gases

Common Name	Chemical Formula	Specific Gravity	Threshold Limit (A)	Hazardous Limit (B)	Lethal Concentration (C)
Hydrogen Cyanide	HCN	0.94	10 ppm	150 ppm/hr	300 ppm
Hydrogen Sulfide	H2S	1.18	10 ppm (D) 20 ppm (E)	250 ppm/hr	600 ppm
Sulfur Dioxide	S02	2.21	5 ppm		1000 ppm
Chlorine	CL2	2.45	1 ppm	4 ppm/hr	1000 ppm
Carbon Monoxide	СО	0.97	50 ppm	400 ppm/hr	1000 ppm
Carbon Dioxide	C02	1.52	5000 ppm	(5 %)	(10 %)
Methane	CH4	0.55	90,000 ppm	(9 %)	Combustible Above 5% in air

A. Threshold Limit - Concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.

B. Hazardous Limit - Concentration that may cause death.

- C. Lethal Concentration Concentration that will cause death with short-term exposure.
- D. Threshold Limit (10 ppm) 1972 ACGIH (American Conference of Governmental Industrial Hygienists).
- E. Threshold Limit (20 ppm) 1966 ANSI acceptable ceiling concentration for eight-hour exposure (based on 40 hour week) is 20 ppm. OSHA Rules and Regulations (Federal Register, Volume 37, No. 202, Part II, dated 10/18/72)

Table II
Physical Effects of Hydrogen Sulfide

Percent (%)	ppm	Physical Effects
0.001	10	Obvious and unpleasant odor
0.002	20	Safe for 8 hrs. exposure
0.01	100	Kills smell in 3-5 minutes; may sting eyes & throat
0.02	200	Kills smell shortly; stings eyes and throat
0.03	300	IDLH (Immediate Danger to Life and Health) Level
0.05	500	Dizziness; breathing ceases in a few minutes
0.07	700	Unconscious quickly; death will result if not rescued
0.10	1000	Unconscious at once; followed by death within minutes

* CAUTION: Hydrogen Sulfide is a colorless and transparent gas and is highly flammable. It is heavier than air and may accumulate in low places.

E. At any time there is a doubt as to the H2S level in the area to be

Rescue-First Aid for Hydrogen Sulfide Poisoning

DO NOT PANIC !!!!

Remain Calm -- THINK

- 1. Hold your breath (Do not inhale; stop breathing) and go to Briefing Area.
- 2. Put on breathing apparatus.
- 3. Remove victim(s) to fresh air as quickly as possible. (Go upwind from the source or at right angles to the wind; NOT downwind).
- 4. Briefly apply chest pressure—arm lift method of artificial respiration to clear the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 5. Provide for prompt transportation to the hospital and continue giving artificial respiration if needed.
- 6. Hospital(s) or medical facilities need to be informed, beforehand, of the possibility of H2S gas poisoning, no matter how remote the possibility.
- 7. Notify emergency room personnel that the victim(s) have been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration, as well as first aid for eyes and skin contact with liquid H2S. Everyone needs to master these necessary skills.

Use of Self-Contained Breathing Apparatus (SCBA)

- I. Written procedures shall be prepared covering safe use of respirators in dangerous atmospheric situations, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available respirators.
- II. Respirators shall be inspected frequently, at random, to insure that they are properly used, cleaned and maintained.
- III. Anyone who may use respirators shall be trained in how to properly seal the face piece. They shall wear respirators in normal air and then in a test atmosphere. (NOTE: Such items as facial hair (beard or sideburns) and eyeglass temple pieces will not allow a proper seal). Anyone that may be expected to wear respirators should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses. Contact lenses should not be allowed.
- IV. Maintenance and care of Respirators
 - A. A program of maintenance and care of respirators shall include the following:
 - 1. Inspection for defects, including leak checks.
 - 2. Cleaning and disinfecting.
 - 3. Repair
 - 4. Storage
 - B. Inspection: Self Contained Breathing Apparatus (SCBA) for emergency use shall be inspected monthly and records maintained for the following:
 - 1. Fully charged cylinders.
 - 2. Regulator and warning device operation.
 - 3. Condition of face piece and connection.
 - 4. Elastomer or rubber parts shall be stretched or massaged to keep them pliable and prevent deterioration.
 - C. Routinely used respirators shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- V. Persons assigned tasks that require the use of Self Contained Breathing Equipment shall be certified physically fit for breathing equipment usage by the local company physician at least annually.
- VI. Respirators should be worn during the following conditions:
 - A. Any employee who works near the top or on the top of any tank unless tests reveal less than 20 ppm of H2S.
 - B. When breaking out any line where H2S can reasonably be expected,
 - C. When sampling air in areas to determine if toxic concentrations of H2S exist,
 - D. When working in areas where over 20 ppm H2S has been detected.