District 1

1625 N. French Dr., Hobbs, NM 88240

1301 W. Grand Avenue, Artesio, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District N

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico

Energy, Minerals & Natural Resources Department

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe. NM 87505

Form C+102

Revised October 12, 2005

Submit to Appropriate District Office

State Lease- 4 Copies


Fee Lease-3 Copies

AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT Pool Code Pool Name 96473 Pierce Crossing; Bone Spring, East 30-015-Property Name Well Number Property Code 8H ELK WALLOW "11" STATE 38036 OCRID No. Operator Name Elevation EOG RESOURCES, INC. 3056.4' 7377

Surface Location UL or lot no. Section Township Ronge Lot Idn Feet from the North/South line | Feet from the East/West line County В 25 SOUTH 29 EAST, N.M.P.M. EDDY 11 170 **NORTH** 2640' EAST Bottom Hole Location If Different From Surface UL or lot no. Section Township Lot Idn Feet from the North/South line Feet from the East/West line County **EDDY** 0 11 25 SOUTH 29 EAST, N.M.P.M. 330' SOUTH 2540' **EAST** Consolidation Code Order No **Dedicated Acres** Joint or Infill 160

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

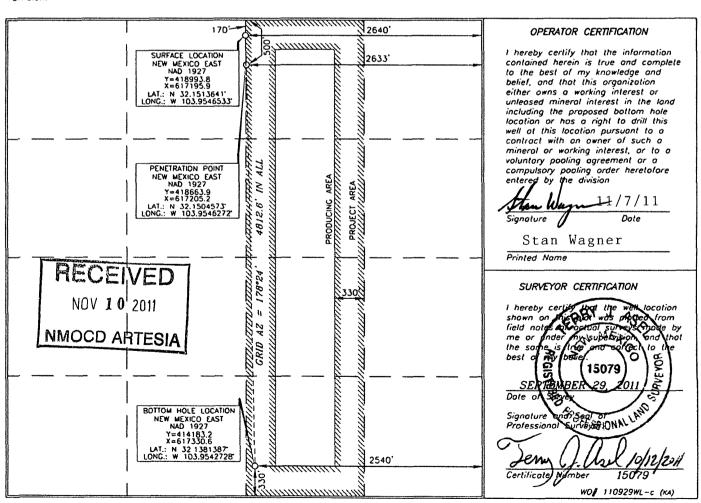

Permit Information:

Well Name: Elk Wallow 11 State No. 8H

Location:

SL: 170' FNL & 2640' FEL, Section 11, T-25-S, R-29-E, Eddy Co., N.M. BHL: 330' FSL & 2540' FEL, Section 11, T-25-S, R-29-E, Eddy Co., N.M.

Casing Program:

Hole		Csg				DF _{min}	$\mathbf{DF}_{\mathbf{min}}$	DF _{min}
Size	Interval	OD	Weight	Grade	Conn	Collapse	Burst	Tension
17.5"	0 – 625'	13.375"	54.5#	J55	STC	1.125	1.25	1.60
12.25"	0-4000'	9.625"	40#	J55	LTC	1.125	1.25	1.60
12.25"	4000' – 4750'	9.625"	40#	HCK-55	LTC	1.125	1.25	1.60
8.75"	0'-12,367'	5.5"	17#	HCP-110	LTC	1.125	1.25	1.60

Cement Program:

	No.	Wt.	Yld	
Depth	Sacks	ppg	Ft ³ /ft	Slurry Description
625'	500	14.8	1.32	Class C + 0.005 pps Static Free + 2% CaCl ₂ + 0.25 pps
				CelloFlake + 0.005 gps FP-6L (TOC @ surface)
4,750'	350	12.7	2.219	1 st Stage Lead: Class C + 2.0% SMS + 10.0% Salt + 1.10%
Stage Tool @ 3,000'				R-3 + 0.005 pps Static Free + 0.25 pps Celloflake
@ 3,000	1			(TOC @ surface)
ļ	200	14.8	1.34	1 st Stage Tail: Class C + 0.60% FL-62 + 0.45% CD-32 +
				0.15% SMS + 0.30% R-3
1	700	12.7	2.219	2 nd Stage Lead: Class C + 2.0% SMS + 10.0% Salt + 0.65%
				R-3 + 0.005 pps Static Free + 0.25 pps Celloflake
	100	14.8	1.34	2 nd Stage Tail: Class C + 0.60% FL-62 + 0.45% CD-32 +
				0.15% SMS + 0.15% R-3 + 0.005 pps Static Free
12,367'	375	10.8	3.675	60:40:0 Class C + 15.0 pps BA-90 + 4% MPA-5 + 3.0%
				SMS + 5.0% A-10 + 1.0% BA-10A + 0.80% ASA-301 +
				2.55% R-21 + 8.0 pps LCM-1
	300	11.8	2.38	50:50:10 Class H + 0.80% FL-52 + 0.30% ASA-301 +
				0.40% SMS + 2.0% Salt + 0.30% R-21 + 3.0 pps LCM-1 +
				0.25 pps Celloflake
	1200	14.2	1.277	50:50:2 Class H + 0.65% FL-52 + 0.45% CD-32 + 0.10%
				SMS + 2.0% Salt

Mud Program:

Depth	Type	Weight (ppg)	Viscosity	Water Loss
0 – 625'	Fresh - Gel	8.6-8.8	28-34	N/c
625' – 4,750'	Brine	10.0-10.2	28-34	N/c
4,750' – 7,282'	Cut Brine	8.4-9.0	28-34	N/c
KOP – 12,367'	Cut Brine - XCD	9.0-9.5	40-42	8-10
Lateral				

Elk Wallow 11 State #8H

Eddy County, New Mexico

170' FNL 2640' FEL Section 11 T-25-S, R-29-E

Proposed Wellbore

API: 30-015-

KB: 3,081.4' GL: 3,056.4'

Bit Size: 17-1/2" 13-3/8", 54.5#, J-55, STC 0' - 625' Stage Tool @ 3000' Bit Size: 12-1/4" 9-5/8", 40#, J-55, LTC 0' - 4,000' 9-5/8", 40#, HCK-55, LTC 4,000' - 4,750' Bit Size: 8-3/4" KOP: 7282' Bit Size: 8-3/4" A STATE OF THE STA

5-1/2", 17#, HCP110, LTC @ 12,367'

Lateral:

12,367' MD, 7,760' TVD

BH Location: 330' FSL & 2540' FEL Section 11

T-25-S, R-29-E

EOG Resources

Project: Eddy County, NM (Nad27) Site: Elk Wallow 11 State Well: Elk Wallow 11 State 8H Wellbore: Wellbore #1

Plan: Plan #1 102411 Rig: Cactus Rig No. 139

PROJECT DETAILS Eddy County, NM (Nad27)

Geodetic System US State Plane 1927 (Exact solution)
Datum NAD 1927 (NADCON CONUS)
Ellipsoid Clarke 1886
Zone New Mexico East 3001
System Datum Mean Sea Level
Location North Grid



Azimuths to Grid North True North -0 20° Magnetic North 7 51°

Magnetic Field Strength 48496 5snT Dip Angle 60 04° Date 10/24/2011 Model IGRF2010_14

PHOENIX

West(-)/East(+) (200 usft/in)

WELL	DETAIL	S: E	Elk Wallow	11	State I	вн

Ground Level 3056 40
Easting Latittude Longitude
617195 90 32° 9' 4 911 N03° 57' 16 752 W Northing 418993 80

WELLE	ORE TAR	GET DETAIL	S (MAP C	O-ORDINA	res)	
Name	TVD	+N/-S	+E/-W	Northing	Easting	Shape
BHL Elk Wallow 11 State 8H	7760 00	-4810 60	134 70	414183 20	617330 60	Point

SECTION DETAILS

MD	Inc	Azı	TVD	+N/-S	+E/-W	Dleg	TFace	VSect	
0 00	0 00	0 00	0 00	0 00	0 00	0 00	0 00	0.00	
7282 54	0 00	0 00	7282 54	0 00	0.00	0 00	0.00	0 00	
8032 54	90 00	178 40	7760 00	-477 28	13 36	12 00	178 40	477 46	
12367 56	90 00	178 40	7760 00	-4810 60	134 70	0 00	0 00	4812 49	BHL Elk Wallow 11 State 8H

ANNOTATIONS

5200


(200 usfVIn)

0000 th

TVD MD Annotation 7282 54 7282 54 Start Build 12 00 7760 00 8032 54 Start 4335 02 hold at 8032 54 MD 7760 00 12367 56 TD at 12367 56

FORMATION TOP DETAILS

No formation data is available

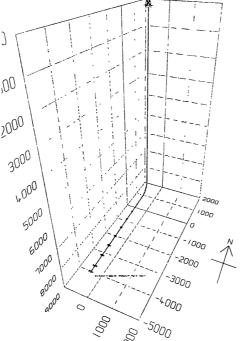

7200																0,	,	90	~ <i>U</i> ()	0						
7600		Stan 4335 * -	litilali	HH		-11-1-	4					+ 1							4				1- 1-51,		TOM	
7800					1200	1400	1600	1800	2000	2200	24	00 3	600	2800	300	0 32	00 3	400 3	600 3	120	1000			BHL E	w Wattow 1	

-6	00 -4	00 -2	00 (2	00	40	0 60	0
	1,14,15	1,215,51	1:	4-11	1,11,11,	-	12,,-	
200	Se	7-17-1	1.7	المامين أمار	-	-	-	200
	1,1.	355	1	1111	III.		744-14-1	
0-	H	1	500	14.4 6	7,515	'n		0
		an Braid	12.60		125	Ľ	معد، نیم دقید ملیم،	
	124	riting.	+	<u>स्थितन्त्र</u>	1 27 2	٤		
-200	:: [:].	71.5.4	ninini		JEI.	,		-200
	1	- in	47.40	140		•		
-400-		721.212	Litt ii			1		-400
Gian	A335 87 F	edd at RO	27 64 165	1-1-1	:: 	1000	Hi-b-i	
-600		L		14211		ï	destances of	600
	盐					12.12		
			12	主動	1	12		
-800-		17172,1	222		·	F		-800
	1 11111		-	1111		ċ		
-1000-	LH.	, , , , ,				-	-	-1000
			1	177.12	35	1	1	
-1200-				s,ètra!	4	5	La Later	-1200
-1200-	THE P		1,777		19-1	4		-1200
	1		: 7.1	: 27	氢	:	3,5,5	
-1400-			1 12		اليتنا	٠		
		44	130° E	122			놸	
-1600-				144	55	ť	اغتنت	4000
						÷	##.T	
	E., 1 5	HHF		-1-1-	H	T	14.1	
-1800-		141,111	-	144	l	7	- I	-1800
	rita)					H		
-2000						ē		-2000
			1.1.	17 tr 17	譚.	-		
-2200	TEM			哑		-	7 11 1	-2200 G
	土土	-		17 17 17	事.	Ė		
	75.		- H.J.	1	i.i.,	3		
-2400	F-17.11F	221 474	17.		2.7.4	Ę	July .	-2400 N
					7,5	ä		
-2600	44.			10.10.		¥	وتتوبية	-2600±
	亚	111111	过过		1,44	ĮĬ.		(200
-2800					2,252	i		2000
-2000	7=2,2			;== === ==		15		-2800 5
,	11.			SIT.	1,94	12	- 11 - 1	Ē
-3000	7,1			11 111	7	۲	-	-3000
				ÇUE	. 2	.,	1,1,1	
-3200-				1112	<u> </u>	=	Tirir	-3200
	虈	HE I		五耳		=	主连	
-3400	apple.	1,44,4		THE	PEP.	÷	444	2400
-3400		1,11,11	î.÷i=i.÷	ž,;i,	:,,,,	E	r. ~	-3400
	-Fi.			1214 [12]	::1	1	F15415	
-3600-					EET	:		-3600
		HI		1311 (12c)	ticte	i		
-3800		البتبنا		-11		Ť	12717	-3800
	111			争臣				
4000	eren.	1214		事法	# <u>.</u>	2		-4000
	Talla.				办			7000
	T.	11 117. 11 1111		計片	阿拉马州	Ė	7 <u>4</u> -1	
-4200-		扯	1,12	1-1-		-		-4200
-		ųΓ,E,	1. 1. 1			Ę	12.5	
-4400-		E P			===	5		-4400
		뷀	甌	1111111	罼		171-15	
4600		Ļ.bję	+++++			٠,	1-1-1-1	:
-4000-		Tillit.	145		4	,	1717-121	
			44	注制	-35	÷		
-4800-		tetaspie		4.7		Η	1-11-1-1	-4800
			27-2,24-2	44	5.7	÷		
-5000			400	45.00	110	7		-5000
	-1-4	19	12367 A	: #ML	G# Wat	b	of 11 State	ker
	***************************************			715.5	200.00	Ξ		
-5200-		PP ¹	144	THE	777	٦	7 7 7 7 7	-5200
	理話	Titt:			1	i	Tri I	
-5400	117171	*******	3.42	20	*	4		-5400
-6	00 -4	00 -2					0 60	iu
		west(-)/East(+) (200 L	istt/in	,		

File Call to Home Ship II September 198 Andre Deaded for Jin Nature address 1979(1)

EOG Resources

Eddy County, NM (Nad27) Elk Wallow 11 State Elk Wallow 11 State 8H Wellbore #1

Plan: Plan #1 102411

EOG Resources

24 October, 2011



Phoenix Technology Services





Local Co-ordinate Reference: Well Elk Wallow 11 State 8H Company: EOG Resources WELL @ 3081.40usft (Original Well Elev + 25' KB) TVD Reference: Project: Eddy County, NM (Nad27) MD Reference: WELL @ 3081.40usft (Original Well Elev + 25' KB) Site: Elk Wallow 11 State Well: Elk Wallow 11 State 8H North Reference: Survey Calculation Method: Minimum Curvature Wellbore: Wellbore #1 GCR DB v5000 Plan #1 102411 Database: Design: Project & Eddy County, NM (Nad27) US State Plane 1927 (Exact solution) Mean Sea Level System Datum: Map System: NAD 1927 (NADCON CONUS) Geo Datum: New Mexico East 3001 Map Zone: Site Elk Wallow 11 State 419,025.40 usft Northing: 32° 9' 5.189 N Latitude: Site Position: 618,185 70 usft Longitude: 103° 57' 5.237 W From: Мар Easting: 13-3/16 " Grid Convergence: 0.20° 0.00 usft Position Uncertainty: Slot Radius: Well Elk Wallow 11 State 8H **Well Position** +N/-S 0.00 usft Latitude: 32° 9' 4.911 N Northing: 103° 57' 16.752 W Longitude: +E/-W 0.00 usft Easting: 617,195 90 usft 3,056.40 usft 0.00 usft Ground Level: Position Uncertainty Wellhead Elevation: usft Wellbore Wellbore #1 Magnetics Model Name Sample Date Declination Dip Angle Field Strength 1. 12/1/ (nT)> 48,497 60.04 IGRF2010_14 10/24/2011 7.71 Design Plan #1 102411 **Audit Notes:** Version: Phase: PLAN Tie On Depth: 0.00 Direction Vertical Section: Depth From (TVD) (usft) (usft) (usft) (°) 0 00 0.00 178,40 0.00

Description !

MWD - Standard

Tool Name

MWD

Survey Tool Program

(usft)

0.00

Date 10/24/2011

(usft) Survey (Wellbore) 12,367.56 Plan #1 102411 (Wellbore #1)



Company: Project:

EOG Resources

Eddy County, NM (Nad27)

Site: Well:

Elk Wallow 11 State Elk Wallow 11 State 8H

Wellbore: Design:

Wellbore #1 Plan #1 102411 Local Co-ordinate Reference: TVD Reference:

MD Reference: North Reference:

Survey Calculation Method: Database:

Well Elk Wallow 11 State 8H

WELL @ 3081.40usft (Original Well Elev + 25' KB) WELL @ 3081.40usft (Original Well Elev + 25' KB)

Grid

1 453	0500	23.	~			
01-	'n'n	~~	œ		rve	ri.
F 16	.,,,,	cu		u	40	.

MD (usft)	Inc Azi	(azimuth)	TVDSS (usft)	TVD N/S (usft) (usft)			ec ft)	DLeg (°/100úsft)	Northing (usft)	Easting (usft)
0.00	0 00	0.00	-3,081.40	0 00	0.00	0.00	0 00	0 00	418,993.80	617,195 90
100.00	0.00	0.00	-2,981 40	100.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
200 00	0 00	0 00	-2,881.40	200.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
300 00	0 00	0 00	-2,781.40	300.00	0.00	0 00	0.00	0.00	418,993 80	617,195.90
400.00	0 00	0.00	-2,681.40	400.00	0.00	0 00	0 00	0.00	418,993.80	617,195.90
500.00	0 00	0.00	-2,581.40	500.00	0.00	0.00	0 00	0.00	418,993.80	617,195.90
600.00	0.00	0.00	-2,481.40	600.00	0.00	0.00	0 00	0.00	418,993.80	617,195.90
700 00	0.00	0.00	-2,381 40	700.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
800.00	0.00	0 00	-2,281.40	800.00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
900.00	0.00	0 00	-2,181.40	900.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,000.00	0.00	0 00	-2,081.40	1,000.00	0 00	0 00	0.00	0 00	418,993.80	617,195.90
1,100.00	0.00	0.00	-1,981.40	1,100.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,200.00	0.00	0.00	-1,881.40	1,200 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,300 00	0.00	0 00	-1,781.40	1,300.00	0.00	0 00	0.00	0.00	418,993 80	617,195.90
1,400.00	0.00	0.00	-1,681.40	1,400.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,500.00	0.00	0.00	-1,581.40	1,500.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,600.00	0.00	0.00	-1,481.40	1,600.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,700 00	0.00	0 00	-1,381.40	1,700 00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
1,800 00	0.00	0 00	-1,281.40	1,800.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
1,900 00	0.00	0.00	-1,181.40	1,900.00	0 00	0 00	0.00	0.00	418,993.80	617,195.90
2,000 00	0.00	0.00	-1,081.40	2,000.00	0 00	0.00	0 00	0.00	418,993.80	617,195.90
2,100.00	0.00	0.00	-981 40	2,100.00	0 00	0.00	0 00	0.00	418,993.80	617,195.90
2,200 00	0.00	0.00	-881 40	2,200.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
2,300 00	0.00	0 00	-781.40	2,300.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
2,400 00	0.00	0.00	-681 40	2,400.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
2,500 00	0.00	0.00	-581.40	2,500.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
2,600.00	0 00	0.00	-481.40	2,600.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90



Company: Project:

EOG Resources

Eddy County, NM (Nad27)

Site: Well: Elk Wallow 11 State Elk Wallow 11 State 8H

Wellbore: Design:

Wellbare #1 Plan #1 102411 Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference:

Survey Calculation Method: Database:

WELL @ 3081.40usft (Original Well Elev + 25' KB) WELL @ 3081.40usft (Original Well Elev + 25' KB)

Grid

Minimum Curvature GCR DB v5000

Well Elk Wallow 11 State 8H

Planned Survey

MD (usft)	Inc (°)	Azi:(azimuth)	TVDSS (usft)	TVD (usft)	N/S (usft)	E/W (usft)	V.Sec (usft)	DLeg (°/100usft)	Northing (usft)	Easting (usft)
2,700 00	0.00	0.00	-381 40	2,700 00	0 00	0.00	0.00	0.00	418,993 80	617,195.90
2,800.00	0.00	0.00	-281.40	2,800.00	0.00	0.00	0 00	0.00	418,993.80	617,195.90
2,900 00	0 00	0.00	-181 40	2,900 00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
3,000.00	0 00	0.00	-81 40	3,000 00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
3,100 00	0.00	0.00	18 60	3,100.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
3,200.00	0 00	0.00	118.60	3,200 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
3,300.00	0.00	0 00	218.60	3,300 00	0 00	0.00	0.00	0 00	418,993.80	617,195.90
3,400.00	0.00	0.00	318.60	3,400 00	0.00	0.00	0.00	0 00	418,993.80	617,195.90
3,500.00	0 00	0.00	418.60	3,500.00	0.00	0 00	0.00	0.00	418,993 80	617,195.90
3,600.00	0.00	0.00	518 60	3,600.00	0 00	0 00	0.00	0.00	418,993 80	617,195.90
3,700.00	0.00	0 00	618.60	3,700.00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
3,800.00	0 00	0.00	718 60	3,800 00	0.00	0.00	0 00	0 00	418,993 80	617,195 90
3,900.00	0.00	0 00	818.60	3,900 00	0 00	0.00	0.00	0.00	418,993 80	617,195.90
4,000.00	0.00	0.00	918 60	4,000.00	0.00	0.00	0.00	0 00	418,993.80	617,195.90
4,100.00	0.00	0.00	1,018.60	4,100.00	0.00	0 00	0.00	0.00	418,993 80	617,195.90
4,200.00	0.00	0.00	1,118.60	4,200.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
4,300.00	0.00	0 00	1,218.60	4,300 00	0.00	0.00	0 00	0.00	418,993.80	617,195.90
4,400.00	0.00	0.00	1,318 60	4,400 00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
4,500.00	0 00	0 00	1,418.60	4,500 00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
4,600.00	0.00	0.00	1,518.60	4,600.00	0 00	0.00	0.00	0.00	418,993.80	617,195 90
4,700.00	0.00	0.00	1,618.60	4,700 00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
4,800.00	0.00	0.00	1,718.60	4,800 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
4,900.00	0.00	0.00	1,818 60	4,900 00	0.00	0.00	0.00	0.00	418,993.80	617,195 90
5,000.00	0.00	0 00	1,918.60	5,000.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
5,100.00	0.00	0.00	2,018 60	5,100 00	0 00	0.00	0.00	0.00	418,993 80	617,195.90
5,200.00	0.00	0 00	2,118 60	5,200.00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
5,300.00	0.00	0.00	2,218.60	5,300.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90



EOG Resources

Company: Project: Site: Eddy County, NM (Nad27) Elk Wallow 11 State Well: Elk Wallow 11 State 8H

Wellbore: Wellbore #1 Design: Plan #1 102411 Local Co-ordinate Reference: TVD Reference:

MD Reference: North Reference: Survey Calculation Method: Database:

Well Elk Wallow 11 State 8H

WELL @ 3081.40usft (Original Well Elev + 25' KB) WELL @ 3081.40usft (Original Well Elev + 25' KB)

anr		

MD	inc	Azi (azimuth)	TVDSS	TVD	N/S	E/W	V. Sec	DLeg	Northing	Easting
(usft)	(°)	(°)	(usft)	(usft)	(usft)	(usft)	(°/	100usft)	(usft)	(usft)
5,400.00	0 00	0.00	2,318 60	5,400.00	0.00	0.00	0.00	0.00	418,993.80	617,195 90
5,500.00	0.00	0.00	2,418 60	5,500.00	0.00	0 00	0 00	0 00	418,993.80	617,195.90
5,600.00	0.00	0.00	2,518.60	5,600.00	0.00	0 00	0.00	0.00	418,993.80	617,195.90
5,700 00	0 00	0 00	2,618.60	5,700.00	0.00	0.00	0.00	0 00	418,993.80	617,195.90
5,800 00	0 00	0.00	2,718.60	5,800.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
5,900 00	0.00	0.00	2,818.60	5,900.00	0.00	0.00	0.00	0 00	418,993.80	617,195.90
6,000.00	- 0.00	0 00	2,918 60	6,000.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
6,100.00	0.00	0.00	3,018.60	6,100 00	0.00	0.00	0.00	0 00	418,993 80	617,195.90
6,200.00	0 00	0 00	3,118 60	6,200 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
6,300.00	0.00	0.00	3,218 60	6,300 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
6,400.00	0.00	0 00	3,318.60	6,400 00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
6,500.00	0.00	0.00	3,418.60	6,500.00	0 00	0.00	0.00	0 00	418,993.80	617,195.90
6,600.00	0.00	0.00	3,518.60	6,600.00	0 00	0.00	0.00	0 00	418,993.80	617,195.90
6,700 00	0.00	0.00	3,618.60	6,700.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
6,800.00	0.00	0.00	3,718.60	6,800.00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
6,900.00	0.00	0.00	3,818.60	6,900 00	0.00	0.00	0.00	0.00	418,993.80	617,195.90
7,000.00	0.00	0.00	3,918.60	7,000.00	0 00	0.00	0.00	0.00	418,993.80	617,195.90
7,100.00	0.00	0.00	4,018.60	7,100.00	0.00	0.00	0.00	0 00	418,993.80	617,195 90
7,200 00	0 00	0.00	4,118.60	7,200.00	0.00	0.00	0.00	0 00	418,993.80	617,195.90
7,282 54	0.00	0.00	4,201.14	7,282.54	0.00	0.00	0.00	0.00	418,993.80	617,195.90
Start Build 1 7,300 00	2.10	178.40	4,218.60	7,300.00	-0.32	0.01	0.32	12.00	418,993.48	617,195 91
7,400 00	14.10	178.40	4,317.42	7,398.82	-14.37	0.40	14.38	12.00	418,979.43	617,196.30
7,500.00	26.10	178.40	4,411.16	7,492.56	-48.65	1.36	48.67	12 00	418,945.15	617,197 26
7,600.00	38 10	178.40	4,495 72	7,577 12	-101.67	2.85	101 71	12 00	418,892.13	617,198 75
7,700.00	50 10	178.40	4,567.41	7,648 81	-171.10	4 79	171 17	12 00	418,822.70	617,200 69
7,800 00	62.10	178.40	4,623.09	7,704.49	-253.91	7 11	254.01	12.00	418,739 89	617,203.01



EOG Resources Company:

Project: Eddy County, NM (Nad27) Site: Well: Elk Wallow 11 State Elk Wallow 11 State 8H

Wellbore: Design:

Wellbore #1 Plan #1 102411 Local Co-ordinate Reference: TVD Reference:

MD Reference:

MD Reference:
North Reference:
Survey Calculation Method:
Database:

Well Elk Wallow 11 State 8H

WELL @ 3081.40usft (Original Well Elev + 25' KB) WELL @ 3081.40usft (Original Well Elev + 25' KB)

Planned Survey					without profession and the state of the Confession and the state of th					
, 12										
MD (usft)	Inc (°)	Azi (azimuth)	(usft)	TVD (usft)	N/S (usft)	E/W		DLeg (100usft)	Northing (usft)	Easting (usft)
7,900.	and the second second	(°) 178.40	4,660.32	7.741 72	-346.49	9.70	346 63	12.00	418,647.31	617,205.60
8,000.		178.40	4,677.49	7,758.89	-444 78	12.45	444 95	12.00	418,549.02	617,208.35
8,032		178.40	4.678 60	7,760 00	-477.28	13 36	477.46	12.00	418,516.52	617,209 26
	5.02 hold at 8032.54 MD		.,	,						
8,100		178.40	4,678.60	7,760.00	-544.72	15.25	544.93	0.00	418,449.08	617,211.15
8,200	00 90 00	178.40	4,678.60	7,760 00	-644.68	18.05	644.93	0.00	418,349.12	617,213.95
8,300	00 90.00	178.40	4,678.60	7,760.00	-744 64	20.85	744.93	0.00	418,249.16	617,216.75
8,400.6	00 90 00	178.40	4,678.60	7,760.00	-844.60	23.65	844.93	0.00	418,149.20	617,219.55
8,500.0	00 90.00	178.40	4,678.60	7,760.00	-944.56	26.45	944.93	0 00	418,049.24	617,222.35
8,600.	00 90.00	178.40	4,678.60	7,760.00	-1,044.52	29.25	1,044.93	0 00	417,949.28	617,225.15
8,700.	00 90 00	178.40	4,678 60	7,760.00	-1,144 48	32.05	1,144.93	0.00	417,849.32	617,227.95
8,800.0	00 90 00	178.40	4,678.60	7,760.00	-1,244.44	34.85	1,244.93	0 00	417,749 36	617,230.75
8,900.0	00 90 00	178.40	4,678.60	7,760.00	-1,344.40	37.64	1,344.93	0.00	417,649.40	617,233.54
9,000.0	00 90.00	178 40	4,678.60	7,760.00	-1,444.36	40.44	1,444.93	0.00	417,549.44	617,236.34
9,100	00 90 00	178.40	4,678.60	7,760.00	-1,544.32	43.24	1,544.93	0 00	417,449.48	617,239 14
9,200.0	90 00	178.40	4,678.60	7,760.00	-1,644.29	46.04	1,644.93	0.00	417,349.51	617,241 94
9,300.0	00 90.00	178 40	4,678.60	7,760.00	-1,744.25	48.84	1,744.93	0.00	417,249.55	617,244.74
9,400.0	00.00	178.40	4,678.60	7,760 00	-1,844.21	51.64	1,844.93	0 00	417,149.59	617,247.54
9,500.0	00 90 00	178.40	4,678.60	7,760.00	-1,944 17	54.44	1,944.93	0.00	417,049.63	617,250 34
9,600.0	00 90.00	178.40	4,678 60	7,760.00	-2,044.13	57.24	2,044 93	0.00	416,949.67	617,253 14
9,700	00 90 00	178.40	4,678.60	7,760.00	-2,144.09	60 04	2,144.93	0 00	416,849.71	617,255.94
9,800.0	00 90 00	178.40	4,678 60	7,760.00	-2,244 05	62 83	2,244 93	0.00	416,749.75	617,258.73
9,900.0	00 90 00	178.40	4,678.60	7,760.00	-2,344.01	65 63	2,344.93	0 00	416,649.79	617,261.53
10,000.6	90.00	178 40	4,678.60	7,760 00	-2,443.97	68.43	2,444.93	0 00	416,549.83	617,264.33
10,100.6	00 90.00	178.40	4,678.60	7,760.00	-2,543 93	71 23	2,544.93	0 00	416,449.87	617,267.13
10,200.0	90.00	178 40	4,678.60	7,760.00	-2,643.89	74.03	2,644.93	0 00	416,349.91	617,269.93
10,300.6	90.00	178.40	4,678 60	7,760.00	-2,743 85	76.83	2,744.93	0 00	416,249.95	617,272.73



Company: Project:

EOG Resources

Eddy County, NM (Nad27) Elk Wallow 11 State

Elk Wallow 11 State 8H

Wellbore: Design: 📑

Site:

. Well:

Wellbore #1 Plan #1 102411 Local Co-ordinate Reference: TVD Reference: MD Reference:

North Reference: Survey Calculation Method:

Database:

Well Elk Wallow 11 State 8H

WELL @ 3081.40usft (Original Well Elev + 25' KB) WELL @ 3081.40usft (Original Well Elev + 25' KB)

ned Survey	

MD (usft)	inc (°)	Azi (azimuth)	TVDSS (usft)	TVD (usft)	N/S (usft)	E/W (usft)	V. Sec (usft)	DLeg (°/100usft)	Northing (usft)	Easting (usft)
10,400 00	90.00	178 40	4,678 60	7,760.00	-2,843.82	79.63	2,844.93	0.00	416,149.98	617,275.53
10,500.00	90.00	178.40	4,678.60	7,760.00	-2,943.78	82.43	2,944.93	0.00	416,050.02	617,278.33
10,600 00	90.00	178 40	4,678 60	7,760.00	-3,043 74	85.23	3,044.93	0.00	415,950 06	617,281.13
10,700 00	90.00	178 40	4,678 60	7,760.00	-3,143.70	88 03	3,144 93	0.00	415,850 10	617,283.93
10,800.00	90.00	178 40	4,678.60	7,760.00	-3,243.66	90.82	3,244.93	0.00	415,750.14	617,286.72
10,900.00	90.00	178.40	4,678.60	7,760.00	-3,343.62	93.62	3,344.93	0.00	415,650.18	617,289.52
11,000.00	90.00	178 40	4,678.60	7,760.00	-3,443.58	96.42	3,444.93	0.00	415,550.22	617,292.32
11,100.00	90 00	178 40	4,678.60	7,760.00	-3,543.54	99 22	3,544 93	0.00	415,450 26	617,295.12
11,200 00	90.00	178 40	4,678.60	7,760.00	-3,643.50	102.02	3,644.93	0.00	415,350.30	617,297.92
11,300.00	90.00	178.40	4,678.60	7,760.00	-3,743.46	104.82	3,744.93	0.00	415,250.34	617,300.72
11,400.00	90.00	178 40	4,678.60	7,760.00	-3,843.42	107.62	3,844.93	0.00	415,150.38	617,303.52
11,500.00	90.00	178.40	4,678 60	7,760 00	-3,943.38	110.42	3,944.93	0.00	415,050.42	617,306.32
11,600.00	90.00	178.40	4,678 60	7,760 00	-4,043.34	113.22	4,044.93	0.00	414,950 46	617,309.12
11,700.00	90.00	178.40	4,678.60	7,760.00	-4,143.31	116 02	4,144.93	0.00	414,850.49	617,311.92
11,800.00	90.00	178 40	4,678 60	7,760 00	-4,243.27	118.81	4,244.93	0.00	414,750.53	617,314.71
11,900.00	90.00	178.40	4,678 60	7,760 00	-4,343.23	121.61	4,344.93	0.00	414,650.57	617,317.51
12,000.00	90.00	178.40	4,678.60	7,760.00	-4,443.19	124.41	4,444 93	0.00	414,550.61	617,320.31
12,100.00	90.00	178.40	4,678.60	7,760.00	-4,543 15	127.21	4,544.93	0.00	414,450 65	617,323.11
12,200.00	90.00	178 40	4,678 60	7,760.00	-4,643.11	130 01	4,644.93	0 00	414,350 69	617,325.91
12,300.00	90.00	178.40	4,678.60	7,760.00	-4,743 07	132 81	4,744.93	0.00	414,250.73	617,328.71
12,367.56	90.00	178.40	4,678.60	7,760.00	-4,810 60	134.70	4,812.49	0 00	414,183.20	617,330.60
TD at 12367.56										

Phoenix Technology Services

EOG Resources



Well Elk Wallow 11 State 8H Company: EOG Resources Local Co-ordinate Reference: Project: Eddy County, NM (Nad27) TVD Reference: WELL @ 3081.40usft (Original Well Elev + 25' KB) MD Reference: WELL @ 3081.40usft (Original Well Elev + 25' KB) Site: Elk Wallow 11 State Grid Well: Elk Wallow 11 State 8H North Reference: Minimum Curvature Wellbore #1 Survey Calculation Method: Wellbore: Design: Plan #1 102411 Database: GCR DB v5000 Plan Annotations , Vertical Measured ? Local Coordinates Depth, Depth +N/-S +E/-W (usft) (usft) (usft) (usft) Comment -7,282.54 0.00 Start Build 12.00 7,282.54 0.00 8,032.54 7,760.00 -477 28 13.36 Start 4335.02 hold at 8032.54 MD 12,367 56 7,760.00 -4,810.60 134.70 TD at 12367.56 Checked By: Approved By: Date:

EOG Resources, Inc.

Legal's:

Elk Wallow 11 State No. 8H

Eddy Co. New Mexico

170' FNL & 2640' FEL Surface Location

330' FSL & 2540' FEL Bottom Hole Location

Section 11 T-25-S, R-29-E Section 11 T-25-S, R-29-E


Lat: N 32.1513641

Lat: N 32.1381387

Long: W 103.9546533

Long: W 103.9542728

H₂S "Contingency Plan"

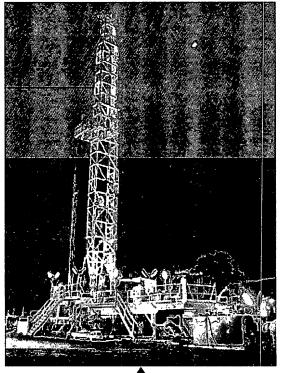



Safety Solutions, LLC 3222 Commercial Dr.

(432) 686-8555 Midland, TX 79701

Table of Contents

I. H₂S Contingency Plan

- a. Scope
- b. Objective
- c. Discussion of Plan

II. Emergency Procedures

- a. Emergency Procedures
- b. Emergency Reaction Steps
- c. Simulated Blowout Control Drills

III. Ignition Procedures

- a. Responsibility
- b. Instructions

IV. Training Requirements

V. Emergency Equipment

VI. Check Lists

- a. Status Check List
- b. Procedural Check List

VII. Briefing Procedures

VIII. Evacuation Plan

- a. General Plan
- b. Emergency Phone Lists

IX. Maps and Plats

- a. Location Plat
- b. Map to Location
- c. Radius of Exposure

X. General Information

- a. Drilling/Re-entry Permits
- b. H-9 Permit
- c. H₂S Permissible Limits
- d. Toxicity Table
- e. Physical Properties
- f. Respirator Use
- g. Emergency Rescue

H₂S CONTINGENCY PLAN SECTION

Scope:

This contingency plan provides an organized plan of action for alerting and protecting the public within an area of exposure prior to an intentional release, or following the accidental release of a potentially hazardous volume of hydrogen sulfide. The plan establishes guidelines for all personnel whose work activity may involve exposure to Hydrogen Sulfide Gas (H₂S).

Objective:

Prevent any and all accidents, and prevent the uncontrolled release of H₂S into the atmosphere.

Provide proper evacuation procedures to cope with emergencies.

Provide immediate and adequate medical attention should an injury occur.

Discussion of Plan:

Suspected Problem Zones:

Implementation: This plan, with all details, is to be fully implemented 1000' before drilling into the first sour zone.

Emergency Response Procedure: This section outlines the conditions and denotes steps to be taken in the event of an emergency.

Emergency Equipment and Procedure: This section outlines the safety and emergency equipment that will be required for the drilling of this well.

Training Provisions: This section outlines the training provisions that must be adhered to 1000' before drilling into the first sour zone.

Emergency call list: Included are the telephone numbers of all persons that would need to be contacted, should an H_2S emergency occur.

Briefing: This section deals with the briefing of all persons involved with the drilling of this well.

Public Safety: Public Safety Personnel will be made aware of the drilling of this well.

Check Lists: Status check lists and procedural check lists have been included to ensure adherence to the plan.

General Information: A general information section has been included to supply support information.

EMERGENCY PROCEDURES SECTION

- I. In the event of any evidence of H₂S level above 10ppm, take the following steps immediately:
 - a. Secure breathing apparatus.
 - b. Order non-essential personnel out of the danger zone.
 - c. Take steps to determine if the H₂S level can be corrected or suppressed, and if so, proceed with normal operations.
- II. If uncontrollable conditions occur, proceed with the following:
 - a. Take steps to protect and/or remove any public downwind of the rig, including partial evacuation or isolation. Notify necessary public safety personnel and the New Mexico Oil Conservation Division of the situation.
 - b. Remove all personnel to the Safe Briefing Area.
 - c. Notify public safety personnel for help with maintaining roadblocks and implementing evacuation.
 - d. Determine and proceed with the best possible plan to regain control of the well. Maintain tight security and safety measures.

III. Responsibility:

- a. The Company Approved Supervisor shall be responsible for the total implementation of the plan.
- b. The Company Approved Supervisor shall be in complete command during any emergency.
- c. The Company Approved Supervisor shall designate a back up Supervisor in the event that he/she is not available.

EMERGENCY PROCEDURE IMPLEMENTATION

I. Drilling or Tripping

a. All Personnel

- i. When alarm sounds, don escape unit and report to upwind Safe Briefing Area.
- ii. Check status of other personnel (buddy system).
- iii. Secure breathing apparatus.
- iv. Wait for orders from supervisor.

b. Drilling Foreman

- i. Report to the upwind Safe Briefing Area.
- ii. Don Breathing Apparatus and return to the point of release with the Tool Pusher or Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

c. Tool Pusher

- i. Report to the upwind Safe Briefing Area.
- ii. Don Breathing Apparatus and return to the point of release with the Drilling Foreman or the Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

d. Driller

- i. Check the status of other personnel (in a rescue attempt, always use the buddy system).
- ii. Assign the least essential person to notify the Drilling Foreman and Tool Pusher, in the event of their absence.
- iii. Assume the responsibility of the Drilling Foreman and the Tool Pusher until they arrive, in the event of their absence.

e. Derrick Man and Floor Hands

i. Remain in the upwind Safe Briefing Area until otherwise instructed by a supervisor.

f. Mud Engineer

- i. Report to the upwind Safe Briefing Area.
- ii. When instructed, begin check of mud for pH level and H₂S level.

g. Safety Personnel

- i. Don Breathing Apparatus.
- ii. Check status of personnel.
- iii. Wait for instructions from Drilling Foreman or Tool Pusher.

II. Taking a Kick

- a. All Personnel report to the upwind Safe Briefing Area.
- b. Follow standard BOP procedures.

III. Open Hole Logging

- a. All unnecessary personnel should leave the rig floor.
- **b.** Drilling Foreman and Safety Personnel should monitor the conditions and make necessary safety equipment recommendations.

IV. Running Casing or Plugging

- a. Follow "Drilling or Tripping" procedures.
- **b.** Assure that all personnel have access to protective equipment.

SIMULATED BLOWOUT CONTROL DRILLS

All drills will be initiated by activating alarm devices (air horn). One long blast, on the air horn, for ACTUAL and SIMULATED Blowout Control Drills. This operation will be performed by the Drilling Foreman or Tool Pusher at least one time per week for each of the following conditions, with each crew:

Drill #1 Bottom Drilling

Drill #2 Tripping Drill Pipe

In each of these drills, the initial reaction time to shutting in the well shall be timed as well as the total time for the crew to complete its entire pit drill assignment. The times must be recorded on the IADC Driller's Log as "Blowout Control Drill".

Drill No .:

Reaction Time to Shut-In: minutes, seconds.

Total Time to Complete Assignment: minutes, seconds.

I. Drill Overviews

- a. Drill No. 1 Bottom Drilling
 - i. Sound the alarm immediately.
 - ii. Stop the rotary and hoist Kelly joint above the rotary table.
 - iii. Stop the circulatory pump.
 - iv. Close the drill pipe rams.
 - v. Record casing and drill pipe shut-in pressures and pit volume increases.
- b. Drill No. 2 Tripping Drill Pipe
 - i. Sound the alarm immediately.
 - ii. Position the upper tool joint just above the rotary table and set the slips.
 - Install a full opening valve or inside blowout preventer tool in order to close the drill pipe.
 - iv. Close the drill pipe rams.
 - v. Record the shut-in annular pressure.

II. Crew Assignments

a. Drill No. 1 - Bottom Drilling

i. Driller

- 1. Stop the rotary and hoist Kelly joint above the rotary table.
- 2. Stop the circulatory pump.
- 3. Check Flow.
- 4. If flowing, sound the alarm immediately
- 5. Record the shit-in drill pipe pressure
- 6. Determine the mud weight increase needed or other courses of action.

ii. Derrickman

- 1. Open choke line valve at BOP.
- 2. Signal Floor Man #1 at accumulator that choke line is open.
- 3. Close choke and upstream valve after pipe tam have been closed.
- 4. Read the shut-in annular pressure and report readings to Driller.

iii. Floor Man #1

- 1. Close the pipe rams after receiving the signal from the Derrickman.
- 2. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Notify the Tool Pusher and Operator representative of the H₂S alarms.
- 2. Check for open fires and, if safe to do so, extinguish them.
- 3. Stop all welding operations.
- 4. Turn-off all non-explosions proof lights and instruments.
- 5. Report to Driller for further instructions.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all crews.

- 3. Compile and summarize all information.
- 4. Calculate the proper kill weight.
- 5. Ensure that proper well procedures are put into action.

vi. Operator Representative

- 1. Notify the Drilling Superintendent.
- 2. Determine if an emergency exists and if so, activate the contingency plan.

b. Drill No. 2 - Tripping Pipe

i. Driller

- 1. Sound the alarm immediately when mud volume increase has been detected.
- 2. Position the upper tool joint just above the rotary table and set slips.
- 3. Install a full opening valve or inside blowout preventer tool to close the drill pipe.
- 4. Check flow.
- 5. Record all data reported by the crew.
- 6. Determine the course of action.

ii. Derrickman

- 1. Come down out of derrick.
- 2. Notify Tool Pusher and Operator Representative.
- 3. Check for open fires and, if safe to do so, extinguish them.
- 4. Stop all welding operations.
- 5. Report to Driller for further instructions.

iii. Floor Man #1

- 1. Pick up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #2).
- 2. Tighten valve with back-up tongs.

- 3. Close pipe rams after signal from Floor Man #2.
- 4. Read accumulator pressure and check for possible high pressure fluid leaks in valves or piping.
- 5. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Pick-up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #1).
- 2. Position back-up tongs on drill pipe.
- 3. Open choke line valve at BOP.
- 4. Signal Floor Man #1 at accumulator that choke line is open.
- 5. Close choke and upstream valve after pipe rams have been closed.
- 6. Check for leaks on BOP stack and choke manifold.
- 7. Read annular pressure.
- 8. Report readings to the Driller.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all of the crews.
- 3. Compile and summarize all information.
- 4. See that proper well kill procedures are put into action.

vi. Operator Representative

- 1. Notify Drilling Superintendent
- 2. Determine if an emergency exists, and if so, activate the contingency plan.

IGNITION PROCEDURES

Responsibility:

The decision to ignite the well is the responsibility of the DRILLING FOREMAN in concurrence with the STATE POLICE. In the event the Drilling Foreman is incapacitated, it becomes the responsibility of the RIG TOOL PUSHER. This decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope of controlling the blowout under the prevailing conditions.

If time permits, notify the main office, but do not delay if human life is in danger. Initiate the first phase of the evacuation plan.

Instructions for Igniting the Well:

- Two people are required for the actual igniting operation. Both men must wear self-contained breathing apparatus and must use a full body harness and attach a retrievable safety line to the D-Ring in the back. One man must monitor the atmosphere for explosive gases with the LEL monitor, while the Drilling Foreman is responsible for igniting the well.
- 2. The primary method to ignite is a 25mm flare gun with a range of approximately 500 feet.
- 3. Ignite from upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best suited for protection and which offers an easy escape route.
- 5. Before igniting, check for the presence of combustible gases.
- 6. After igniting, continue emergency actions and procedures as before.
- 7. All unassigned personnel will limit their actions to those directed by the Drilling Foreman.

Note: After the well is ignited, burning Hydrogen Sulfide will convert to Sulfur Dioxide, which is also highly toxic. Do not assume the area is safe after the well is ignited.

TRAINING PROGRAM

When working in an area where Hydrogen Sulfide (H₂S) might be encountered, definite training requirements must be carried out. The Company Supervisor will ensure that all personnel, at the well site, have had adequate training in the following:

- 1. Hazards and characteristics of Hydrogen Sulfide.
- 2. Physicals effects of Hydrogen Sulfide on the human body.
- 3. Toxicity of Hydrogen Sulfide and Sulfur Dioxide.
- 4. H₂S detection, Emergency alarm and sensor location.
- 5. Emergency rescue.
- 6. Resuscitators.
- 7. First aid and artificial resuscitation.
- 8. The effects of Hydrogen Sulfide on metals.
- 9. Location safety.

Service company personnel and visiting personnel must be notified if the zone contains H_2S , and each service company must provide adequate training and equipment for their employees before they arrive at the well site.

EMERGENCY EQUIPMENT REQUIREMENTS

Lease Entrance Sign:

Should be located at the lease entrance with the following information:

CAUTION – POTENTIAL POISON GAS HYDROGEN SULFIDE NO ADMITTANCE WITHOUT AUTHORIZATION

Respiratory Equipment:

- Fresh air breathing equipment should be placed at the safe briefing areas and should include the following:
- Two SCBA's at each briefing area.
- Enough air line units to operate safely, anytime the H₂S concentration reaches the IDLH level (100 ppm).
- Cascade system with enough breathing air hose and manifolds to reach the rig floor, the derrickman and the other operation areas.

Windsocks or Wind Streamers:

- A minimum of two 10" windsocks located at strategic locations so that they may be seen from any point on location.
- Wind streamers (if preferred) should be placed at various locations on the well site to ensure wind consciousness at all times. (Corners of location).

Hydrogen Sulfide Detector and Alarms:

- 1 Four channel H₂S monitor with alarms.
- Four (4) sensors located as follows: #1 Rig Floor, #2 Bell Nipple, #3 Shale Shaker, #4 Mud Pits.
- Gastec or Draeger pump with tubes.
- Sensor test gas.

Well Condition Sign and Flags:

The Well Condition Sign w/flags should be placed a minimum of 150' before you enter the location. It should have three (3) color coded flags (green, yellow and red) that will be used to denote the following location conditions:

GREEN – Normal Operating Conditions YELLOW – Potential Danger RED – Danger, H₂S Gas Present

Auxiliary Rescue Equipment:

- Stretcher
- 2 100' Rescue lines.
- First Aid Kit properly stocked.

Mud Inspection Equipment:

Garret Gas Train or Hach Tester for inspection of Hydrogen Sulfide in the drilling mud system.

Fire Extinguishers:

Adequate fire extinguishers shall be located at strategic locations.

Blowout Preventer:

- The well shall have hydraulic BOP equipment for the anticipated BHP.
- The BOP should be tested upon installation.
- BOP, Choke Line and Kill Line will be tested as specified by Operator.

Confined Space Monitor:

There should be a portable multi-gas monitor with at least 3 sensors (O_2 , LEL H_2S). This instrument should be used to test the atmosphere of any confined space before entering. It should also be used for atmospheric testing for LEL gas before beginning any type of Hot Work. Proper calibration documentation will need to be provided.

Communication Equipment:

- Proper communication equipment such as cell phones or 2-way radios should be available at the rig.
- Radio communication shall be available for communication between the company man's trailer,
 rig floor and the tool pusher's trailer.

Communication equipment shall be available on the vehicles.

Special Control Equipment:

- Hydraulic BOP equipment with remote control on the ground.
- Rotating head at the surface casing point.

Evacuation Plan:

- Evacuation routes should be established prior to spudding the well.
- Should be discussed with all rig personnel.

Designated Areas:

Parking and Visitor area:

- All vehicles are to be parked at a pre-determined safe distance from the wellhead.
- Designated smoking area.

Safe Briefing Areas:

- Two Safe Briefing Areas shall be designated on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds or they are at a 180 degree angle if wind directions tend to shift in the area.
- Personal protective equipment should be stored at both briefing areas or if a moveable cascade trailer is used, it should be kept upwind of existing winds. When wind is from the prevailing direction, both briefing areas should be accessible.

Note:

- Additional equipment will be available at the Safety Solutions, LLC office.
- Additional personal H₂S monitors are available for all employees on location.
- Automatic Flare Igniters are recommended for installation on the rig.

CHECK LISTS

Status Check List

Note: Date each item as they are implemented.

1.	Sign at location entrance.
2.	Two (2) wind socks (in required locations).
3.	Wind Streamers (if required).
4.	SCBA's on location for all rig personnel and mud loggers.
5.	Air packs, inspected and ready for use.
6.	Spare bottles for each air pack (if required).
7.	Cascade system for refilling air bottles.
8.	Cascade system and hose line hook up.
9.	Choke manifold hooked-up and tested. (before drilling out surface casing.)
10.	Remote Hydraulic BOP control (hooked-up and tested before drilling out surface casing).
11.	BOP tested (before drilling out surface casing).
12.	Mud engineer on location with equipment to test mud for H ₂ S.
13.	Safe Briefing Areas set-up
14.	Well Condition sign and flags on location and ready.
15.	Hydrogen Sulfide detection system hooked -up & tested.
16.	Hydrogen Sulfide alarm system hooked-up & tested.
17.	Stretcher on location at Safe Briefing Area.
18.	2 – 100' Life Lines on location.
19.	1 – 20# Fire Extinguisher in safety trailer.
20.	Confined Space Monitor on location and tested.
21.	All rig crews and supervisor trained (as required).

22. Access restricted for unauthorized personnel.	
23. Drills on H ₂ S and well control procedures.	
24. All outside service contractors advised of potential H ₂ S on the well.	
25. NO SMOKNG sign posted.	
26. H ₂ S Detector Pump w/tubes on location.	
27. 25mm Flare Gun on location w/flares.	
28. Automatic Flare Igniter installed on rig.	

Procedural Check List

Perform the following on each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to insure that they have not been tampered with.
- 3. Check pressure on the supply air bottles to make sure they are capable of recharging.
- 4. Make sure all of the Hydrogen Sulfide detection systems are operative.

Perform the following each week:

- 1. Check each piece of breathing equipment to make sure that they are fully charged and operational. This requires that the air cylinder be opened and the mask assembly be put on and tested to make sure that the regulators and masks are properly working. Negative and Positive pressure should be conducted on all masks.
- 2. BOP skills.
- 3. Check supply pressure on BOP accumulator stand-by source.
- 4. Check all breathing air mask assemblies to see that straps are loosened and turned back, ready for use.
- 5. Check pressure on cascade air cylinders to make sure they are fully charged and ready to use for refill purposes if necessary.
- 6. Check all cascade system regulators to make sure they work properly.
- 7. Perform breathing drills with on-site personnel.
- 8. Check the following supplies for availability:
 - Stretcher
 - Safety Belts and Ropes
 - Spare air Bottles
 - Spare Oxygen Bottles (if resuscitator required)
 - Gas Detector Pump and Tubes
 - Emergency telephone lists
- 9. Test the Confined Space Monitor to verify the batteries are good

BRIEFING PROCEDURES

The following scheduled briefings will be held to ensure the effective drilling and operation of this project:

Pre-Spud Meeting

Date: Prior to spudding the well.

Attendance: Drilling Supervisor

Drilling Engineer Drilling Foreman Rig Tool Pushers Rig Drillers Mud Engineer

All Safety Personnel

Key Service Company Personnel

Purpose: Review and discuss the well program, step-by-step, to insure complete understanding of

assignments and responsibilities.

EVACUATION PLAN

General Plan

The direct lines of action prepared by SAFETY SOLUTIONS, LLC to protect the public from hazardous gas situations are as follows:

- 1. When the company approved supervisor (Drilling Foreman, Tool Pusher or Driller) determine that Hydrogen Sulfide gas cannot be limited to the well location, and the public will be involved, he will activate the evacuation plan. Escape routes are noted on the area map.
- 2. Company safety personnel or designee will notify the appropriate local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company approved safety personnel that have been trained in the use of the proper emergency equipment will be utilized.
- 4. Law enforcement personnel (State Police, Local Police Department, Fire Department, and the Sheriff's Department) will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.

NOTE: Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

5. After the discharge of gas has been controlled, "Company" safety personnel will determine when the area is safe for re-entry.

See Emergency Action Plan

Emergency Assistance Telephone List

PUBLIC SAFETY:	911				
Eddy County Sheriff's Department		(575) 887-7551			
Kent Waller					
Fire Department:					
Carlsbad		(575) 885-3125			
Artesia		(575) 746-5050			
Hospitals:					
Carlsbad		(575) 887-4121			
Artesia		(575) 748-3333			
Hobbs		(575) 392-1979			
Dept. of Public Safety/Carlsbad		(575) 748-9718			
Highway Department		(575) 885-3281			
New Mexico Oil Conservation		(575) 476-3440			
U.S. Dept. of Labor		(575) 887-1174			
EOG Resources, Inc.					
EOG / Midland	Office	(432) 686-3600			
Company Drilling Consultants:		,			
Danny Kiser Will Henderson	Cell	(432) 894-3417			
Larry King		•			
Drilling Engineer					
Steve Munsell	Office	(432) 686-3609			
	Cell	(432) 894-1256			
Operations Manager		,			
Travis Lain	Office	(432) 686-3740			
	Cell	(432) 254-3521			
Drilling Superintendent					
Barney Thompson	Office	(432) 686-3678			
	Cell	(432) 254-9056			
Field Drilling Superintendent					
Ron Welch	Cell	(432) 386-0592			
McVay Drilling					
Cactus Drilling	Office	(580) 799-2752			
Cactus Drilling Rig #123	Rig	(432) 894-3417			
Tool Pusher:					
Terry Johnson	Cell	(575) 370-5620			
Cafatu Canaultanta					
Safety Consultants	Offi	(422) 696 9555			
Safety Solutions, LLC		(432) 686-8555			
Cliff Strasner	Cell	(432) 894-9789			
Craig Strasner	Cell	(432) 894-0341			

MAPS AND PLATS (Maps & Plats Attached)

Affected Notification List

(within a 65' radius of exposure @100ppm)

The geologic zones that will be encountered during drilling are known to contain hazardous quantities of H_2S . The accompanying map illustrates the affected areas of the community. The residents within this radius will be notified via a hand delivered written notice describing the activities, potential hazards, conditions of evacuation, evacuation drill siren alarms and other precautionary measures.

Evacuee Description:

Residents:

THERE ARE NO RESIDENTS WITHIN 3000' ROE.

Notification Process:

A continuous siren audible to all residence will be activated, signaling evacuation of previously notified and informed residents.

Evacuation Plan:

All evacuees will migrate lateral to the wind direction.

The Oil Company will identify all home bound or highly susceptible individuals and make special evacuation preparations, interfacing with the local and emergency medical service as necessary.

GENERAL INFORMATION

Toxic Effects of H₂S Poisoning

Hydrogen Sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 PPM, which is .001% by volume. Hydrogen Sulfide is heavier than air (specific gravity -1.192) and is colorless and transparent. Hydrogen Sulfide is almost as toxic as Hydrogen Cyanide and is 5-6 times more toxic than Carbon Monoxide. Occupational exposure limits for Hydrogen Sulfide and other gases are compared below in Table 1. Toxicity table for H_2S and physical effects are shown in Table 2.

Table 1
Permissible Exposure Limits of Various Gases

Common Name	Symbol	Sp. Gravity	TLV	STEL	IDLH
Hydrogen Cyanide	HCN	.94	4.7 ppm	С	
Hydrogen Sulfide	H ₂ S	1.192	10 ppm	15 ppm	100 ppm
Sulfide Dioxide	SO ₂	2.21	2 ppm	5 ppm	
Chlorine	CL	2.45	.5 ppm	1 ppm	
Carbon Monoxide	со	.97	25 ppm	200 ppm	
Carbon Dioxide	CO ₂	1.52	5000 ppm	30,000 ppm	
Methane	CH ₄	.55	4.7% L EL	14% UEL	

Definitions

- A. TLV Threshold Limit Value is the concentration employees may be exposed based on a TWA (time weighted average) for eight (8) hours in one day for 40 hours in one (1) week. This is set by ACGIH (American Conference of Governmental Hygienists) and regulated by OSHA.
- B. STEL Short Term Exposure Limit is the 15 minute average concentration an employee may be exposed to providing that the highest exposure never exceeds the OEL (Occupational Exposure Limit). The OEL for H₂S is 19 PPM.
- C. IDLH Immediately Dangerous to Life and Health is the concentration that has been determined by the ACGIH to cause serious health problems or death if exposed to this level. The IDLH for H₂S is 100 PPM.
- D. TWA Time Weighted Average is the average concentration of any chemical or gas for an eight
 (8) hour period. This is the concentration that any employee may be exposed based on an TWA.

TABLE 2

		Toxicity Table of H₂S
Percent %	PPM	Physical Effects
.0001	1	Can smell less than 1 ppm.
.001	10	TLV for 8 hours of exposure.
.0015	15	STEL for 15 minutes of exposure.
.01	100	Immediately Dangerous to Life & Health.
		Kills sense of smell in 3 to 5 minutes.
.02	200	Kills sense of smell quickly, may burn eyes and throat.
.05	500	Dizziness, cessation of breathing begins in a few minutes.
.07	700	Unconscious quickly, death will result if not rescued promptly.
.10	1000	Death will result unless rescued promptly. Artificial resuscitation may be necessary.

PHYSICAL PROPERTIES OF H₂S

The properties of all gases are usually described in the context of seven major categories:

COLOR

ODOR

VAPOR DENSITY

EXPLOSIVE LIMITS

FLAMMABILITY

SOLUBILITY (IN WATER)

BOILING POINT

Hydrogen Sulfide is no exception. Information from these categories should be considered in order to provide a fairly complete picture of the properties of the gas.

COLOR - TRANSPARENT

Hydrogen Sulfide is colorless so it is invisible. This fact simply means that you can't rely on your eyes to detect its presence. In fact that makes this gas extremely dangerous to be around.

ODOR – ROTTEN EGGS

Hydrogen Sulfide has a distinctive offensive smell, similar to "rotten eggs". For this reason it earned its common name "sour gas". However, H₂S, even in low concentrations, is so toxic that it attacks and quickly impairs a victim's sense of smell, so it could be fatal to rely on your nose as a detection device.

VAPOR DENSITY - SPECIFIC GRAVITY OF 1.192

Hydrogen Sulfide is heavier than air so it tends to settle in low-lying areas like pits, cellars or tanks. If you find yourself in a location where H₂S is known to exist, protect yourself. Whenever possible, work in an area upwind and keep to higher ground.

EXPLOSIVE LIMITS – 4.3% TO 46%

Mixed with the right proportion of air or oxygen, H₂S will ignite and burn or explode, producing another alarming element of danger besides poisoning.

FLAMMABILITY

Hydrogen Sulfide will burn readily with a distinctive clear blue flame, producing Sulfur Dioxide (SO₂), another hazardous gas that irritates the eyes and lungs.

SOLUBILITY – 4 TO 1 RATIO WITH WATER

Hydrogen Sulfide can be dissolved in liquids, which means that it can be present in any container or vessel used to carry or hold well fluids including oil, water, emulsion and sludge. The solubility of H_2S is dependent on temperature and pressure, but if conditions are right, simply agitating a fluid containing H_2S may release the gas into the air.

BOILING POINT – (-76 degrees Fahrenheit)

Liquefied Hydrogen Sulfide boils at a very low temperature, so it is usually found as a gas.

RESPIRATOR USE

The Occupational Safety and Health Administration (OSHA) regulate the use of respiratory protection to protect the health of employees. OSHA's requirements are written in the Code of Federal Regulations, Title 29, Part 1910, Section 134, Respiratory Protection. This regulation requires that all employees who might be required to wear respirators, shall complete a OSHA mandated medical evaluation questionnaire. The employee then should be fit tested prior to wearing any respirator while being exposed to hazardous gases.

Written procedures shall be prepared covering safe use of respirators in dangerous atmospheric situations, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available respirators.

Respirators shall be inspected prior to and after each use to make sure that the respirator has been properly cleaned, disinfected and that the respirator works properly. The unit should be fully charged prior to being used.

Anyone who may use respirators shall be properly trained in how to properly seal the face piece. They shall wear respirators in normal air and then in a test atmosphere. (Note: Such items as facial hair (beard or sideburns) and eyeglass temple pieces will not allow a proper seal.) Anyone that may be expected to wear respirators should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses. Contact lenses should not be allowed.

Respirators shall be worn during the following conditions:

- A. Any employee who works near the top or on the top of any tank unless tests reveal less than 20 ppm of H_2S .
- B. When breaking out any line where H₂S can reasonably be expected.
- C. When sampling air in areas where H_2S may be present.
- D. When working in areas where the concentration of H₂S exceeds the Threshold Limit Value for H₂S (10 ppm).
- E. At any time where there is a doubt as to the H₂S level in the area to be entered.

EMERGENCY RESCUE PROCEDURES

DO NOT PANIC!!!

Remain Calm - Think

- 1. Before attempting any rescue you must first get out of the hazardous area yourself. Go to a safe briefing area.
- 2. Sound alarm and activate the 911 system.
- 3. Put on breathing apparatus. At least two persons should do this, when available use the buddy system.
- 4. Rescue the victim and return them to a safe briefing area.
- 5. Perform an initial assessment and begin proper First Aid/CPR procedures.
- 6. Keep victim lying down with a blanket or coat, etc.., under the shoulders to keep airway open. Conserve body heat and do not leave unattended.
- 7. If the eyes are affected by H₂S, wash them thoroughly with potable water. For slight irritation, cold compresses are helpful.
- 8. In case a person has only minor exposure and does not lose consciousness totally, it's best if he doesn't return to work until the following day.
- 9. Any personnel overcome by H_2S should always be examined by medical personnel. They should always be transported to a hospital or doctor.