

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Div-Dist. 2  
1301 W. Grand Avenue  
Albuquerque, NM 88210

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals

**SUBMIT IN TRIPLICATE**

**RECEIVED**

**JUN 14 2005**

**OCU-NTBIA**

1. Type of Well

Oil Gas  
☒ Well ☐ Well ☐ Other

2. Name of Operator

**STRATA PRODUCTION COMPANY**

3. Address and Telephone No.

**P. O. Box 1030  
Roswell, New Mexico 88202-1030 505-622-1127**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

**2080' FSL & 840' FEL  
Section 21-23S-30E**

5. Lease Designation and Serial No.  
**NM-104965**

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

**Forty Niner Ridge Unit #4**

9. API Well No.

**30-015-33743**

10. Field and Pool, or Exploratory Area

**Forty Niner Ridge Delaware**

11. County or Parish, State

**Eddy County, New Mexico**

**12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

**TYPE OF SUBMISSION**

**TYPE OF ACTION**

☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice


☐ Abandonment  
☒ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ OTHER

☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Install BOP. POH w/production equipment. TIH /w5 1/2" RBP. Set at 6800'. Test at 2000 psi. POH. Perforate 20 .42" holes @ 6623' - 6123'. TIH w/packer & RBP. Acidize @ 6623' - 6523'; 6354' - 6254'; 6129' - 6029'. If necessary swab individual zones to determine oil/wtr cuts. Frac 6586' - 6623'; 6335' - 6354'; 6123' - 6129'. Bleed off pressure. POH w/packer & RBP. TIH w/tubing & retrieving head. Swab to recover load & test. Clean out to RBP @ 6800'. POH w/RBP. Run production equipment & test.

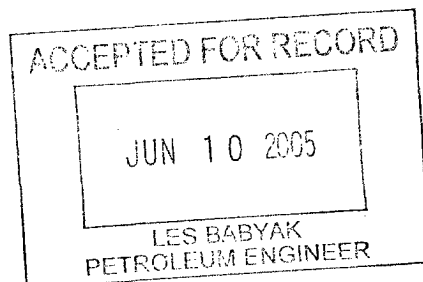

14. I hereby certify that the foregoing is true and correct

Signature *Ken M. Brutt* Title Production Records Date 06/03/05

(This space for Federal or State office use)

Approved by \_\_\_\_\_ Title \_\_\_\_\_ Date \_\_\_\_\_

Conditions of approval, if any: