

Form'3160-5 (June 2015)		UNITED STATES EPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT NOTICES AND REPORTS ON WELLS		OCD ATTESTA DI	ERVATIO	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.	
-	GEMENT NM ARTESTA DA RTS ON WELLS FEB 1 4 2018 drill or to re-enter an D) for such proposals.			5. Lease Serial No. NMNM81616			
D ab	e-enter an proposals. దార్	EIVER	6. If Indian, Allottee of	or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2						7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well □ Gas Well □ Other				8		8. Well Name and No. H B 10A FEDERAL 8	
2. Name of Operator DEVON ENERGY PRODUCTION COM-Mail: ronnie.slack@dvn.com				ACK		9. API Well No. 30-015-29915-00-\$1	
3a. Address 6488 SEVEN RIVERS HIGHWAY ARTESIA, NM 88211			3b. Phone No. (include area code) Ph: 405-552-4615			10. Field and Pool or Exploratory Area CEDAR CANYON	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description			ı)			11. County or Parish,	State
Sec 10 T24S R2	29E SESE 660	OFSL 400FEL				EDDY COUNT	Y, NM
12. CH	ECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	ATE NATURE OI	FNOTICE	, REPORT, OR OTH	HER DATA
TYPE OF SUBM	PE OF SUBMISSION			TYPE OF	ACTION		
Notice of Intent	.+	Acidize	🗖 De	epen	Produc	tion (Start/Resume)	□ Water Shut-Off
		Alter Casing	🗖 Ну	draulic Fracturing	🗖 Reclam	nation	Well Integrity
Subsequent Rep	port	🗖 Casing Repair	New Construction		Recomplete		🗖 Other
Final Abandonment Notice		🗖 Change Plans	Plug and Abandon 📋 Tempo		rarily Abandon		
		Convert to Injection	🗖 Plug Back 🗖 Wa		U Water	ter Disposal	
If the proposal is to a Attach the Bond und following completion testing has been com	deepen directiona der which the wor on of the involved npleted. Final At	eration: Clearly state all pertine ally or recomplete horizontally, rk will be performed or provide operations. If the operation re pandonment Notices must be fil	, give subsurfac the Bond No. o sults in a multi	e locations and measur on file with BLM/BIA ple completion or reco	red and true v . Required su mpletion in a	ertical depths of all pertin ibsequent reports must be new interval, a Form 316	nent markers and zones. filed within 30 days for 4 must be filed once
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cat 7. Pump 35 sx (1 8. Perf 5-1/2" cat 9. Pump 100 sx	deepen direction: der which the wor on of the involved npleted. Final At site is ready for f nit. POOH w/r 5,830'. Tag. Ci 50') CI C @ 6, 50') CI C @ 3, 50') CI C @ 3, soing @ 850' . 140') CI C in/ou ssing @ 400'. CI C in/out @	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re andonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 882 but (2) 850' - 7 10 ^t . Tag. (T 2) 7 400' to surface. Set dry hole marker.	, give subsurfac the Bond No. (ssults in a multipled only after al function tubing pring 6774') cer) elaware 2998 5. Salt 832') 2 2 2	e locations and measure on file with BLM/BIA ple completion or reco Il requirements, includi g from 7,976'.	red and true v . Required su mpletion in a ing reclamatio Salt 2810')	ertical depths of all pertir absequent reports must be new interval, a Form 316 on, have been completed a RECLAMATIO	nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED D FOR
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" ca 9. Pump 100 sx	deepen directions der which the wor on of the involved mpleted. Final At site is ready for f hit. POOH w/r 5,830'. Tag. Ci 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, asing @ 860' . 140') CI C in/o asing @ 400'. CI C in/out @ d off 3' BGL.	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re inandonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 852 out @ 850' - 210'. Tag. (T 9 8 2 400' to surface. Set dry hole marker.	give subsurfac the Bond No. o soults in a multipled only after al function tubing pring 6774') cer) plaware 2998 T.Salt 832') S & Z Corepted for 402848 verifition	e locations and measure on file with BLM/BIA ple completion or reco Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 3'; Shoe 2933'; B.S 7 record - NMOC record - NMOC	red and true v . Required sumpletion in a ing reclamation Salt 2810') Salt 2810') Information to the Carls	ertical depths of all pertir ibsequent reports must be new interval, a Form 316 in, have been completed a RECLAMATIO. ATTA EE ATTACHE ONDITIONS (nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cat 9. Pump 100 sx 10. Cut wellhead	deepen directions der which the wor on of the involved inpleted. Final At site is ready for f nit. POOH w/r 5,830'. Tag. Ci 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, sing @ 850' . 140') CI C in/o sing @ 400'. CI C in/out @ d off 3' BGL. S	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. Tod pump and 2-7/8" prod reculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 8 7 2 but @ 850' - 710'. Tag. (T 9 7 2 400' to surface. Set dry hole marker. Ture and correct. Electronic Submission # For DEVON ENERG mmitted to AFMSS for proc	give subsurfac the Bond No. o soults in a multipled only after al function tubing pring 6774') cer) plaware 2998 T.Salt 832') S & Z Corepted for 402848 verifition	e locations and measu on file with BLM/BIA ple completion or reco. Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 7; Shoe 2933'; B.S	red and true v . Required su mpletion in a ing reclamation Salt 2810') Salt 2810') Salt 2810') I Information to the Carlis o 01/31/2018	ertical depths of all pertir ibsequent reports must be new interval, a Form 316 in, have been completed a RECLAMATIO. ATTA EE ATTACHE ONDITIONS (nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cas 7. Pump 35 sx (1 8. Perf 5-1/2" cas 9. Pump 100 sx 10. Cut wellhead	deepen directions der which the wor on of the involved inpleted. Final At site is ready for f nit. POOH w/r 5,830'. Tag. Ci 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, sing @ 850' . 140') CI C in/o sing @ 400'. CI C in/out @ d off 3' BGL. S	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 8 7 2 out (2) 850' - 710'. Tag. (T (2) 7 3 400' to surface. Set dry hole marker. Three and correct. Electronic Submission # For DEVON ENERG mitted to AFMSS for proc SLACK	give subsurfac the Bond No. o soults in a multipled only after al function tubing pring 6774') cer) plaware 2998 T.Salt 832') S & Z Corepted for 402848 verifition	e locations and measu on file with BLM/BIA ple completion or reco. Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 7; Shoe 2933'; B.S	red and true v . Required sumpletion in a ing reclamation ing teclamation ing teclamation ing teclamation ing teclamation Information to the Carlis O1/31/2018 ICTION TE	ertical depths of all pertir ibsequent reports must be new interval, a Form 316 in, have been completed a RECLAMATIO ATTA EE ATTACHE ONDITIONS (n System sbad 3 (18PP0969SE)	nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cas 7. Pump 35 sx (1 8. Perf 5-1/2" cas 9. Pump 100 sx 10. Cut wellhead	deepen directions der which the wor on of the involved inpleted. Final At site is ready for f nit. POOH w/r 6,830'. Tag. Ci 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, sing @ 860' . 140') CI C in/o sing @ 400'. CI C in/out @ d off 3' BGL. S at the foregoing is con ad RONNIE S	ally or recomplete horizontally, rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 8 7 2 out (2) 850' - 710'. Tag. (T (2) 7 3 400' to surface. Set dry hole marker. Three and correct. Electronic Submission # For DEVON ENERG mitted to AFMSS for proc SLACK	give subsurfac the Bond No. (sults in a multipled only after al function tubing pring 6774') cer) claware 2998 C.Salt 832') S Z Coccepted for 402848 verifi SY PRODUCT cessing by PR	e locations and measu on file with BLM/BIA ple completion or reco. Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 3'; Shoe 2933'; B.S 7 ccord - NMOC record - NMOC record - NMOC record - NMOC record - NMOC record - NMOC record - NMOC	red and true v . Required sumpletion in a ing reclamation Salt 2810') Salt 2810'] Salt 2810	ertical depths of all pertir the equent reports must be new interval, a Form 316 on, have been completed a RECLAMATIO ATTA EE ATTACHE ONDITIONS (n System shad 8 (18PP0969SE) CHNOLOGIST	nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cat 9. Pump 35 sx (1 8. Perf 5-1/2" cat 9. Pump 100 sx 10. Cut wellhead 14. 1 hereby certify that Name (<i>Printed/Typee</i> Signature	deepen directions der which the wor on of the involved inpleted. Final At site is ready for f nit. POOH w/r 5,830'. Tag. Ci 50') Cl C @ 6, 50') Cl C @ 3, 50') Cl C @ 3, 50') Cl C @ 3, 50') Cl C @ 3, 50') Cl C @ 3, sing @ 850' . 140') Cl C in/out sing @ 400'. Cl C in/out @ d off 3' BGL. S at the foregoing is con ed) RONNIE S	ally or recomplete horizontally, rk will be performed or provide loperations. If the operation re pandonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp. 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 8 7 2 but @ 850' - 210'. Tag. (T 9 8 2 hut @ 850' - 210'. Tag. (T 9 10 hut	give subsurfac the Bond No. (sults in a multipled only after al function tubing oring 6774') cer) blaware 2998 C.Salt 832') Seccepted for Accepted for by PRODUCT ressing by PR	e locations and measure on file with BLM/BIA ple completion or reco. Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 3'; Shoe 2933'; B.S 7 - 1 S - 1 S 7 record - NMOC 10N COM LP, sent 10N COM LP, se	red and true v . Required sumpletion in a ing reclamation calt 2810') Salt 2810	ertical depths of all pertir the equent reports must be new interval, a Form 316 an, have been completed a RECLAMATIO ATTA EE ATTACHE ONDITIONS (n System shad 3 (18PP0969SE) CHNOLOGIST USE AET	nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED
If the proposal is to a Attach the Bond und following completion testing has been com determined that the s 1. MIRU P&A un 2. Set CIBP @ 6 3. Spot 25 sx (25 4. Spot 25 sx (25 5. Spot 35 sx (35 6. Perf 5-1/2" cat 7. Pump 35 sx (35 6. Perf 5-1/2" cat 9. Pump 100 sx 10. Cut wellhead 14. I hereby certify that Name (<i>Printed/Typed</i> Signature	deepen directions der which the wor on of the involved inpleted. Final At site is ready for f hit. POOH w/r 5,830'. Tag. Ci 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, 50') CI C @ 3, sing @ 860' . 140') CI C in/out asing @ 400' . CI C in/out @ d off 3' BGL. S at the foregoing is con ad RONNIE S (Electronic S	ally or recomplete horizontally, rk will be performed or provide loperations. If the operation re andonment Notices must be fil inal inspection. od pump and 2-7/8" prod irculate 10# salt gel mud. 830' - 6,580'. (T.Bone Sp. 580' - 3,330'. (3000' spac 050' - 2,700'. Tag. (T.De 8 8 2 but @ 850' - 710'. Tag. (T. 8 8 2 400' to surface. Set dry hole marker. For DEVON ENERG mitted to AFMSS for proc SLACK Submission) THIS SPACE FO d. Approval of this notice does itable title to those rights in th	give subsurfac the Bond No. (subts in a multipled only after al function tubing oring 6774') cer) plaware 2998 C.Salt 832') Secepted for 402848 verifi SY PRODUCT ressing by PR DR FEDER	e locations and measure on file with BLM/BIA ple completion or reco. Il requirements, includi g from 7,976'. 3'; Shoe 2933'; B.S 3'; Shoe 2933'; B.S 7 - 1 S - 1 S 7 record - NMOC 10N COM LP, sent 10N COM LP, se	red and true v . Required sumpletion in a ing reclamation Galt 2810') Salt 2810	ertical depths of all pertir the equent reports must be new interval, a Form 316 an, have been completed a RECLAMATIO ATTA EE ATTACHE ONDITIONS (n System shad 3 (18PP0969SE) CHNOLOGIST USE AET	nent markers and zones. filed within 30 days 60-4 must be filed once and the operator has N PROCEDURE CHED D FOR OF APPROVA 2-7-1

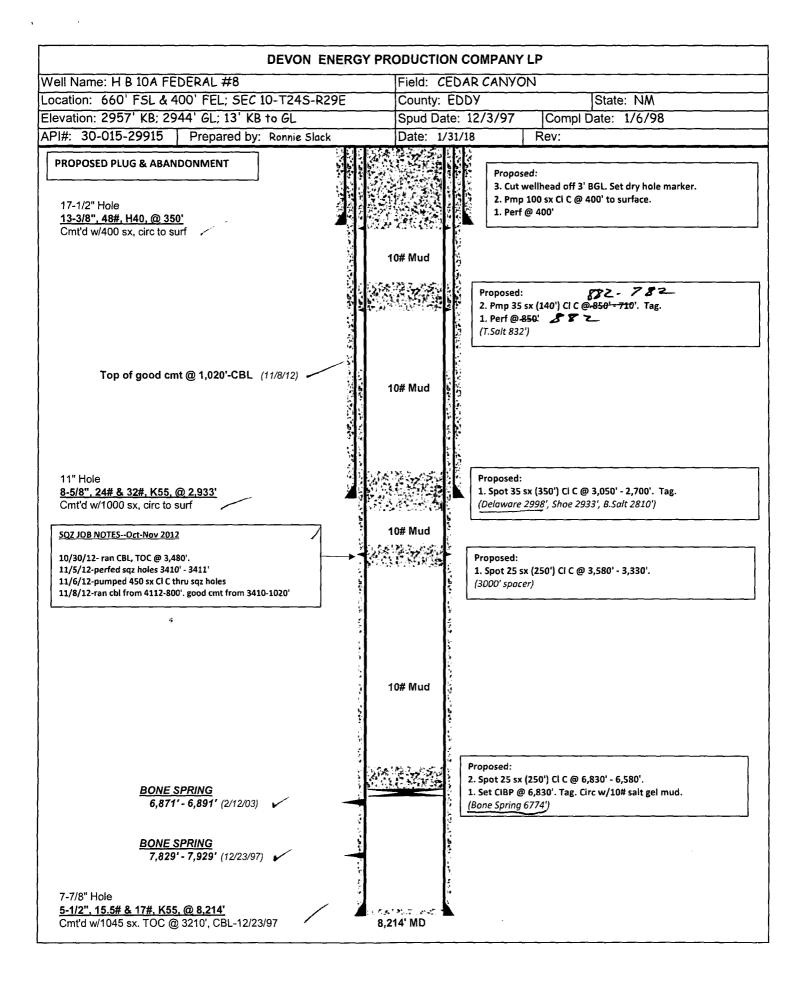

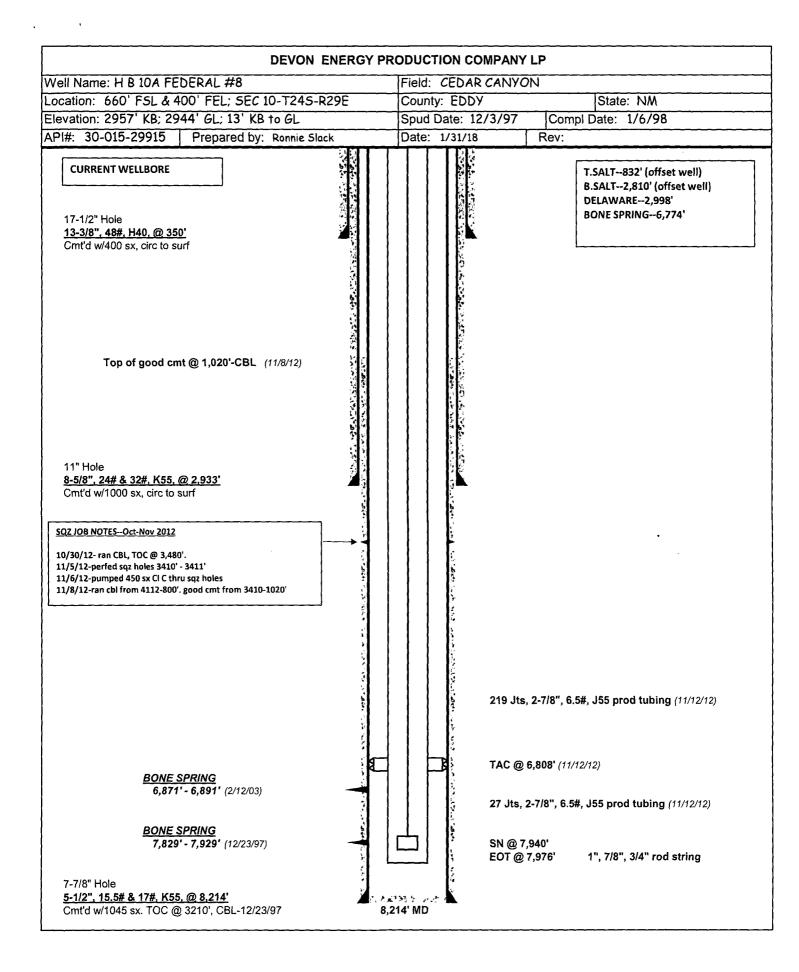

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

. .

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612