UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia


FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018


5. Lease Serial No. NMNM0405444A

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

_			
6.	If Indian.	Allottee or Tril	e Name

abandoned we	o. Il ilidiali, Allottee c	i Trice Name						
SUBMIT IN	7. If Unit or CA/Agreement, Name and/or No.							
Type of Well ☐ Gas Well ☐ Oth	8. Well Name and No. TODD 26P FED 16							
Name of Operator DEVON ENERGY PRODUCT	9. API Well No. 30-015-27134-00-S1							
3a. Address 333 WEST SHERIDAN AVEN OKLAHOMA, OK 73102		b. Phone No. (include area code) h: 405-552-4615		10. Field and Pool or Exploratory Area INGLE WELLS				
4. Location of Well (Footage, Sec., T			11. County or Parish, State					
Sec 26 T23S R31E SESE 330			EDDY COUNTY, NM					
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE	OF NOTICE	REPORT, OR OTI	HER DATA		
TYPE OF SUBMISSION	YPE OF SUBMISSION TYPE OF ACTION							
Notice of Intent	☐ Acidize		☐ Deepen ☐		tion (Start/Resume)	■ Water Shut-Off		
_	☐ Alter Casing	□ Ну	☐ Hydraulic Fracturing		ation	■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	☐ Ne	■ New Construction		plete	Other		
☐ Final Abandonment Notice	☐ Change Plans	🛛 Plu	☑ Plug and Abandon		rarily Abandon			
	☐ Convert to Injection		g Back	☐ Water	Disposal			
1. MIRU P&A unit. 2. Pull rod pump assembly and 2-7/8" production tubing from 8,262'. 3. Set CIBP @ 6,680'. Tag. Circulate 10# salt gel mud. (Open perfs 6722'-8228') 4. Spot 25 sx (250') CI C @ 6,680' - 6,430'. 5. Spot 25 sx (250') CI C @ 5,835' - 5,585'. **C** 6. Spot 270 sx (2730') CI C @ 4,525' - 1,795'. Tag. (Delaware 4475'; B.Salt 4055'; R-111P area) 7. Perf @ 5-1/2" casing @ 1,775'. Pump 235 sx (1005') CI C in/out @ 1,775' - 770'. Tag. (continue salt plug. T.Salt 1090') 8. Perf @ 5-1/2" casing @ 140'. Pump 35 sx CI C in/out from 140' to surface. 9. Cut wellhead off 3' BGL. Set dry hole marker. DISTRICT II-ARTESIA O.C.D.								
Below grouns	Slevel de	y ho	/	erker	require			
14. I hereby certify that the foregoing is	true and correct. Electronic Submission # For DEVON ENERG nmitted to AFMSS for proc	Y PRODUCTI	ΦΝ COM LP, so	ent to the Carls	baď			
Name (Printed/Typed) RONNIE S	SLACK		Title PRO	DUCTION TE	CHNOLOGIST			
Signature (Electronic S	Submission)		Date 03/01	/2018				
	THIS SPACE FO	OR FEDER	AL OR STAT	E OFFICE U	SE			
Approved By Conditions of approval, if any, are attached	d. Approval of this notice does	not warrant or	Title	Sapo.	SET	7-10-18 Date		
certify that the applicant holds legal or equivalent would extitle the applicant to condu	uitable title to those rights in the	e subject lease	Office Control of the	riskar	ake to any denominant	e grancy of the United		
Title 18 U.S.C. Section 1001 and Title 43	U.S.C. Section 1212, make it a	to any matter y	erson knowingly a	na wiiituliy to m	ake to any department or	agency of the United		

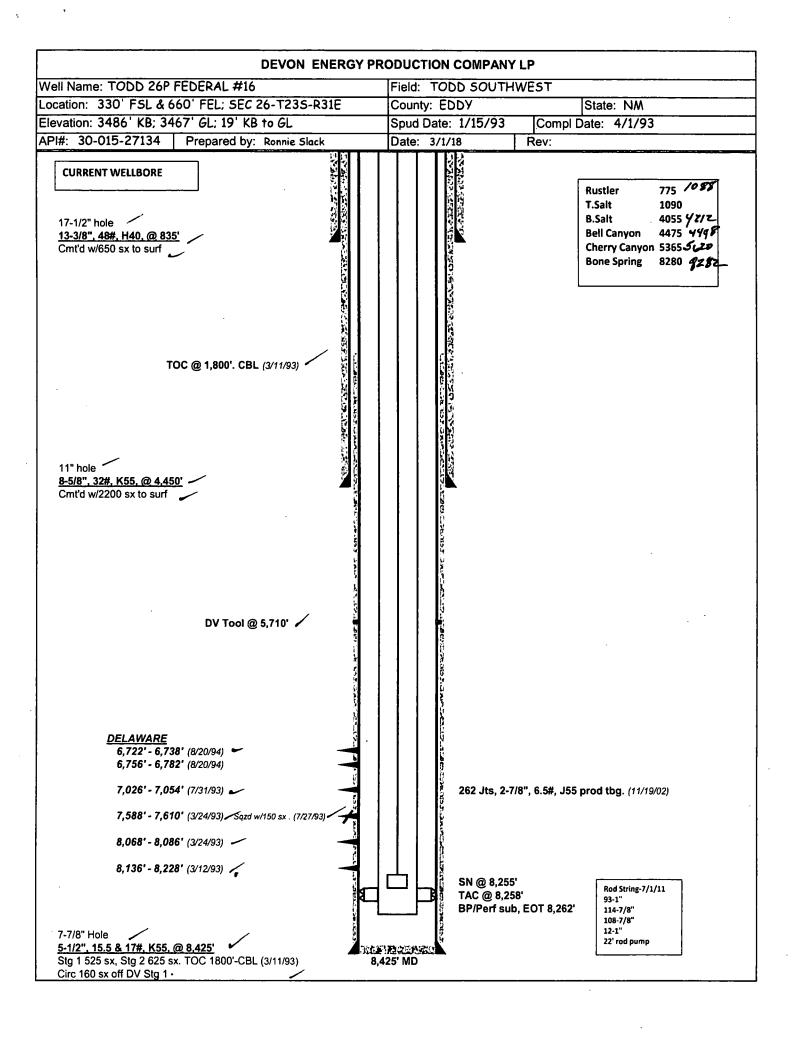

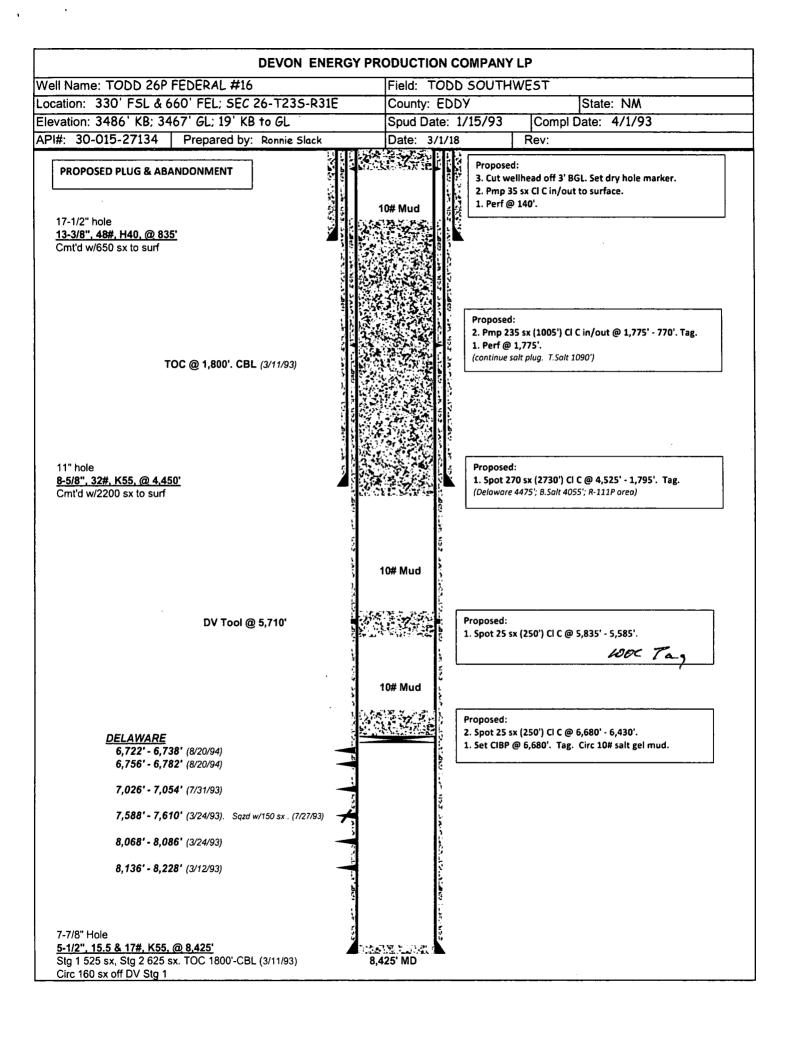

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted