
June 2015)	S NTERIOR GEMENT		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018			
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2 1. Type of Well Other Other				 5. Lease Serial No. NMLC060999 6. If Indian, Allottee or Tribe Name 7. If Unit or CA/Agreement, Name and/or No. 8. Well Name and No. MCINTYRE B 3 		
			6. It			
			7. I			
2. Name of Operator COG OPERATING LLC Contact: ABIGAIL ANDERSON E-Mail: abbym@bcmandassociates.com				9. API Well No. 30-015-22444-00-S1		
3a. Address 600 W ILLINOIS AVENUE MIDLAND, TX 79701	3b. Phone No. (include area code) Ph: 432-580-7161		10. Field and Pool or Exploratory Area GRAYBURG			
4. Location of Well (Footage, Sec	n)	11.	11. County or Parish, State			
Sec 20 T17S R30E NWSW	Dag Fillo C L		EDDY COUNTY, NM			
12. CHECK THE	APPROPRIATE BOX(ES	16. SLOATTACTED	FTORICE, REP	ORT, OR OTI	HER DATA	
TYPE OF SUBMISSION	0	CONDITIONS OF APPROXAL				
Notice of Intent	Acidize	Deepen	Production (S	Start/Resume)	UWater Shut-Off	
—	Alter Casing	Hydraulic Fracturing	Reclamation		U Well Integrity	
Subsequent Report	Casing Repair	New Construction	Recomplete		🗋 Other	
Final Abandonment Notice		🛛 Plug and Abandon	Temporarily			
	Convert to Injection	Plug Back	Water Dispos	sal		
Attach the Bond under which the following completion of the invo testing has been completed. Fina	work will be performed or provide ved operations. If the operation re Abandonment Notices must be fit	, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ	 Required subseque mpletion in a new in 	depths of all pertir ent reports must be terval, a Form 316	ent markers and zones. filed within 30 days 60-4 must be filed once	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sgz 120 sx cmt @	work will be performed or provide lved operations. If the operation re A bandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 530'-Surface. (T/Salt & 8 \$, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe)	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f	depths of all pertir int reports must be terval, a Form 316 e been completed a	tent markers and zones. filed within 30 days 60-4 must be filed once and the operator has	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sgz 120 sx cmt @	work will be performed or provide lved operations. If the operation re A bandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 530'-Surface. (T/Salt & 8 \$, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f	depths of all pertir int reports must be terval, a Form 316 e been completed a AESIA DIE	Filed within 30 days 50-4 must be filed once and the operator has	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @	work will be performed or provide lved operations. If the operation re A bandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 530'-Surface. (T/Salt & 8 \$, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe)	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f	depths of all pertir int reports must be terval, a Form 316 e been completed a	ent markers and zones. filed within 30 days 60-4 must be filed once and the operator has	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sgz 120 sx cmt @	work will be performed or provide lved operations. If the operation re l Abandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 0 530'-Surface. (T/Salt & 8 th cement to surface, weld on C C	, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f	depths of all pertir int reports must be terval, a Form 316 e been completed a AESIA DIE	ent markers and zones. filed within 30 days 60-4 must be filed once and the operator has TRICT 2019	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sgz 120 sx cmt @	work will be performed or provide lved operations. If the operation re A bandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 530'-Surface. (T/Salt & 8 \$, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f	depths of all pertir int reports must be terval, a Form 316 e been completed a ALLESIA DIS FEB 08 2	ent markers and zones. filed within 30 days 60-4 must be filed once and the operator has TRICT 2019	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify	work will be performed or provide ved operations. If the operation re A bandonment Notices must be fir or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 0 530'-Surface. (T/Salt & 8 the cement to surface, weld on	, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2//9//9 cord - NMOCD	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f::::::::::::::::::::::::::::::::::::	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	Antimatkers and zones. filed within 30 days 50-4 must be filed once and the operator has FIRICT 2019 ED	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify	work will be performed or provide lved operations. If the operation re l Abandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 0 530'-Surface. (T/Salt & 8 & cement to surface, weld on Generation of the surface of the second Accepted for re Electronic Submission for For COG (Committed to AFMSS for pr	, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2//9//9 cord - NMOCD	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f::::::::::::::::::::::::::::::::::::	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	Antimatkers and zones. filed within 30 days 50-4 must be filed once and the operator has FIRICT 2019 ED	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify 4. Cut off well head, verify 14. I hereby certify that the foregoin Name (Printed/Typed) ABIGA	work will be performed or provide lved operations. If the operation re l Abandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 0 530'-Surface. (T/Salt & 8 & cement to surface, weld on Generation of the surface of the second Accepted for re Electronic Submission for For COG (Committed to AFMSS for pr	, give subsurface locations and measu te the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2//9//9 cord - NMOCD 4450529 verified by the BLM Well DPERATING LLC, sent to the Ca rocessing by JAMES AMOS on 0	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. F.C.7 & r. Information Syst rIsbad 1/15/2019 (19JA0)	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	ent markers and zones. filed within 30 days 60-4 must be filed once and the operator has ED ED	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify 4. Cut off well head, verify 14. I hereby certify that the foregoir Name (Printed/Typed) ABIGA	work will be performed or provide lved operations. If the operation re l Abandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 9530'-Surface. (T/Salt & 8 st cement to surface, weld on <i>G</i> C Accepted for re Electronic Submission for For COG C Committed to AFMSS for pu IL ANDERSON	, give subsurface locations and measu te the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2//9//9 cord - NMOCD 4450529 verified by the BLM Well DPERATING LLC, sent to the Ca rocessing by JAMES AMOS on 0 Title AGENT	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f.C.1 of r. f. l Information Syste risbad 1/15/2019 (19JA00	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	Antimatkers and zones. filed within 30 days 50-4 must be filed once and the operator has FIRICT 2019 ED	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify 4. Cut off well head, verify 14. I hereby certify that the foregoir Name (<i>Printed/Typed</i>) ABIGA Signature (Electror	work will be performed or provide lved operations. If the operation re I Abandonment Notices must be fi for final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 9 530'-Surface. (T/Salt & 8 st cement to surface, weld on <i>G</i> C Accepted for re For COG (Committed to AFMSS for pu IL ANDERSON THIS SPACE F(, give subsurface locations and measu te the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2 //9 //9 cord - NMOCD 450529 verified by the BLM Well DPERATING LLC, sent to the Ca rocessing by JAMES AMOS on O Title AGENT Date 01/14/20 OR FEDERAL OR STATE (. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f f f f. f. f. f. f. f. f. f	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	tent markers and zones. filed within 30 days 50-4 must be filed once and the operator has FIRICT 2019 ED TERED 4-0-4	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify 4. Cut off well head, verify 14. I hereby certify that the foregoir Name (<i>Printed/Typed</i>) ABIGA Signature (Electron Approved By_ZOTA STEVENS Conditions of approval, if any, are atta	work will be performed or provide lved operations. If the operation re I Abandonment Notices must be fi for final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 9 530'-Surface. (T/Salt & 8 st cement to surface, weld on <i>G</i> C Accepted for re Electronic Submission for For COG (Committed to AFMSS for pu IL ANDERSON THIS SPACE F(ched. Approval of this notice doe	, give subsurface locations and measu te the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2 //9 //9 cord - NMOCD 450529 verified by the BLM Well DPERATING LLC, sent to the Ca rocessing by JAMES AMOS on O Title AGENT Date 01/14/20 OR FEDERAL OR STATE (TitlePETROLE s not warrant or	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f.C.1 of r. f. l Information Syste risbad 1/15/2019 (19JA00	depths of all pertir ant reports must be terval, a Form 316 e been completed a CALLESIA DIS FEB 08 2 RECEIVE	tent markers and zones. filed within 30 days 50-4 must be filed once and the operator has FIRICT 2019 ED FIERED	
Attach the Bond under which the following completion of the invoi testing has been completed. Fina determined that the site is ready f 1. Set 5 1/2" CIBP @ 1610 WOC & Tag. 2. Spot 25 sx cmt @ 1100- 3. Perf & Sqz 120 sx cmt @ 4. Cut off well head, verify 4. Cut off well head, verify 14. I hereby certify that the foregoir Name (<i>Printed/Typed</i>) ABIGA Signature (Electron Approved By_ZOTA STEVENS	work will be performed or provide lved operations. If the operation re l Abandonment Notices must be fi or final inspection. '. Pressure test csg. Circula 900'. WOC & Tag (B/Salt) 9530'-Surface. (T/Salt & 8 st cement to surface, weld on <i>G</i> C Accepted for re Electronic Submission for For COG (Committed to AFMSS for pr IL ANDERSON THIS SPACE For ched. Approval of this notice doe equitable title to those rights in th	, give subsurface locations and measu te the Bond No. on file with BLM/BIA esults in a multiple completion or reco led only after all requirements, includ te hole w/ MLF. Spot 25 sx cm 5/8" Shoe) Below Ground Dry Hole Marke 2 //9 //9 cord - NMOCD 450529 verified by the BLM Well DPERATING LLC, sent to the Ca rocessing by JAMES AMOS on O Title AGENT Date 01/14/20 OR FEDERAL OR STATE (TitlePETROLE s not warrant or	. Required subseque mpletion in a new in ing reclamation, have t @ 1610-1410'. f f f. f. f. f. f. f. f. f. f.	depths of all pertir ant reports must be terval, a Form 316 e been completed a COMPACT ALLESIA DIS FEB 08 2 RECEIVE	Antimatkers and zones. filed within 30 days 60-4 must be filed once and the operator has FIRICT 2019 ED	

4


COG Operating LLC

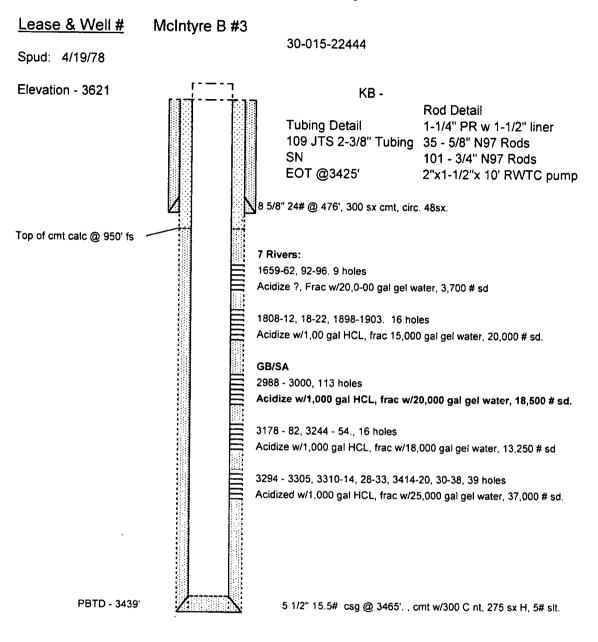

T/Salt - 530 B!Salt - 1080 Yates - 1240 7R - 1560

32.8173943 -103.9995346

COG Operating LLC

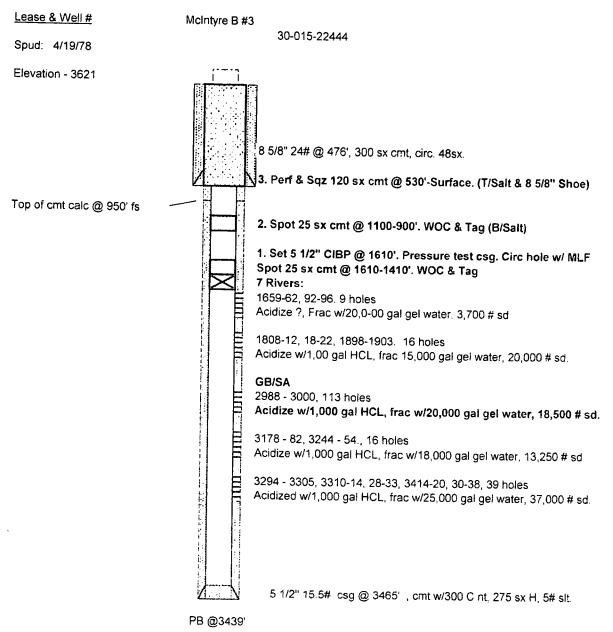

•

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

.

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612