

Sundry Notices And Reports on Wells

Do not use this form for proposals to drill or to re-enter an Abandoned well. Use form 3160-3 (APD) for such proposals.

Use Serial No.

NM14293

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

Slayton Federal #1

9. API Well No.

30-005-61101

10. Field and Pool, or Exploratory Area

Pecos Slope Abo

11. County or Parish, State

Chaves Co, NM

SUBMIT IN TRIPLICATE - Other Instructions On reverse side

1. Type of Well:

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Pecos River Operating

3. Address of Operator

400 W. Illinois, Ste 1070 Midland, Texas 79701

3b. Phone No. (Include area code)

(915) 620-8480

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL & 660 FWL, Sec 1, T8S, R26E, Unit N


12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

Type Of Submission	Type Of Action
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize <input type="checkbox"/> Deepen <input type="checkbox"/> Production (Start/Resume) <input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing <input type="checkbox"/> Fracture Treat <input type="checkbox"/> Reclamation <input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair <input type="checkbox"/> New Construction <input type="checkbox"/> Recomplete <input type="checkbox"/> Other _____
	<input type="checkbox"/> Change Plans <input checked="" type="checkbox"/> Plug and Abandon <input type="checkbox"/> Temporarily Abandon _____
	<input type="checkbox"/> Convert to Injection <input type="checkbox"/> Plug Back <input type="checkbox"/> Water Disposal _____

13. Describe proposed or completed operations. (clearly state all pertinent details, starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Notify BLM 24 hrs before starting.

1. Load hole w/9.8# mud spot 100' plug @ 4810' (perf @ 4816 to 25) WOC tag.
2. Cut & pull 4 1/2 casing from 3500.
3. RIH spot 100' plug across stub 50' in 50' out WOC tag.
4. Spot 100' plug @ 2250 to 2150.
5. Spot 100' plug @ 1180 (8 5/8 shoe @ 1130) WOC tag.
6. Spot 60' plug from 60' to surface.
7. Cut off wellhead install dry hole marker.

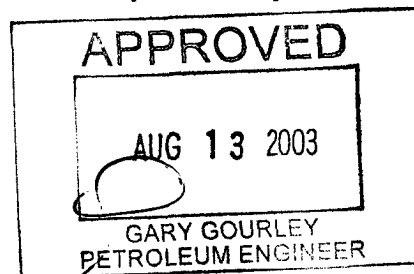

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

William R. Huck

Title VP - Engr. & Operations

Signature

Date 7/25/03

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Date

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, Make it a crime for any person knowingly and willfully to make to any department or agency of the United State any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

PECOS River Operating

Slayton Federal #1

660' FNL + 660' FNL
Sec 1, T-8S, R-26E

