


OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

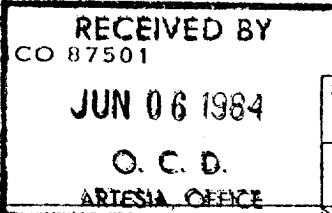

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
LG-8088

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☐ OTHER- P&A
Name of Operator
Yates Petroleum Corporation ✓
Address of Operator
207 South 4th St., Artesia, NM 88210
Location of Well
UNIT LETTER K, 1980 FEET FROM THE South LINE AND 1980 FEET FROM THE West LINE, SECTION 24 TOWNSHIP 2S RANGE 19E NMPM.

7. Unit Agreement Name
8. Farm or Lease Name
Chisum YN State
9. Well No.
1
10. Field and Pool, or Wildcat
Wildcat Precambrian
12. County
Lincoln

15. Elevation (Show whether DF, RT, GR, etc.)
4914.8' GR

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLAYS ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐ OTHER ☐ CASING TEST AND CEMENT JOBS ☐ OTHER ☐

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Verbal permission obtained from Larry Brooks, NMCCD, Artesia, 11:00 AM 4-19-84 to plug and abandon well as follows:

- 1) Notify NMCCD 24 hours in advance of plugging.
- 2) Set CIBP at 2700'± (above top perms) w/100' cement on CIBP.
- 3) Set 100' cement plug inside 5½" casing 2330-2430' (this covers Abo).
- 4) Cut and pull 5½" at 1850'± (bond log shows free pipe ± 1850').
- 5) 100' cement plug (minimum 35 sx) in/out stub where cut/pulled 5½".
- 6) Straddle Clorietta at 744' in open hole and set 35 sx plug.
- 7) 35 sx cement plug in/out shoe at 13-3/8" at 443'.
- 8) 15 sx plug at surface.
- 9) Install dry hole marker.
- 10) Clean location and notify NMCCD for inspection.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed Leslie A. Clements

TITLE Production Supervisor

DATE 6-6-84

Original Signed By

Leslie A. Clements

Supervisor District II

APPROVED BY

TITLE

DATE JUN 07 1984

CONDITIONS OF APPROVAL, IF ANY: