

Office	State of New Mexico	Form C-103
District [- (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II - (575) 748-1283		WELL API NO.
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-025-20904
District III - (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> = (505) 476-3460	Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM		0. State Off & Gas Lease No.
87505		
SUNDRY NOT	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
OF THE PROPERTY OF THE PARKET	SALS TO DRILL OR TO DEEPEN BE PUT TO A	Lusk 16 State
PROPOSALS.)	CICES AND REPORTS ON WELLS DISALS TO DRILL OR TO DEEPEN PROBLEM TO CD ICATION FOR PERMIT* (FORM C-101) FOR SUCH	8. Well Number #2
1. Type of Well: Oil Well	Gas Well Other SEP 1 1 2020	
2. Name of Operator		9. OGRID Number
COG Operating, LLC	- TOENED	229137
3. Address of Operator	RECEIVED	10. Pool name or Wildcat
2208 W. Main Street Artesia, NI	√1 88210	Lusk Morrow
4. Well Location		
Unit Letter K:	1980feet from theSline and 1980	feet from the W line
Section 16		NMPM County Lea
THE THE PARTY OF THE PARTY OF THE PARTY.	11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
	3614' GR	
12 Charle	Appropriate Box to Indicate Nature of Notice,	Danant au Othau Data
12. CHECK	Appropriate box to indicate Nature of Notice,	Report of Other Data
NOTICE OF IN	NTENTION TO: SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK		
TEMPORARILY ABANDON	 	
PULL OR ALTER CASING	. <u> </u>	_
DOWNHOLE COMMINGLE	<u> </u>	
CLOSED-LOOP SYSTEM		
OTHER:	☐ OTHER:	П
13. Describe proposed or com	pleted operations. (Clearly state all pertinent details, and	give pertinent dates, including estimated date
	ork). SEE RULE 19.15.7.14 NMAC. For Multiple Cor	
proposed completion or re-	completion.	
	520'. Circ hole w/MLF. Pressure test csg. Spot 25 sx	class H cmt @ 12,520-12,420'.
	nt @ 10,500-10,400'. (Wolfcamp)	
3. Spot 25 sx class C cmt @ 7270-7100'. WOC & Tag (Bone Spring)		
4. Peri & Sqz SU sx cmi	(a) 4041-3900'. WOC & Tag (9 5/8" Shoe)	
5. Perf & Sqz 50 sx cmt @ 2830-2700'. WOC & Tag (Yates) 6. Perf & Sqz 80 sx cmt @ 1280-950'. WOC & Tag (T/Salt & 13 3/8" Shoe)		
7. Perf & Sqz 50 sx cm		
	ify cmt to surface, weld on Below Ground Dry Hole	Marker. See attached Conditions OF OF OPPROVAL
6. Cut VII Wennessu, vei	iny cance to surface, well out below Ground Dry Hole	WINEKER.
		LDG CONDITION
		Je Comp 15
Spud Date:	Rig Release Date:	7 6 8 LO
•		W.
I hereby certify that the information	above is true and complete to the best of my knowledge	e and helief
Thereby centry that the information	above is true and complete to the best of my knowledge	c and bener.
- 4.4 /	-A	
SIGNATURE Delilah Fe	ores TITLE: Regulatory Technician	DATE: 07/27/2020
		J1115. VI. 21/2020
Type or print name: Delilah Flores	E-mail address: dflores2@concho.com	PHONE: 575-748-6946
For State Use Only		
$\overline{}$	1-1-	01100
APPROVED BY: XWW	Fut TITLE CO A	DATE 9-11-20
Conditions of Approval (if any):		

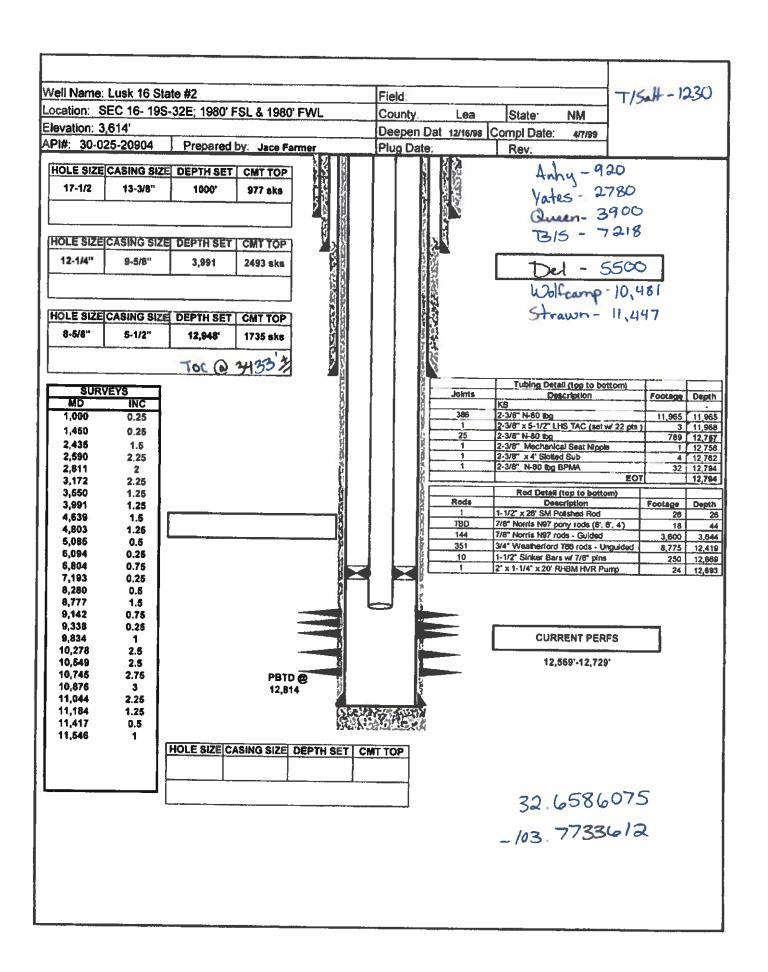

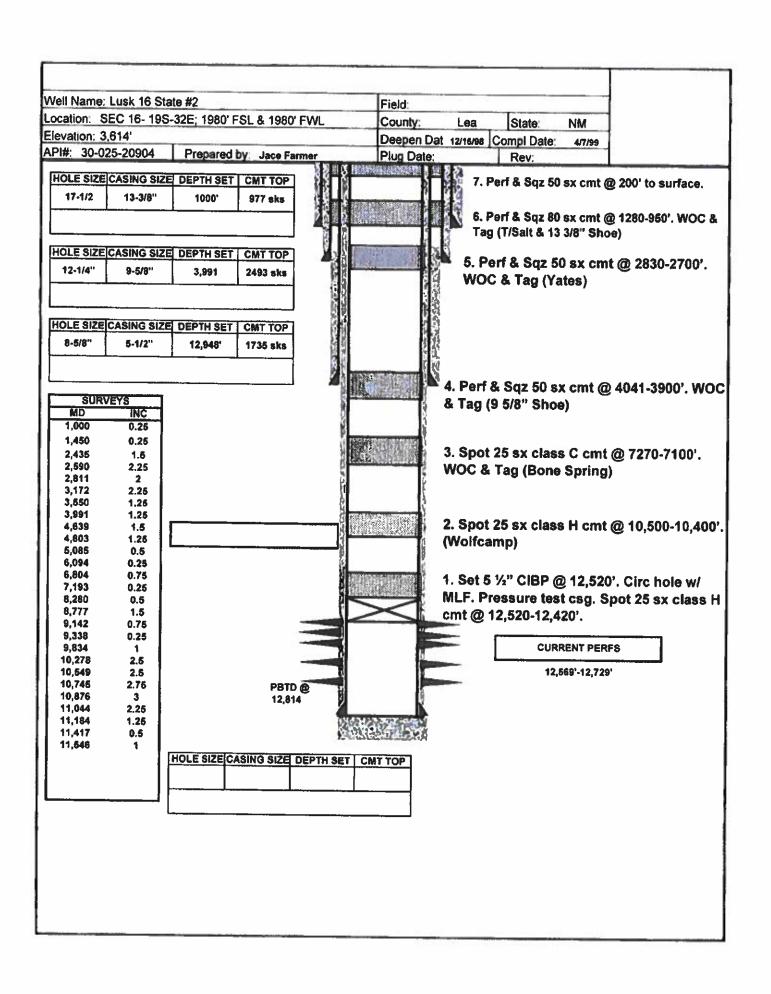

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify **NMOCD District Office I** (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least '4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)