

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised August 1, 2011

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-35802
1. Type of Well: Oil Well ☐ Gas Well ☒ Other		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator DAVID H. ARRINGTON OIL AND GAS,		6. State Oil & Gas Lease No.
3. Address of Operator P.O. BOX 2071 MIDLAND, TX 79702		7. Lease Name or Unit Agreement Name Double Hackle Peacock 31 State Com
4. Well Location Unit Letter <u>3 L</u> : 2380 feet from the <u>South</u> line and <u>958</u> feet from the <u>West</u> line Section 31 Township 16S Range 36E NMPM County Lea		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4020' GL		9. OGRID Number 5898
		10. Pool name or Wildcat Shoe Bar; Chester, East (Gas)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT I		INT TO PA <u>Amx</u>
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	COMMENCE DRILLING OPNS. ☐	P&A NR <u> </u>
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	CASING/CEMENT JOB ☐		P&A R <u> </u>
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐			
DOWNHOLE COMMINGLE ☐				
OTHER: ☐		OTHER: ☐		

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1) MIRU ND WH NU BOP. 2) POOH w/ production tbg. RU wire line & run gauge ring to 11,250'. Pull same. Run & set 5 1/2" CIBP @ 11,250', dump bail 35' cmt. 3) RIH open ended @ 11,200'. Circ hole 9.5 MLF. POOH ND BOP & WH.
3b. Perf & sqz 30 sx H cmt @ 9300'. WOC & tag.
4) NU to 5 1/2 csg, stretch & cut @ +/- 6,000' & LD same. 5) RIH to 6,050', spot 45 sx cmt plug. Pull up hole, WOC tag 50' above sub.
6) Pull up hole 5,015', spot 50 sx cmt plug. WOC & tag @ 4,900'. Pull up hole to 3,000' - Spot 35 sx cmt plug. Spot 35 sx cmt @ 2000'. Pull up to 500', spot 40 sx cmt plug. POOH. WOC & tag
7) Cut off WH mast & anchors 3' below ground level. ~~60 sx cmt to surface~~ and Install DHM. RD MO.

verify cmt to surface all strings

spot cmt 60' to

Spud Date:

Rig Release

NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Debbie Whiting TITLE ENGINEERING TECH DATE 02/22/2017

Type or print name DEBBIE WHITING E-mail address: DEBBIE.WHITING@ARRINGTON.CO.NM PHONE (505) 682-6685

For State Use Only

APPROVED BY: Mark White TITLE P.E.S. DATE 02/28/2017

Conditions of Approval (if any):


2380' FSL
958' FWL
S-31
T16S
R36E

Double Hackle Peacock 1
Lea County, New Mexico
Existing Wellbore

API: 30-025-35802

KB: 4037'
GL: 4020'

Spud: 06/27/02
Rig Rel: 07/27/02

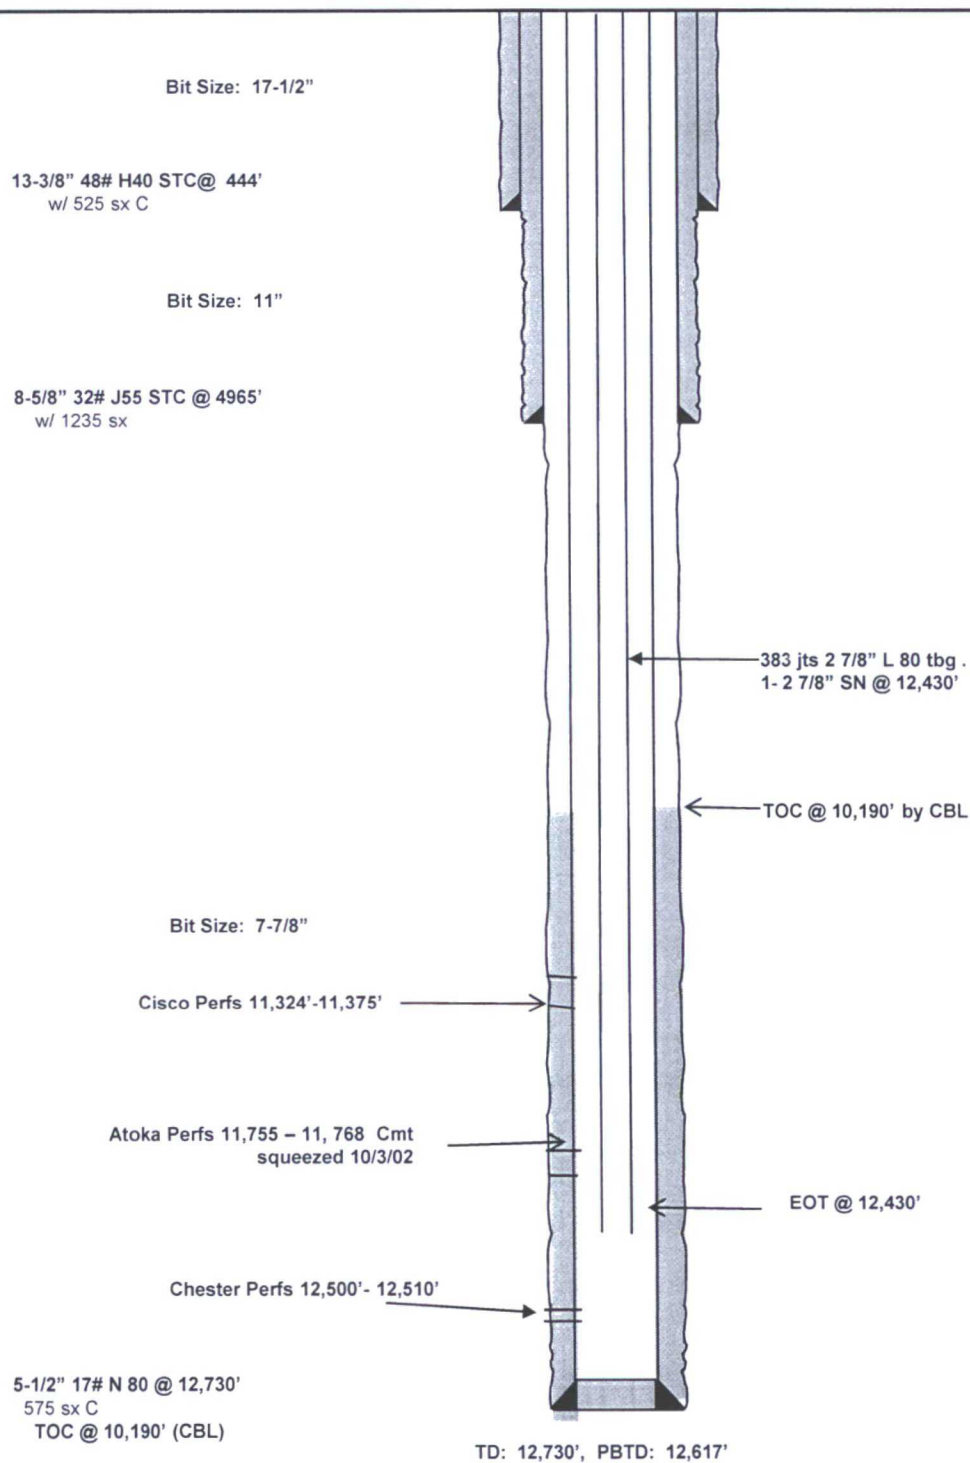

2380' FSL
958' FWL
S-31
T16S
R36E

Double Hackle Peacock 1
Lea County, New Mexico
Plug and Abandon Wellbore

KB: 4037'
GL: 4020'

API: 30-025-35802

Spud: 06/27/02
Rig Rel: 07/27/02

