

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87411
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources
HOBBS OCD
OIL CONSERVATION DIVISION
 220 South St. Francis Dr.
 Santa Fe, NM 87505

Form C-103
 May 27, 2004

RECEIVED
 APR 15 2020

WELL API NO. 30-025-30046
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Grama Ridge 8 St.
8. Well Number 1
9. OGRID Number 372098
10. Pool name or Wildcat Grama Ridge, Morrow

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator
Marathon Oil Permian, LLC

3. Address of Operator
5555 San Felipe Houston, TX 77056

4. Well Location
 Unit Letter H : 1980 feet from the N line 600 feet from the E line
 Section 8 Township 22S Range 34E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3595' RKB

Pit or Below-grade Tank Application or Closure
 Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____
 Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK PLUG AND ABANDON
 TEMPORARILY ABANDON CHANGE PLANS
 PULL OR ALTER CASING MULTIPLE COMPL

OTHER:

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ALTERING CASING
 COMMENCE DRILLING OPNS P AND A
 CASING/CEMENT JOB

OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. 4 1/2 CIBP @ 11,400' w/25sx Test to 500psi Circ w/P&A mud.
 2. 25sx @ 8400' CLASS H CMT
 3. 5300' - 5200' 35sx P.S & tag.
 4. 35sx @ 4485' - 4385'. Tag.
 5. 30sx @ 2100' - 2000'.
 6. 30sx @ 1142' - 1042' Tag.
 7. ~~30sx @ 100'~~ - Surf P.S Verify. Cut off WH. RDMO. Cut off anchors.
 8. Install DHM. RR. 150 CIRC CMT TO SURF

P&A mud between all plugs. Closed loop all fluids to licensed facility.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCDC guidelines , a general permit or an (attached) alternative OCD-approved plan .

SIGNATURE Brody Pinkerton TITLE Agent DATE 4-15-2020

Type or print name: Brody Pinkerton E-mail address: Brody@maverickwellpluggers.com Telephone No.: 432-458-3780

For State Use Only

APPROVED BY: Kerry Jahn TITLE COA DATE 4-16-20
 Conditions of Approval (if any):

See Attached Conditions of Approval

MARATHON
Prior to P&A

MOP LLC

DATE: 4-15-20
API # 30-025-30046

Company:

WELLBORE DIAGRAM

Lease: Grama Ridge 8
Location: 1980'FNL&660FEL, Unit H
Survey:
Ct/St: Lea Co. NM
Current Stat.:

Well No.: St 1
Sec: 8 Blk: T-22S, R-34E
G.L.: 3566.9'
K.B.: 3595' D.F.:

Field: Grama Ridge Marrow
Spud :10/3/87
Comp:11/27/87
Initial Form:



Hole Size: 17-1/2"
Surface CSG: 13-3/8" 46# H-40 ST&C
Set @ : 1092'
Circ: Yes 10-5-87

23/8" tbg 11,332'

Hole Size: 12-1/4"
Intermed CSG: 9-5/8" 36# & 40# K55
Set@ : 5261'
Circ: Yes 10-15-87

6250' Badspot

Hole Size: 8-1/2"
Long Str: 7" 26# S-95 LT&C & Seallock
Set @: 11,550'
CMT: 375 Sks HLW & 325Sks Cts C 30 min 1500# 11-2-87
TOC 7000'

Perfs 27hole, 11458'missed, 11496', 513', 527', 540'missed, 551', 556', 578', 586', 598', 614', 621', 630', 660', 697', 728', 748', 903', 918', 933', 943', 958', 967', 976', 989', 12400'missed, 12584',

Packer@
11,330'
1.5 profile

BP@12,890'

TD @13,570'
PB@13,420'

Perfs 13,034', 048', 207', 248', 363',

Hole Size: 6-1/8"
Liner: 4-1/2" 15.10# P-110 TOL @ 11,217'
Set@: 13,570'
CMT: 376Sks Cts H8%Haled 22Mixed @ 15.6 ppg.
yield 1.18. test to 1800# 11-27-87

MARATHON
After P/LA

MOP LLC

Company:


WELLBORE DIAGRAM

DATE: 4-15-20
API # 30-025-30046

Lease: Grama Ridge 8
Location: 1980' FNL & 660' FEL, Unit H
Survey:
Ct/St: Lea Co. NM
Current Stat.: **D.H.M.**

Well No.: St 1
Sec: 8 Bk: T-22S, R-34E
G.L.: 3566.9'
K.B.: 3595' D.F.:

Field: Grama Ridge Marrow
Spud : 10/3/87
Comp: 11/27/87
Initial Form:

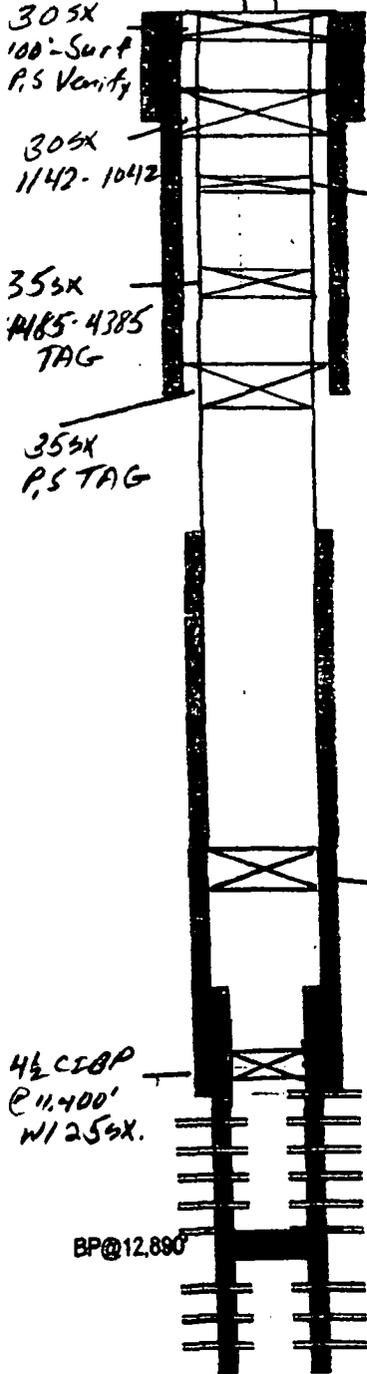

Hole Size: 17-1/2"
Surface CSG: 13-3/8" 48# H-40 ST&C
Set @ : 1092'
Circ: Yes 10-5-87

23/8" tbg 11,332'
305X 2100-2000

Hole Size: 12-1/4"
Intermed CSG: 9-5/8" 36# & 40# K55
Set @ : 5261'
Circ: Yes 10-15-87

6250' Badspot

Hole Size: 8-1/2"
Long Str: 7" 26# S-95 LT&C & Seallock
Set @ : 11,550'
CMT: 375 Sks HLW & 325 Sks Cts C 30 min 1500# 11-2-87
TOC 7000'

Perfs 27hole, 11458'missed, 11496', 513', 527', 540'missed, 551', 556', 578', 586', 598', 614', 621', 630', 660', 697', 728', 748', 903', 918', 933', 943', 958', 967', 976', 989', 12400'missed, 12584',

Perfs 13,034', 048', 207', 248', 363',

Hole Size: 6-1/8"
Liner: 4-1/2" 15.10# P-110 TOL @ 11,217'
Set @ : 13,570'
CMT: 376 Sks Cts H8% Hated 22 Mixed @ 15.6 ppg.
yield 1.18. test to 1800# 11-27-87

**CONDITIONS OF APPROVAL
FOR PLUGGING AND ABANDONMENT
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify **NMOCD District Office I (Hobbs) at (575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) **Fusselman**
 - B) **Devonian**
 - C) **Morrow**
 - D) **Wolfcamp**
 - E) **Bone Springs**
 - F) **Delaware**
 - G) **Any salt sections**
 - H) **Abo**
 - I) **Glorieta**
 - J) **Yates.**
 - K) **Potash---(In the R-111-P Area (Potash Mine Area),**

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least 1/4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name
2. Lease and Well Number
3. API Number
4. Unit letter
5. Quarter Section (feet from the North, South, East or West)
6. Section, Township and Range
7. Plugging Date
8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION