

Submit 2 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-29323
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. LG-2869
7. Lease Name or Unit Agreement Name Airstrip NW Deep Unit
8. Well No. 1
9. Pool name or Wildcat E-K Wolfcamp

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Manzano Oil Corporation 505/623-1996	
3. Address of Operator P.O. Box 2107/Roswell, NM 88202-2107	
4. Well Location Unit Letter B : 660 Feet From The North Line and 1980 Feet From The East Line Section 20 Township 18 South Range 34 East NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4050.9	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Cut 5-1/2 csg @ approximately 6000'.
- 100' cement plug (50' in 5-1/2" csg stub & 50' out.)
 - 100' cement plug across 8-5/8" shoe. (50' in & 50' out) (505C')
 - 100' cement plug across 13-3/8" shoe. (370')
 - 10' surface plug.
 - Dry hole marker.
 - Cut dead men - level pits - clean lease.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE D.E. Brown TITLE Vice President Engineering DATE 11/14/94
TYPE OR PRINT NAME D.E. Brown TELEPHONE NO. 505/623-1996

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:


Air strip NW Deep Unit #1
 660 FNL & 1980 FNL, Sec 20-T18S-R34E
 Lea Co. New Mexico

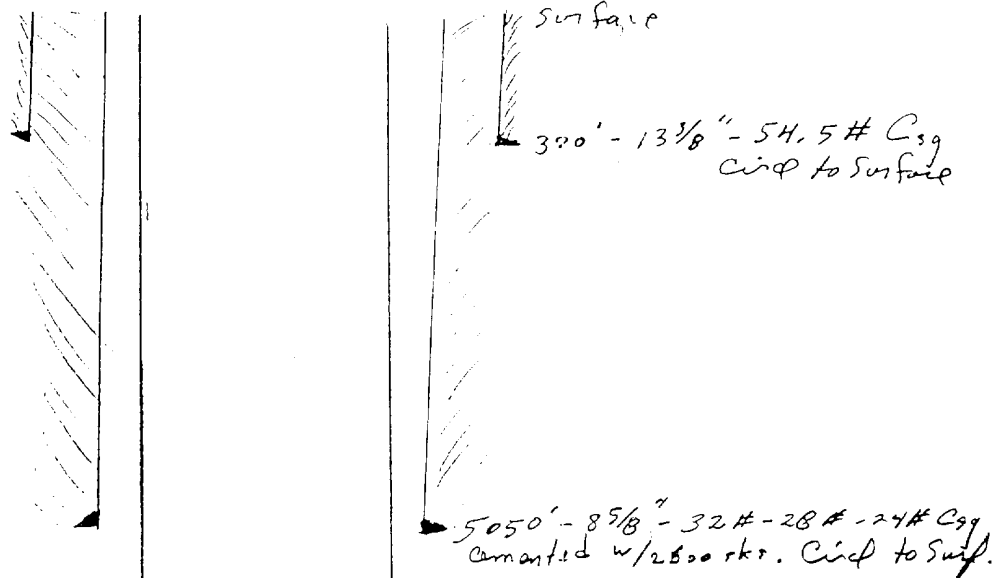

PIA Procedure

Cut & Pull Csg. Recovery
 Expected - 5050 to 6000.

1. 100' Cement Plug (50' in
 5 1/2" Csg Stub & 50' out).
2. 100' Cement Plug Across 8 5/8"
 shoe, (50' In & 50' out)
3. 100' Cement Plug Across 13 3/8"
 shoe
4. 10' Surface Plug.
5. Dry hole Marker.
6. Cut Dead Man-Level Pits -
 clean bore.

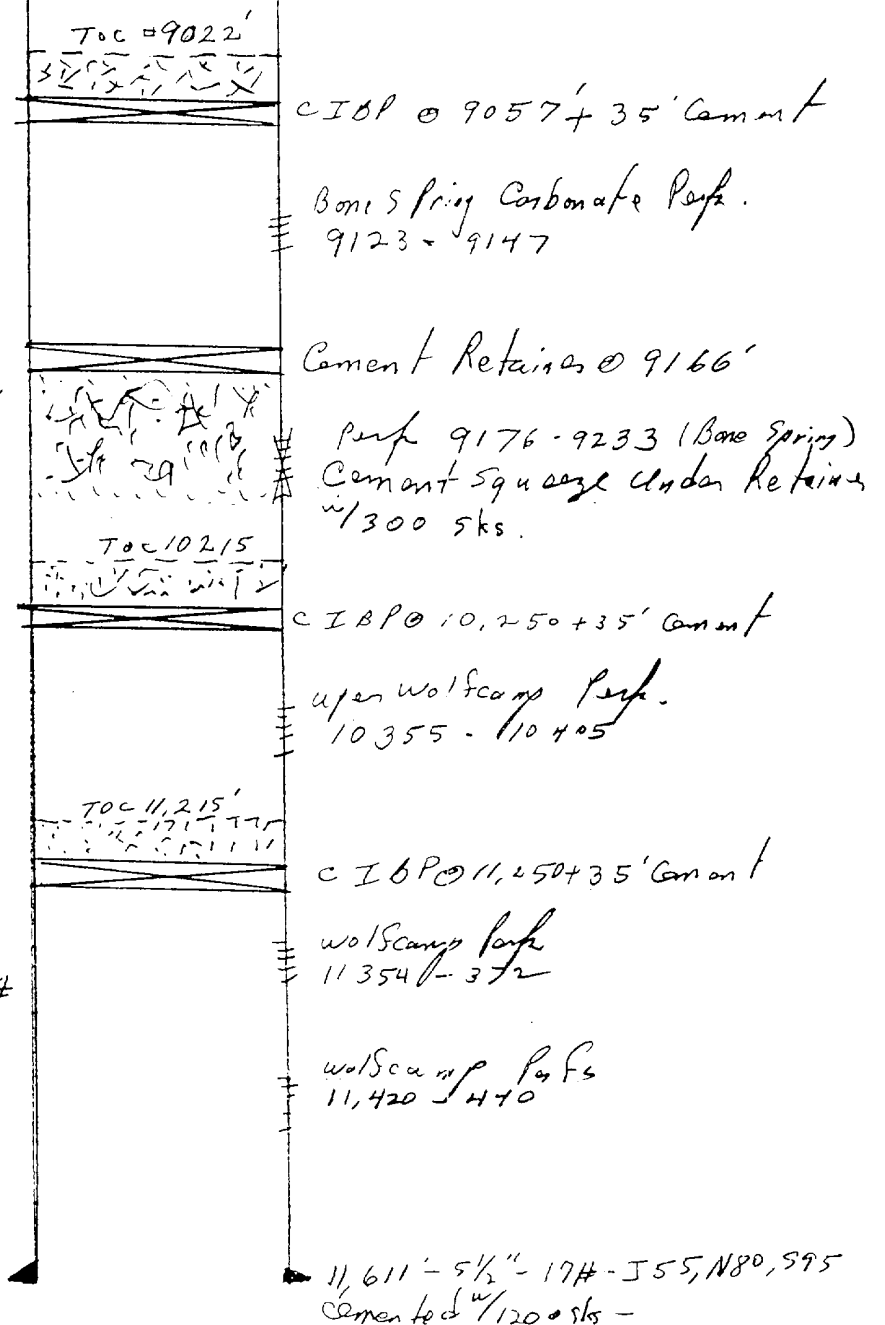

5 1/2" Csg Run In This Order - All 17#

135# - 513' - S95 - LT9C
 735# - 3069' - N80 - LT9C
 1105# - 4594' - J55 - LT9C
 765# - 3198' - N80 - LT9C
 65# - 237' - S95 - LT9C
 278' - 1141' -