

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P. O. Box 2088
Santa Fe, NM 87504-2088

WELL API NO. 30-025-33773
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Caprock Maljamar Unit
8. Well No. 280
9. Pool name or Wildcat Maljamar Grayburg San Andrea
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4088'

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER	
2. Name of Operator The Wiser Oil Company	
3. Address of Operator P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797	
4. Well Location Unit Letter <u>M</u> : <u>932</u> Feet From The <u>South</u> Line and <u>330</u> Feet From The <u>West</u> Line Section <u>28</u> Township <u>17S</u> Range <u>33E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4088'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Wiser requests approval to Plug and Abandon the well by the procedure listed below.

Surface Casing: 8-5/8" set @ 444'
Perfs: 4200'-4649'

Production Casing: 5-1/2" @ 4827'

1. Cut tbg. off @ 2320' if 100% loose
2. Set cmt. retainer @ 2300'. Pump 200 sks. cmt. or until pressure goes to 2000#.
3. Dump 50' cmt. on cmt. retainer.
4. Tag cmt.
5. Circulate abandonment mud.
6. Spot 50' cmt. plug @ 1600'.
7. Tag cmt.
8. Spot 50' cmt. plug @ 600'.
9. Tag cmt.
10. Spot 50' cmt. plug @ 444'.
11. Tag cmt.
12. Spot 50' cmt. plug to surface.
13. Install dry hole marker. Clean location.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mike Jones TITLE Superintendent DATE January 24, 2002

TYPE OR PRINT NAME Mike Jones

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE JAN 28 2002

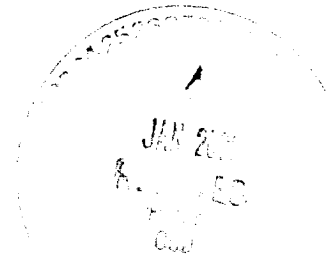


DEC 18 '96 01:04PM

P.2


WISER OIL CO

CAP ROCK MALJAMAR UNIT #280
SEC. 28, 17S, 33E
LEA COUNTY, NM.
DIRECTIONAL PROPOSAL

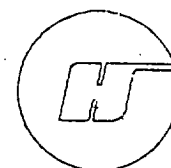

HALLIBURTON

12/17/96 8:04 pm


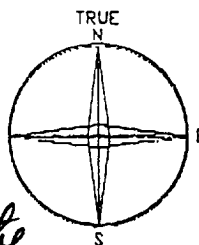


*Top of fish @
2325' 3/4" hole
in 2 7/8" tbg.
all tbg in the
hole.*

VERTICAL VIEW
SCALE 100 ft. / DIVISION
TVD REF: WELLHEAD
VERTICAL SECTION REF: WELLHEAD

FILE

HORIZONTAL VIEW
SCALE 100 ft. / DIVISION
SURVEY REF: WELLHEAD

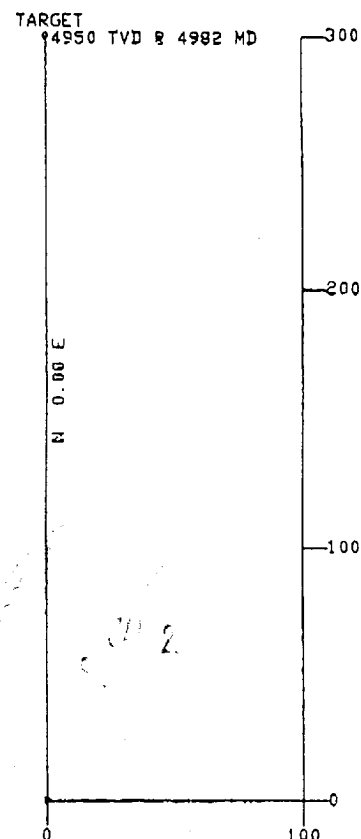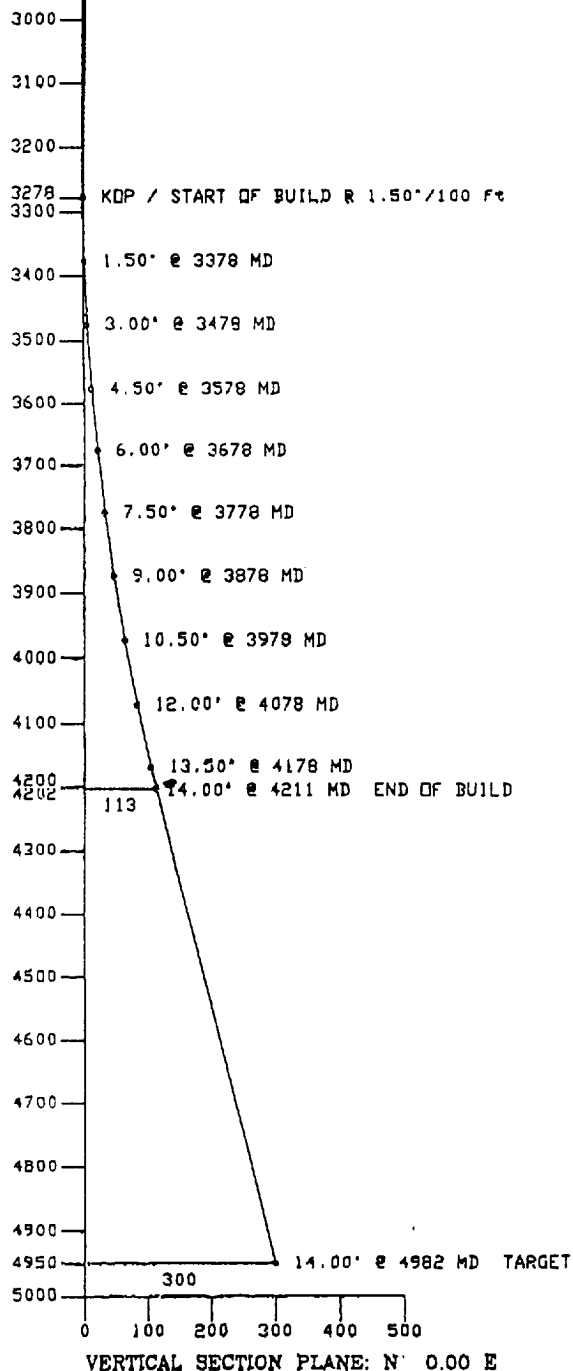

PROPOSED BHL	
TVD	4950.00
MD	4982.16
VS	300.00
N/S	300.00 N
E/W	0.00 E