

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02116
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Bridges State
8. Well No.	5
9. Pool name or Wildcat	Vacuum Grayburg (San Andres)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☐ GAS WELL ☐ OTHER ☐ WIW ☐
2. Name of Operator	Mobil Producing TX & NM Inc. *
	*Mobil Exploration & Producing US Inc. as agent for MPTM
3. Address of Operator	P.O. Box 633, Midland, TX 79702
4. Well Location	

Unit Letter C : 660 Feet From The North Line and 1980 Feet From The West Line

Section 26 Township 17-S Range R-34-E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
KB 4039

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	
OTHER: ☐	

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐	
OTHER: ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
- RIH W/ WS TO 2825'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 25 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2775' FROM 2825-2725'.
- PUH TO 1850'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1800' FROM 1850-1750'. PLUG MUST BE TAGGED!
- PUH TO 855'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 805' FROM 855-755'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). PLUG MUST BE TAGGED!
- PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
- ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE Regulatory Technician DATE 08-03-93
TYPE OR PRINT NAME Kaye Pollock TELEPHONE NO. 915-688-2584

(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY _____ TITLE _____ DATE AUG 05 1993
CONDITIONS OF APPROVAL, IF ANY:

BRIDGES STATE # 5 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO

RECOMMENDED WORKOVER PROCEDURE

1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 2825'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 25 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2775' FROM 2825-2725'.
3. PUH TO 1850'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1800' FROM 1850-1750'. **PLUG MUST BE TAGGED!**
4. PUH TO 855'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 805' FROM 855-755'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
5. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
6. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

KB = 4039'
GL = 4028'

C, 26, T 17-S, R 34-E,

805'

10-3/4" 48# L.W. CSG CMTD W / 179 SX CIRC.

2230'

TOC (CALCULATED)

PBTD=3993'

CIBP @ 4028' W/ 35' CMT CAP

4277'

7" 24# SL CSG CMTD W / 279 SX

SAN ANDRES OH FROM 4277-4750'

FILL @ 4591'

TD=4750'


BS5C.PRE
ALS 08/02/93

BRIDGES STATE
WELL # 5 WIW
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
PROPOSED COMPLETION

C, 26, T 17-S, R 34-E, 660' FNL, 1980' FWL

KB = 4039'

GL = 4028'

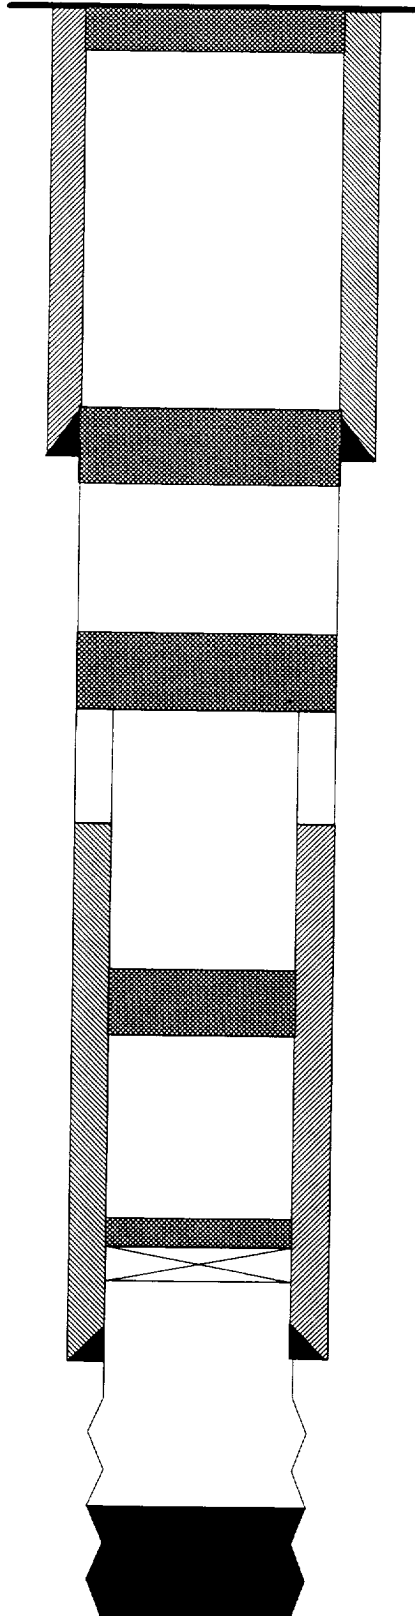

15 SX CLASS C NEAT CMT PLUG
FROM SURFACE-30'

50 SX CLASS C NEAT CMT PLUG ACROSS CSG SHOE @
805' FROM 855-755'
MUST TAG THIS PLUG!

50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @
1800' AND 7" CSG STUB FROM 1850-1750'
MUST TAG THIS PLUG!

25 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @
2775' FROM 2825-2725'

CIBP @ 4028' W/ 35' CMT CAP

SAN ANDRES OH FROM 4277-4750'

10-3/4" 48# L.W. CSG CMT'D
W / 179 SX CIRC. @ 805'

TOC @ 2230' (CALCULATED)

PBTD=3993'

7" 24# SL CSG CMT'D
W / 279 SX @ 4277'

FILL @ 4591'

TD=4750'