

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.

<p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)</p>	
<p>OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-</p>	7. Unit Agreement Name
2. Name of Operator TEXACO INC.	8. Farm or Lease Name C. H. Weir A
3. Address of Operator P.O. BOX 728 Hobbs, NM. 88240	9. Well No. 8
4. Location of Well UNIT LETTER F , 1980 FEET FROM THE West LINE AND 1985 FEET FROM THE North LINE, SECTION 12 TOWNSHIP 20-S RANGE 37-E NMPM.	10. Field and Pool, or WHdcat See below
15. Elevation (Show whether DF, RT, GR, etc.) 3574' (DF)	12. County Lea

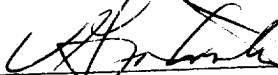
16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
<p>NOTICE OF INTENTION TO:</p> <p>PERFORM REMEDIAL WORK <input type="checkbox"/></p> <p>TEMPORARILY ABANDON <input type="checkbox"/></p> <p>PULL OR ALTER CASING <input type="checkbox"/></p> <p>OTHER Repair Water Flow <input checked="" type="checkbox"/></p>	<p>SUBSEQUENT REPORT OF:</p> <p>PLUG AND ABANDON <input type="checkbox"/></p> <p>CHANGE PLANS <input type="checkbox"/></p> <p>REMEDIAL WORK <input type="checkbox"/></p> <p>COMMENCE DRILLING OPNS. <input type="checkbox"/></p> <p>CASING TEST AND CEMENT JOBS <input type="checkbox"/></p> <p>OTHER <input type="checkbox"/></p> <p>ALTERING CASING <input type="checkbox"/></p> <p>PLUG AND ABANDONMENT <input type="checkbox"/></p>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Field - Skaggs Glorieta, Weir Blinbry East, Monument Tubb

1. RIG UP. PULL RODS AND PUMP FROM GLORIETA STRING. INSTALL BOP. PULL TUBING.
2. SET CIBP IN TUBB STRING @ 4000' AND SPOT 40' CEMENT ON PLUG.
3. SET CIBP IN BLINBRY STRING @ 4000' AND SPOT 40' CEMENT ON PLUG.
4. SET CIBP IN GLORIETA STRING @ 4000' AND SPOT 40' CEMENT ON PLUG.
5. PERFORATE TUBB STRING W/2-JS @ 1489'.
6. CEMENT TO SURFACE THROUGH PERFORATIONS @ 1489' W/ 580 SX. CLASS H CEMENT CONTAINING 2% CACL. SQUEEZE W/ ADDL 200 SX. CLASS H CEMENT. WOC. DOC. TEST.
7. DRILL OUT PLUGS IN BLINBRY AND GLORIETA STRINGS.
8. INSTALL PRODUCTION EQUIPMENT. TEST AND RETURN TO PRODUCTION.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED  TITLE **Asst Dist Mgr** DATE **9-2-83**

ORIGINAL SIGNED BY JERRY SEXTON

APPROVED BY **DISTRICT SUPERVISOR**

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE **SEP 6 1983**