

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO CLEAN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	
2. Name of Operator Atlantic Richfield Company	
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	
4. Location of Well UNIT LETTER <u>P</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>26</u> TOWNSHIP <u>21S</u> RANGE <u>37E</u> NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.) 3375' GR	

7. Unit Agreement Name
8. Farm or Lease Name Elmer C. Hill
9. Well No. 1 1
10. Field and Pool, or Wildcat Blinebry Oil & Gas
12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <u>Blank off perfs, reperf, treat higher</u> <input checked="" type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>
same zone			

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to blank off present Blinebry Oil & Gas perfs 5773-5894' & perforate higher in same zone in the following manner:


1. Rig up, kill well, POH w/completion assy, install BOP.
2. Run & set CIBP @ 5750'.
3. Perf Blinebry Gas zone w/1 JS ea @ 5509, 18, 30, 39, 5548, 57, 69, 82, 92, 5605, 51, 70, 75, 81, 89 & 5701'.
4. RIH w/pkr, set pkr @ 5450' & acidize w/1500 gals DS-30 acid. Flush w/KCL wtr & swab back load.
5. Frac perfs 5509-5701' w/20,000 gals gelled KCL & 31,000# sd.
6. Swab test, run completion assy, return to production.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <u>Dist. Drlg. Supv.</u>	DATE <u>10/4/76</u>
APPROVED BY _____	TITLE _____	DATE <u>OCT 6 1976</u>
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

1970
JAN 10 1970
U.S. DEPT. OF JUSTICE

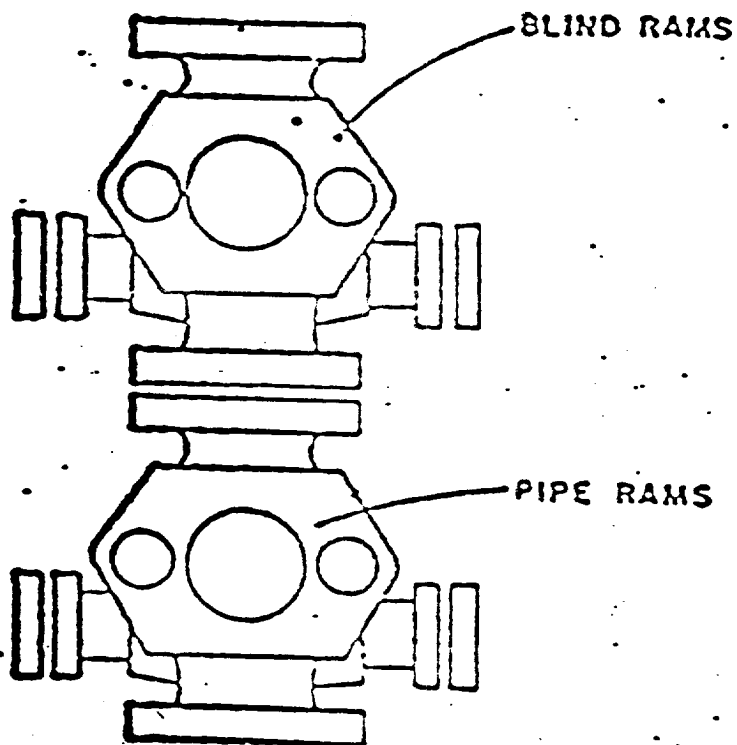

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name Elmer C. Hill

Well No. 1

Location .660' FSL & 660' FEL
Sec 26-21S-37E, Lea County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.

RECEIVED

APR 10 1970
U.S. AIR FORCE
HEADQUARTERS
WASHINGTON, D.C.