

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. 157
7. Unit Agreement Name
8. Farm or Lease Name State 157 "D"
9. Well No. 5
10. Field and Pool, or Wildcat Arrowhead Grayburg
12. County Lea

<p><b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>	
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Atlantic Richfield Company
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	4. Location of Well UNIT LETTER P 330 FEET FROM THE South LINE AND 330 FEET FROM THE East LINE, SECTION 12 TOWNSHIP 22S RANGE 36E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 3480' GR	16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

## NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

## SUBSEQUENT REPORT OF:

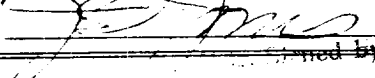
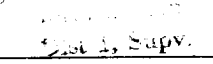
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 3726'. Completed open hole 3569-3726'. Presently shut in.  
9-5/8" OD 40# csg set @ 322' & cmt'd w/100 sx. Circ to surf.  
7" OD 24# csg set @ 3569' & cmt'd w/250 sx.  
Propose to Plug & abandon in the following manner:  
1. Rig up, kill well, install BOP & POH w/completion assy.  
2. RIH w/CIBP on WL, set BP @ approx 3500'. Spot 20 sx Cl C cmt cont'g 4% gel on top of BP w/bailer. Spot heavy gelled mud between all plugs.  
3. Run free point & cut 7" csg @ approx 2500' & pull.  
4. Spot 45 sx Cl C cmt cont'g 4% gel & 2% CaCl (100' plug) across 7" OD csg stub.  
5. Spot 45 sx Cl C cmt cont'g 4% gel & 2% CaCl (100' plug) across top of salt @ 1210'.  
6. Spot 45 sx Cl C cmt cont'g 4% gel & 2% CaCl (100' plug) across 9-5/8" OD csg shoe @ 322'.  
7. Spot 10 sx cmt @ surface, install regulation dry hole marker. Clean & level location for abandonment.

100' plug at base of salt if not behind pipe.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Dist. Drlg. Supv.	DATE 11/5/75
APPROVED BY 	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		