

|                        |      |  |
|------------------------|------|--|
| NO. OF COPIES RECEIVED |      |  |
| DISTRIBUTION           |      |  |
| SANTA FE               |      |  |
| FILE                   |      |  |
| U.S.G.S.               |      |  |
| LAND                   | FICE |  |
| OPE                    | OR   |  |

NEW MEXICO OIL CONSERVATION COMMISSION

am C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-4-65

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

|  |  |  |  |
|--|--|--|--|
| <input checked="" type="checkbox"/> OIL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-  |  | Type of Lease <input type="checkbox"/> Fee <input checked="" type="checkbox"/> |  |
| Name of Operator<br><b>TEXACO Inc.</b>   |  | Lease No.<br><b>M. B. Weir B</b>   |  |
| 3. Address of Operator<br><b>P. O. Box 728 - Hobbs, New Mexico 88240</b>   |  | County<br><b>10</b>  |  |
| 4. Location of Well<br>UNIT LETTER <b>P</b> , <b>987</b> FEET FROM THE <b>East</b> LINE AND <b>990</b> FEET FROM THE <b>South</b> LINE, SECTION <b>12</b> TOWNSHIP <b>20-S</b> RANGE <b>37-E</b> |  | Well Name<br><b>Skaggs Drinkard, Weir Blinebry East, Monument Tubb</b>         |  |
| 15. Elevation (Show whether DF, RT, GR, etc.)<br><b>3565' DF</b>   |  | 12. County<br><b>Lea</b>   |  |

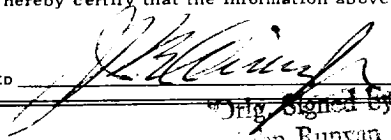

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

|  |   |  |   |
|--|---|--|---|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input type="checkbox"/>                           | REMEDIAL WORK <input type="checkbox"/>               | ALTER PLUG OR Casing <input type="checkbox"/> |
| TEMPORARILY ABANDON <input type="checkbox"/>   | CHANGE PLANS <input type="checkbox"/>                               | COMMENCE DRILLING OPER. <input type="checkbox"/>     | TEST AND ABANDONMENT <input type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/>  | OTHER <input checked="" type="checkbox"/> <b>Downhole Commingle</b> | CASING TEST AND CEMENT JOBS <input type="checkbox"/> | OTHER <input type="checkbox"/>                |

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent data, etc. work) SEE RULE 1109. **NMOCC HEARING - CASE NO. 5457, ORDER NO. R-5006**

1. Pull production equipment from Blinebry and Drinkard zones.
2. Check TD on all zones.
3. If necessary, clean out Blinebry and Tubb zones to TD.
4. Spot 200 gals. Xylene over Drinkard perforations 6812'-6866'.
5. Acidize Drinkard perforations 6812-6866' w/2000 gals. 15% NE acid in two (2) stages of 1000 gals. each using 200# Rock Salt Block.
6. Kill Tubb zone w/fresh water.
7. Perforate Tubb & Blinebry zones w/2 JSPF from 6854'-6864'.
8. Run production equipment in Drinkard string.
9. Test and return to production as Triple Downhole Commingle of Blinebry, Tubb, and Drinkard.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

|  |                                   |                    |
|--|-----------------------------------|--------------------|
| SIGNED       | TITLE <b>Asst. District Supt.</b> | DATE <b>9-4-75</b> |
| APPROVED BY  | TITLE <b>Geologist</b>            |                    |
| CONDITIONS OF APPROVAL, IF ANY:  |                                   |                    |