


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

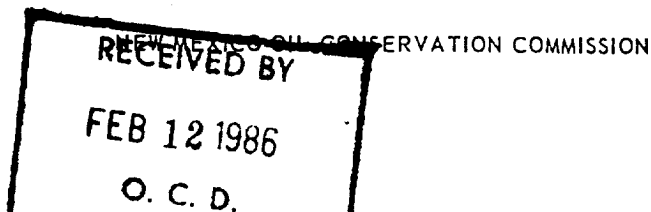

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	E-1923

### SUNDY NOTICE AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - " (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TXO Production Corp.	8. Farm or Lease Name South Wilson St. Com #1
3. Address of Operator 900 Wilco Bldg. Midland, Tx 79701	9. Well No. 1
4. Location of Well UNIT LETTER J 1800 FEET FROM THE South LINE AND 1980 FEET FROM THE east LINE, SECTION 14 TOWNSHIP 21S RANGE 34E NMPM.	10. Field and Pool, or Wildcat Wilson (Morrow)
15. Elevation (Show whether DF, RT, GR, etc.) 3702 KB 3700 DF 3680 GL	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input checked="" type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

\*Notify Hobbs NMOCC 24 hrs before starting work.  
Kill well  
Unseat pkr, TOH.  
Set CIBP @ 12600'. TIH.  
Set 40 sx on CIBP. (TDC 12100')  
Set 20 sx from 11300-11100'.  
Set 20 sx from 10400-10200'.  
Set 20 sx from 8100-7900'.  
TOH.  
Weld on pull nipple & free pt csg. (TOC approx 5350)  
Cut csg. TOH & LD.  
TIH w/tbg & spot 20 sx from 5800-5600'.  
Set plug 100' into 4 1/2" stub & 100' into 8 5/8" csg.  
Set 35 sx 3600-3400'.  
Set 35 sx 1700-1500'.  
Spot 10 sx @ surf.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Laurel Giff TITLE Production Engineer DATE 2-10-86

APPROVED BY R. A. B. B.

TITLE OIL & GAS INSPECTOR

DATE

CONDITIONS OF APPROVAL, IF ANY:

**RECEIVED**  
FEB 20 1986  
O.C.D.  
HOBBS OFFICE