

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO.
30-025-09219-00-00

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-1167

7. Lease Name or Unit Agreement Name
State JG

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well
OIL ☒ GAS ☐
WELL ☒ WELL ☐ OTHER ☐

2. Name of Operator
John H. Hendrix Corporation

8. Well No. 4

3. Address of Operator
PO Box 3040; Midland, Texas 79702-3040

9. Pool name or Wildcat
Langlie Mattix

4. Well Location
Unit Letter L 1980 Feet From The South Line and 660 Feet From The West Line

Section 2 Township 23S Range 36E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3472' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐ CASING TEST AND CEMENT JOB ☐
OTHER ☐ OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work, SEE RULE 1103.

1. Rig up P&A equipment. Dig and line work pit. NU BOP.
2. Set CIBP at 3370'.
3. Circulate hole w/ 9.5# mud
4. Cap CIBP w/ 40-sx. cement.
5. Spot 40-sx cement from 3100'-3000'.
6. Perforate at 2814'. Squeeze w/ 55 sx. cement. Displace TOC to 2714' (base of salt). Tag
7. Perforate at 1320'. Squeeze w/ 55 sx. cement. Displace TOC to 1220' (Top of salt). Tag
8. Perforate at 307'. Squeeze w/ 100 sx. cement. Displace TOC to 207'. Tag
9. Cut off wellhead. Spot 10 sx. surface plug.
10. Install P&A marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE H. Boatright TITLE Agent

DATE 11/14/02

TYPE OR PRINT NAME H. Boatright

TELEPHONE NO. 915 570 5382

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

WELL NAME AND NUMBER

State JG #4


John W Hendrix Corporation

Lea County, New Mexico

After Plug and Abandonment

State Lease # B-1167

WELLBORE CONFIGURATION

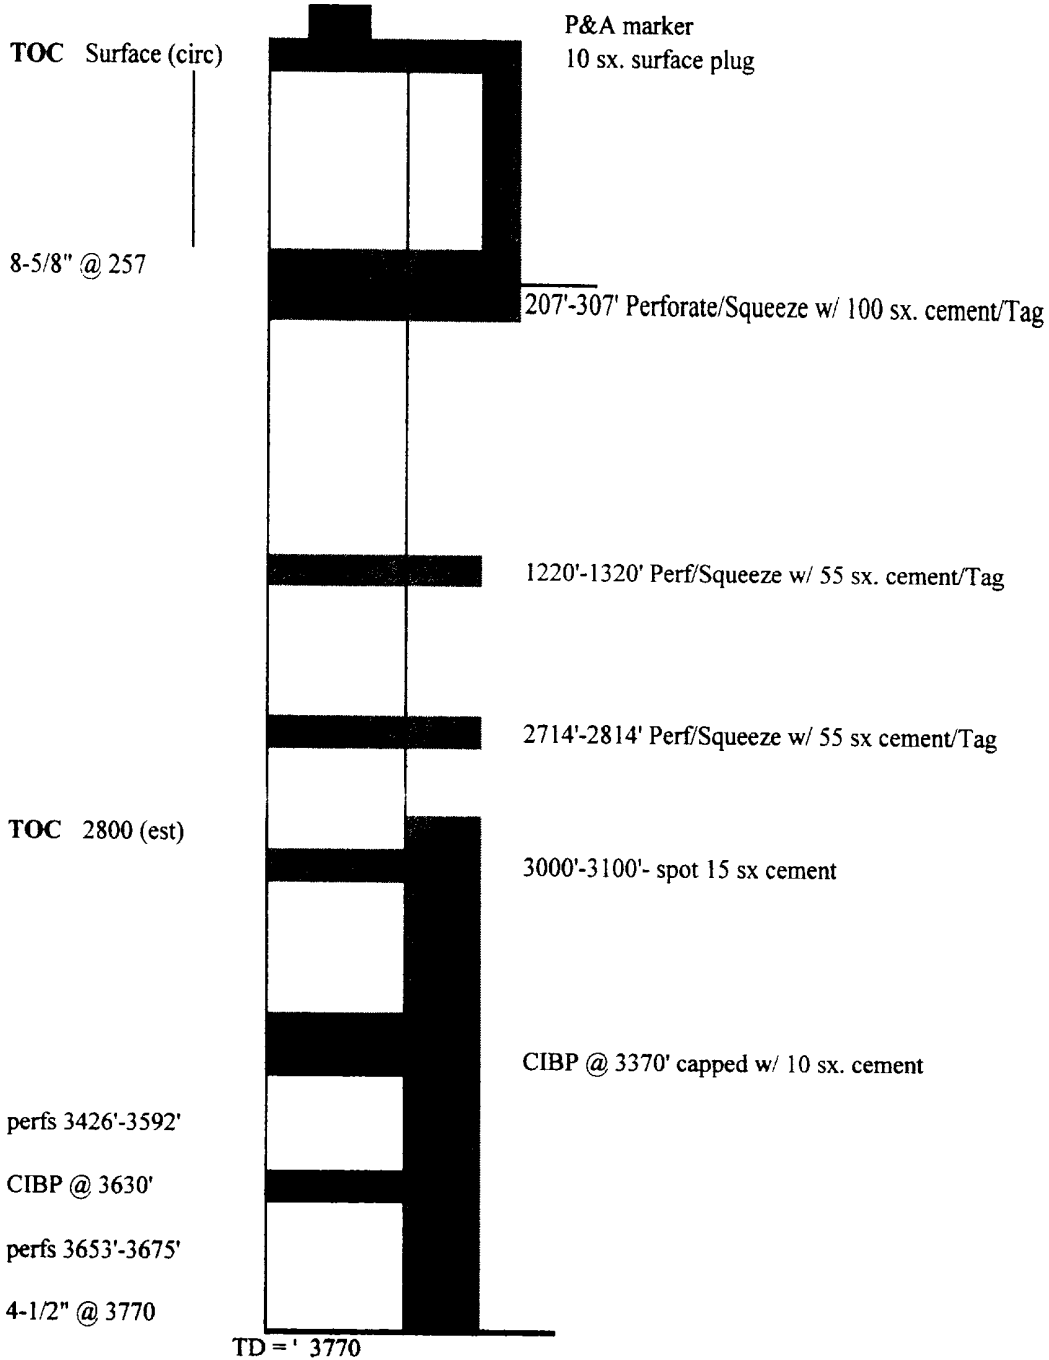

WELL NAME AND NUMBER

State JG #4

John M Hendrix Corporation

Lea County, New Mexico

State Lease # B-1167

WELLBORE CONFIGURATION

