

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

3002510770

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

B-158

7. Lease Name or Unit Agreement Name

N.M. 'BZ' State NCT-8

8. Well No.

12

9. Pool name or Wildcat

Langlie Mattix 7RQ Grayburg

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

Texaco Inc

3. Address of Operator

P.O. Box 730 Hobbs, New Mexico 88240

4. Well Location

Unit Letter O : 660 Feet From The South Line and 1980 Feet From The East Line

Section 16 Township 23S Range 37E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3309' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU pulling unit. Install BOP.
2. TIH w/2-3/4" concave mill on 2-1/16" WS. Mill out 35' cmt from 4215'-4250' and 3-1/2" CIBP at 4250'. TOH w/WS and mill.
3. TIH w/ 3-1/2" CIBP on WS and set at 5280' and spot 35'cmt on top.
4. Circulate hole full of 9.5 ppg mud.
5. TIH w/3-1/2" cement retainer on WS. Set retainer @ 3310'. Squeeze Langlie Mattix perforations 3412'-3572' w/100 sacks of Class 'H' cmt w/2% CaCl, 5.2 gal water/sack, 15.6 ppg, 1.18 cu.ft/sack. Release WS out of retainer.
6. Pull up hole and spot 100' cmt plug from 1125'-1025'.
7. Pull up hole and spot 10' cmt plug at surface.
8. Cut off wellhead, install dry hole marker. Clean location.

(over)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

L.W. Johnson

TITLE

Engr. Asst.

DATE

8-27-90

TYPE OR PRINT NAME

L.W. Johnson

TELEPHONE NO.

(505)

397-0426

(This space for State Use)

APPROVED BY


TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

THIS COMMISSION WILL BE RESPONSIBLE FOR
HOLDING BACK ANY WELL FROM PRODUCTION
PENDING OPERATIONS FOR THE WELL
BEING APPROVED.

NEW MEXICO BE STATE NGTB No. 12
 Unit Letter O, SEC 16 T-235 R-37E
 Lea County, New Mexico

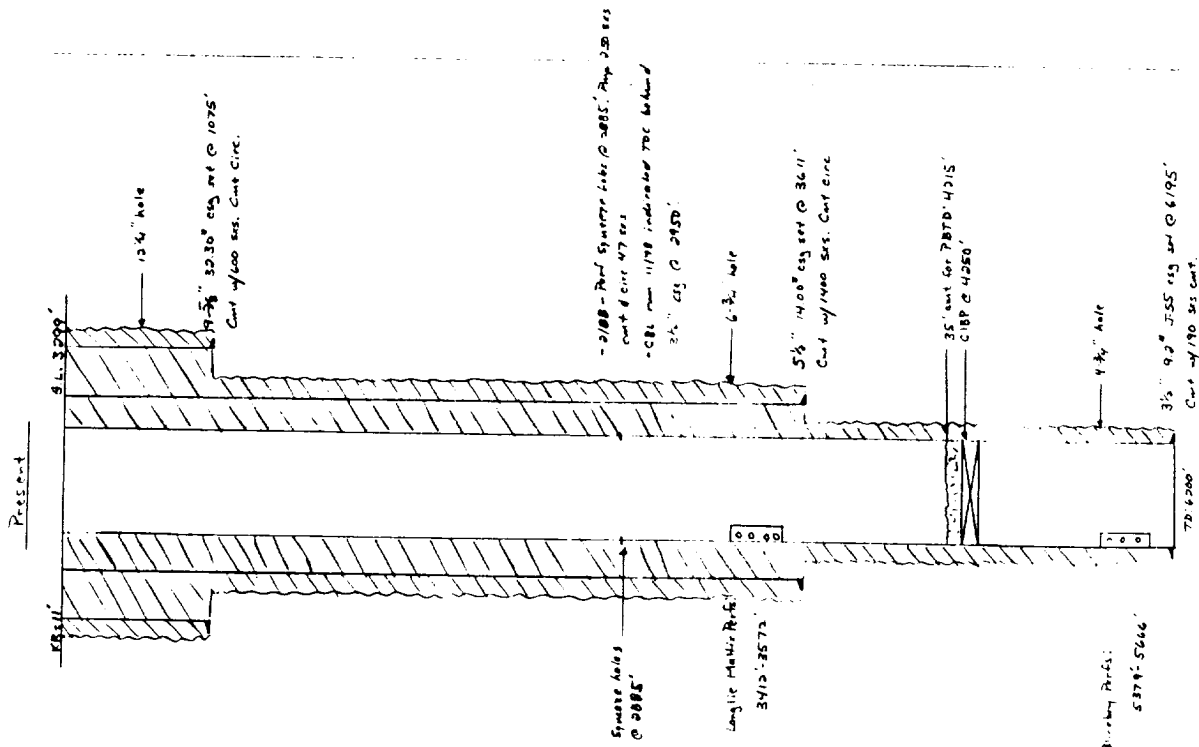

NEW MEXICO BE STATE NGTB No. 12
 Unit Letter O, SEC 16 T-235 R-37E
 Lea County, New Mexico

