

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SEP 12 10 01 AM '69

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name Woolworth
9. Well No. 1
10. Field and Pool, or Wildcat Jalmat Yates
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator Adriene G. Simon
3. Address of Operator Hobbs Pipe & Supply Co., Box 2010, Hobbs, N. Mex
4. Location of Well UNIT LETTER K FEET FROM THE _____ LINE AND _____ FEET FROM THE _____ LINE, SECTION 33 TOWNSHIP 24 RANGE 37 NMPM.
15. Elevation (Show whether DF, RT, GR, etc.)

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

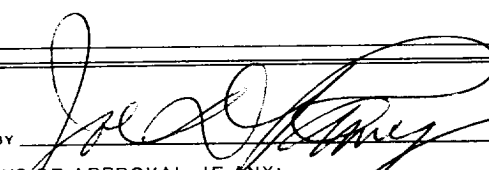
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- * 1. Plan to shoot tubing into at 2300'
- 2. Spot a 25 sx plug at 2300'
- 3. Shoot & recover approx 1500' of 5-1/2" casing
- 4. Spot a 25 sx plug at stub of 5-1/2"
- 5. Spot a 25 sx plug at base of 8-5/8" at 1200'
- 6. Recover 8-5/8" if possible
- 7. Spot a 25 sx plug in & out of stub of 8-5/8"
- 8. Spot a 10 sx plug in top & erect a marker
- 9. Hole will be loaded with mud

*Tubing is stuck in hole & tubing is plugged inside at a depth of 2358'

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED _____	TITLE Agent	DATE September 11, 1969
APPROVED BY 	TITLE SUPERVISOR DISTRICT	DATE SEP 15 1969
CONDITIONS OF APPROVAL, IF ANY:		