

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30 025 12234
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	B-9519
7. Lease Name or Unit Agreement Name	WEST DOLLARHIDE DRINKARD UNIT
8. Well No.	35
9. Pool Name or Wildcat	DOLLARHIDE TUBB DRINKARD

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER INJECTOR
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	P.O. BOX 730, HOBBS, NM 88240
4. Well Location	Unit Letter <u>N</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>1980</u> Feet From The <u>WEST</u> Line Section <u>29</u> Township <u>24S</u> Range <u>38E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3217' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐
 OTHER: PERFORATE AND STIMULATE WELL ☒

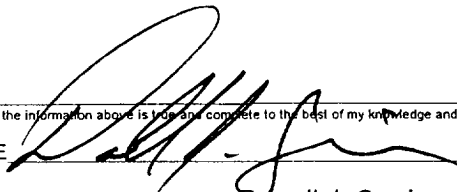
SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
 CASING TEST AND CEMENT JOB ☐
 OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. RUPU. INSTALL BOP. TOH WITH INJECTION EQUIPMENT.
2. CLEANOUT CASING TO 6769' WITH 3-1/8" BIT.
3. RU WIRELINE AND RUN GR-CNL LOG ON INTERVAL 6000'-6769'. PICK PERFORATION FROM LOG AND PERF WITH 2 JSPF.
4. TIH WITH TREATING PACKER AND SET @ 6440'.
5. ACIDIZE PERFORATIONS WITH 5000 GALLONS 20% HCL NEFE, 3000# ROCK SALT AND 30 BBL GELLED BRINE. AIR = 2-3 BPM, Pmax = 4000 PSI.
6. RELEASE PACKER AND POH WITH WORKSTRING.
7. TIH WITH INJECTION TUBING AND SET PACKER @ 6280'. LOAD BACKSIDE WITH PACKER FLUID.
8. PRESSURE TEST. RETURN TO INJECTION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Engineering Assistant DATE 2/6/95
 TYPE OR PRINT NAME Darrell J. Carriger Telephone No. 397-0426

(This space for State Use) ORIGINAL FILED IN DISTRICT OFFICE
 APPROVED BY  TITLE STATE REPRESENTATIVE DATE FEB 08 1995
 CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

72 HUBBS
OFFICE