Submit 3 Copies To Appropriate District Office

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised May 08, 2003

WELL API NO.
30-005-21111

5. **Indicate Type of Lease**
STATE ☐   FEE ☑

6. **State Oil & Gas Lease No.**

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. **Type of Well:**
Oil Well ☑   Gas Well ☐   Other

2. **Name of Operator** OGS Operating Co., Inc.

3. **Address of Operator** 550 W. Texas, Suite 1140, Midland, TX 79701

7. **Lease Name or Unit Agreement Name**
D. J. Fee

8. **Well Number**
1-Y

9. **OGRID Number**
16367

10. **Pool name or Wildcat**
Cato San Andres

4. **Well Location**

Unit Letter G : 1659 feet from the North line and 1745 feet from the East line

Section 35   Township 7-S   Range 30-E   NMPM   County Chaves

11. **Elevation** *(Show whether DR, RKB, RT, GR, etc.)*
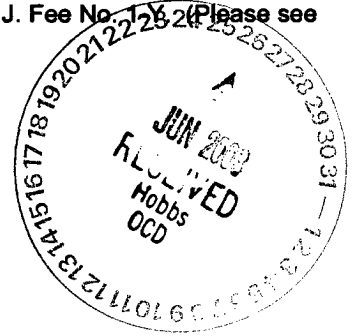4164" GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK ☐   PLUG AND ABANDON ☑

TEMPORARILY ABANDON ☐   CHANGE PLANS ☐

PULL OR ALTER CASING ☐   MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐   ALTERING CASING ☐

COMMENCE DRILLING OPNS ☐   PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

13. **Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

OGS Operating Co., Inc. respectfully requests permission to plug and abandon the D.J. Fee No. 1-Y 2 (Please see attached well bore schematic)   35'
Plug #1   Set CIBP @2700' cap w 20' cement
Plug #2   Spot 30 sk plug 2300' - 2100'
Plug #3   Spot 30 sk plug 1575' - 1375'
Plug #4   Spot 30 sk plug 440' - 240' — TAG
Plug #5   Spot 10 sk plug @surface
Install 4" dry hole marker extending 4' above ground surface

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

(circular stamp: RECEIVED JUN 2003 Hobbs OCD)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _James P. "Phil" Stinson_   TITLE Drilling Superintendent   DATE 6/24/03

Type or print name   James P. "Phil" Stinson   Telephone No. (432) 682-6373

(This space for State use)

JUN 2 6 2003

APPPROVED BY _Harry J. Wink_ OC FIELD REPRESENTATIVE II/STAFF MANAGER   DATE _____

Conditions of approval, if any:

8⅝" Casing Set @ 340' Cmt'd
with 200 SX Class "G" Cmt Circ 50 SX.

Formation Tops
Top Salt 1151'
Top Yates 1576'
Top 7 Rivers 1672'
Top Queen 2310
Top San Andres 2708

Perfs @ 3503' - 3632'

5½" Casing set @ 3700' DV Tool @ 1811'
1st Stage Cmt'd with 350 SX
2nd Stage Cmt'd with 400 SX

Spot 10 SK Plug @ Surface

Spot 30 SK Plug 440' - 240'

Spot 30 SK Plug 1575 - 1375

Spot 30 SK Plug 2300 - 2100'

Set CIBP @ 2700' Cap w 20' Cement