

UU LINE LEAK

Remediation Action Plan

NMOCD Incident No. nAPP2218244166
UL "B", Sec. 13, T17S, R34E
32.8424°, -103.5129°
Lea County, New Mexico

May 22, 2026



PREPARED ON BEHALF OF

DCP Operating Company, LP
411 S. Keeler Ave.
Suite 207 Adams Building
Bartlesville, Oklahoma 74006



PREPARED BY

Tasman, Inc.
2620 W. Marland Blvd.
Hobbs, NM 88240





May 22, 2026

DCP Operating Company, LP c/o Phillips 66 Company
411 S. Keeler Ave, Suite 207 Adams Building
Bartlesville, OK 74006

Attn: Ms. Becky Hesslen
Email: Becky.l.hesslen@p66.com

Re: Remediation Action Plan
UU Line Leak
UL "B", Section 13, Township 17 South, Range 34 East
Lea County, New Mexico
NMOCD Incident No. nAPP2218244166
Tasman Project No. 3228

Dear Ms. Hesslen,

Tasman, Inc. (Tasman) is pleased to submit this Remediation Action Plan for the above referenced site. Site assessment activities were executed in accordance with the New Mexico Oil Conservation Division (NMOCD) regulations concerning the delineation of releases of natural gas condensate to the environment.

Tasman conducted initial assessment activities, identifying an approximately 947-square foot area that had been impacted by the release. The release area was then vertically, and horizontally delineated. Based on laboratory analytical results from soil samples collected during confirmation sampling activities, impacted soil within the release area has been laterally delineated to the applicable NMOCD Action Level. Additional project details are provided in the attached Remediation Action Plan.

Tasman appreciates the opportunity to provide environmental services to DCP Operating Company, LP. Should you have any questions or require additional information, please do not hesitate to contact the undersigned.

Sincerely,
Tasman, Inc.

Kendon Stark
Project Manager
kstark@tasman-geo.com

Kyle Norman
Regional Project Manager
knorman@tasman-geo.com

TABLE OF CONTENTS

1.0 INTRODUCTION	1
1.1 Site Description	1
1.2 Release Detail and Initial Response	1
2.0 SITE CHARACTERISTICS	1
2.1 Depth to Groundwater	1
2.2 Karst Potential.....	2
2.3 Distance to Nearest Potable Water Well.....	2
2.4 Distance to Nearest Surface Water	2
2.5 100-year Floodplain	2
2.6 Residence, School, Hospital, or Institution	2
2.7 Proximity to Sensitive Receptors and Site Characteristics Summary	3
3.0 REMEDIATION AND ASSESSMENT LEVELS	3
3.1 Reclamation Levels	3
4.0 RELEASE ASSESSMENT.....	4
4.1 Soil Sampling Procedures for Laboratory Analysis.....	4
4.2 Soil Analytical Methods	5
4.3 Release Assessment Data Evaluation	5
5.0 PROPOSED REMEDIAL ACTIONS.....	5
6.0 PROPOSED RECLAMATION AND REVEGETATION	6

Figures

- Figure 1 – Site Location and Characteristics Map
- Figure 2 – Karst Potential & Subsurface Mine Map
- Figure 3 – Surface Water Map
- Figure 4 – FEMA FIRMetete Map
- Figure 5 – Delineation Overview Map

Table

- Table 1 – Soil Sample Analytical Summary – Confirmation and Delineation Soil Samples

Appendix A – NMOCD Notifications

Appendix B – Depth to Groundwater Information

Appendix C – Photographic Log

Appendix D – Certified Laboratory Analytical Reports

UU Line Leak - nAPP2218244166
Remediation Action Plan

1.0 INTRODUCTION

Tasman, Inc. (Tasman) is pleased to submit this Remediation Action Plan for the UU Line Leak (Site) on behalf of DCP Operating Company, LP (DCP), documenting the results of field activities conducted in response to a release of natural gas condensate to environmental media.

1.1 Site Description

The Site is located in Unit Letter “B” of Section 13, Township 17 South, Range 34 East in Lea County, New Mexico. The release occurred from the UU natural gas pipeline on property held by Angel Land and Livestock, LLC. The Site and surrounding area are primarily comprised of undeveloped pastureland and oil and gas infrastructure.

1.2 Release Detail and Initial Response

On May 19, 2021, the UU pipeline was discovered by DCP personnel to have failed due to internal corrosion. A Notification of Release (NOR) was provided to the New Mexico Oil Conservation District (NMOCD) via online portal on July 1, 2022. The incident resulted in the release of approximately 12 barrels (bbls) of natural gas condensate to the surrounding environmental media. DCP personnel shut in the pipeline to isolate the release. The line was later repaired and returned to service. No natural gas condensate was recovered.

Copies of the NMOCD notifications are provided in Appendix A.

2.0 SITE CHARACTERISTICS

2.1 Depth to Groundwater

Tasman reviewed available depth to groundwater information available through the New Mexico Office of the State Engineer (NMOSE) and U.S. Geological Survey (USGS) for registered water wells within a one-mile radius of the site. The nearest registered water well, identified as L-15993 – POD 1, is located 0.14 miles (740 feet) from the site. Groundwater was not encountered at its terminal depth of 105 feet below ground surface on December 2, 2025. One additional well, L-03007, is also located within 1,000 feet of the site. Both L-15993 and L-03007 are plugged and abandoned.

The Site Location and Characteristics Map included as Figure 1 illustrates the location of the registered water wells within the vicinity of the site, and a summary of depth to groundwater



UU Line Leak - nAPP2218244166
Remediation Action Plan

information as well as plugging records are provided as Appendix B.

2.2 Karst Potential

Tasman utilized the publicly available karst potential map published by the Bureau of Land Management (BLM) Carlsbad Field Office (CFO) to determine the potential for encountering karst formations beneath the site. Review of the BLM CFO karst potential map indicates that the site is located in an area of low potential to encounter karstic features.

Tasman utilized the USGS Mineral Resources database to determine that there are no subsurface mines beneath or in the vicinity of the site.

Areas of karst potential and subsurface mine locations are illustrated on Figure 2.

2.3 Distance to Nearest Potable Water Well

The nearest potable water well is assumed to be L-13291 POD 1, located 0.86 miles from the site. Tasman did not visually confirm the presence of the well. The location of L-13291 POD 1 is shown on the attached Figure 1 and the well log is provided in Appendix B.

2.4 Distance to Nearest Surface Water

Tasman reviewed aerial imagery and the National Wetland Inventory Map, published by the U.S. Fish and Wildlife Service, for wetlands and surface water in the vicinity of the site. The nearest wetland, a freshwater pond, is located approximately 0.42 miles from the site. The nearest significant surface water was identified as White Lake, located 7.34 miles from the site. The location of the nearest surface water body can be seen on Figures 1 and 3, respectively.

2.5 100-year Floodplain

Review of flood map data published by the Federal Emergency Management Agency (FEMA) indicates the site is not located within a 100-year floodplain. A copy of the FEMA FIRMete Map can be found attached as Figure 4.

2.6 Residence, School, Hospital, or Institution

Review of aerial imagery did not show that the site is within 300 feet of an occupied permanent residence, school, hospital, or institution.

UU Line Leak - nAPP2218244166
Remediation Action Plan



2.7 Proximity to Sensitive Receptors and Site Characteristics Summary

The table below denotes if the site is located within the minimum allowable distance from a sensitive receptor, as defined in New Mexico Administrative Code (NMAC) 19.15.29.

Site Characteristics Summary		
Approximate depth to groundwater:	>105 ft bgs	
Within an area of high karst potential?	☐ Yes	☒ No
Within 300 ft. of any continuously flowing of significant watercourse?	☐ Yes	☒ No
Within 200 ft. of any lakebed, sinkhole, or playa lake?	☐ Yes	☒ No
Within 300 ft. of an occupied permanent residence, school, hospital, or institution?	☐ Yes	☒ No
Within 500 ft. of a spring or private, domestic fresh water well?	☐ Yes	☒ No
Within 1,000 ft. of any fresh water well?	☐ Yes	☒ No
Within the incorporated municipal boundaries or within a municipal well field?	☐ Yes	☒ No
Within 300 ft. of a wetland?	☐ Yes	☒ No
Within the area overlying a subsurface mine?	☐ Yes	☒ No
Within an unstable area?	☐ Yes	☒ No
Within a 100-year floodplain?	☐ Yes	☒ No

3.0 REMEDIATION AND ASSESSMENT LEVELS

NMOCD assessment and cleanup levels for hydrocarbon and produced water releases are based on depth to groundwater and proximity to sensitive receptors as established in NMAC 19.15.29. Based on site characteristics described in Section 2.0, the NMOCD Action Levels for a site with a depth to groundwater greater than 100 feet were utilized; these Action Levels are as follows:

Constituent	Action Level
Chloride	20,000 mg/kg
TPH (GRO+DRO+MRO)	2,500 mg/kg
TPH (GRO+DRO)	1,000 mg/kg
BTEX	50 mg/kg
Benzene	10 mg/kg

TPH – total petroleum hydrocarbons

DRO – diesel range organics

BTEX – benzene, toluene, ethylbenzene, total xylenes

GRO – gasoline range organics

MRO – motor/lube oil range organics

mg/kg – milligrams per kilogram

3.1 Reclamation Levels

NMAC 19.15.29.13(D) codifies, and the *Procedures for Implementation of the Spill Rule*, dated September 6, 2019, clarifies that the top four feet of the remediated area should be non-waste containing. Therefore, the NMOCD Reclamation Standards are applied to the top four feet of any area impacted by a release that is not located within an active production facility. NMOCD Reclamation Standards are as follows:



UU Line Leak - nAPP2218244166
Remediation Action Plan

Constituent	Reclamation Standard
Chloride	600 mg/kg
TPH (GRO+DRO+MRO)	100 mg/kg
BTEX	50 mg/kg
Benzene	10 mg/kg

4.0 RELEASE ASSESSMENT

On June 9, 2021, Tasman was retained by DCP to respond to a release of natural gas condensate at the site. Initial observations indicated a disturbed area of approximately 947 square feet (ft²). A photographic log of the release area is included as Appendix C.

From September 15 to September 30, 2021, Tasman began excavation activities and approximately 576 cubic yards of impacted soil was excavated, exported, and properly disposed of at an NMOCD-approved facility. On September 30, 2021, three 5-point composite samples of the excavation were collected and submitted for laboratory analysis.

On March 8, 2023, due to elevated concentrations in samples collected from the remedial excavation, Tasman advanced seven trenches (referred to as verticals) via heavy equipment to delineate the release area vertically and horizontally. Verticals V-1 through V-5 were advanced outside of the apparent release area and verticals V-6 and V-7 were advanced within the release area. Verticals were advanced to depths varying from 2 to 15 ft bgs.

Analytical results are discussed further in section 4.3 and summarized on Table 1. Laboratory analytical results are included as Appendix D and waste manifests are available upon request. The attached Figure 5 illustrates the observed release area, current excavation extent, and location of vertical delineation trenches.

4.1 Soil Sampling Procedures for Laboratory Analysis

The collection of soil samples for laboratory analysis was conducted in accordance with NMOCD criteria and generally approved industry standards. Collected soil samples were placed in laboratory provided containers, properly labeled, and preserved on ice pending delivery under a chain of custody form to Cardinal Laboratory in Hobbs, New Mexico.



UU Line Leak - nAPP2218244166
Remediation Action Plan

4.2 Soil Analytical Methods

Each soil sample was analyzed using Environmental Protection Agency (EPA) or other NMOCD-approved methods. Laboratory analytical methods are as follows:

- Chloride – EPA Method SM4500.
- Total Petroleum Hydrocarbons (TPH) – gasoline, diesel, and motor/lube oil range organics (GRO+DRO+MRO) – EPA Method 8015M Extended.
- Benzene, toluene, ethylbenzene, and total xylenes (BTEX) – EPA Method 8021B.

4.3 Release Assessment Data Evaluation

Concentrations of benzene were not detected above Action Levels in any of the collected soil samples. One sample, V-5 at 9 ft bgs, exhibited concentrations above the laboratory reporting limit (RL) at 0.056 milligrams per kilogram (mg/kg).

Concentrations of total BTEX were detected above Action Levels in soil samples V-5 at 13 ft bgs (358 mg/kg) and V-5 at 15 ft bgs (235 mg/kg).

Concentrations of TPH (GRO/DRO) were detected above Action Levels in soil samples Bottom at 6 ft bgs (1,284 mg/kg), South Wall (1,440 mg/kg), and V-5 at 15 ft bgs (1,727 mg/kg).

Concentrations of total TPH (GRO/DRO/MRO) were detected above Action Levels in soil samples North Wall (2,891 mg/kg), V-5 at 9 ft bgs (2,681 mg/kg), and V-5 at 13 ft bgs (3,183 mg/kg).

Concentrations of chlorides were detected above Action Levels in soil sample South Wall (928 mg/kg).

Analytical results are summarized on Table 1 and laboratory analytical results are included as Appendix D.

5.0 PROPOSED REMEDIAL ACTIONS

Tasman proposes to remediate the site using physical removal of soil within the delineated area of the release. Vertical delineation has not yet been achieved at sample point Bottom as well as vertical V-5 that was advanced to 15 feet bgs. Tasman will excavate the area surrounding vertical V-5 to applicable Action Levels for the site. Samples Bottom, North Wall, and South Wall will be addressed with additional excavation until associated areas fall within applicable NMOCD Action Levels. Excavated soil will be staged on-site atop a polyethylene liner pending transportation



UU Line Leak - nAPP2218244166
Remediation Action Plan

under manifest to an NMOCD approved disposal facility.


Once field data indicates that the release area has been remediated to NMOCD requirements established in Section 3.0, Tasman will collect five-point confirmation samples from the base and sidewalls of the excavation. Confirmation sampling activities and laboratory analysis will be conducted as described in Sections 4.1 and 4.2.

6.0 PROPOSED RECLAMATION AND REVEGETATION

Upon receipt of confirmation samples that indicate remediation objectives have been met, areas affected by the release and associated remediation activities will be restored to the condition which existed prior to the release to the maximum extent possible. Excavated areas will be backfilled with non-impacted “like” material and contoured and/or compacted to achieve erosion control, stability, and preservation of surface water flow to the extent practicable.

Angel Land and Livestock, LLC. (surface owner) will be consulted for their preference in native seed mix. Upon surface owner approval, Tasman will seed the area using the approved seed mixture during the next favorable growing season.

Figures

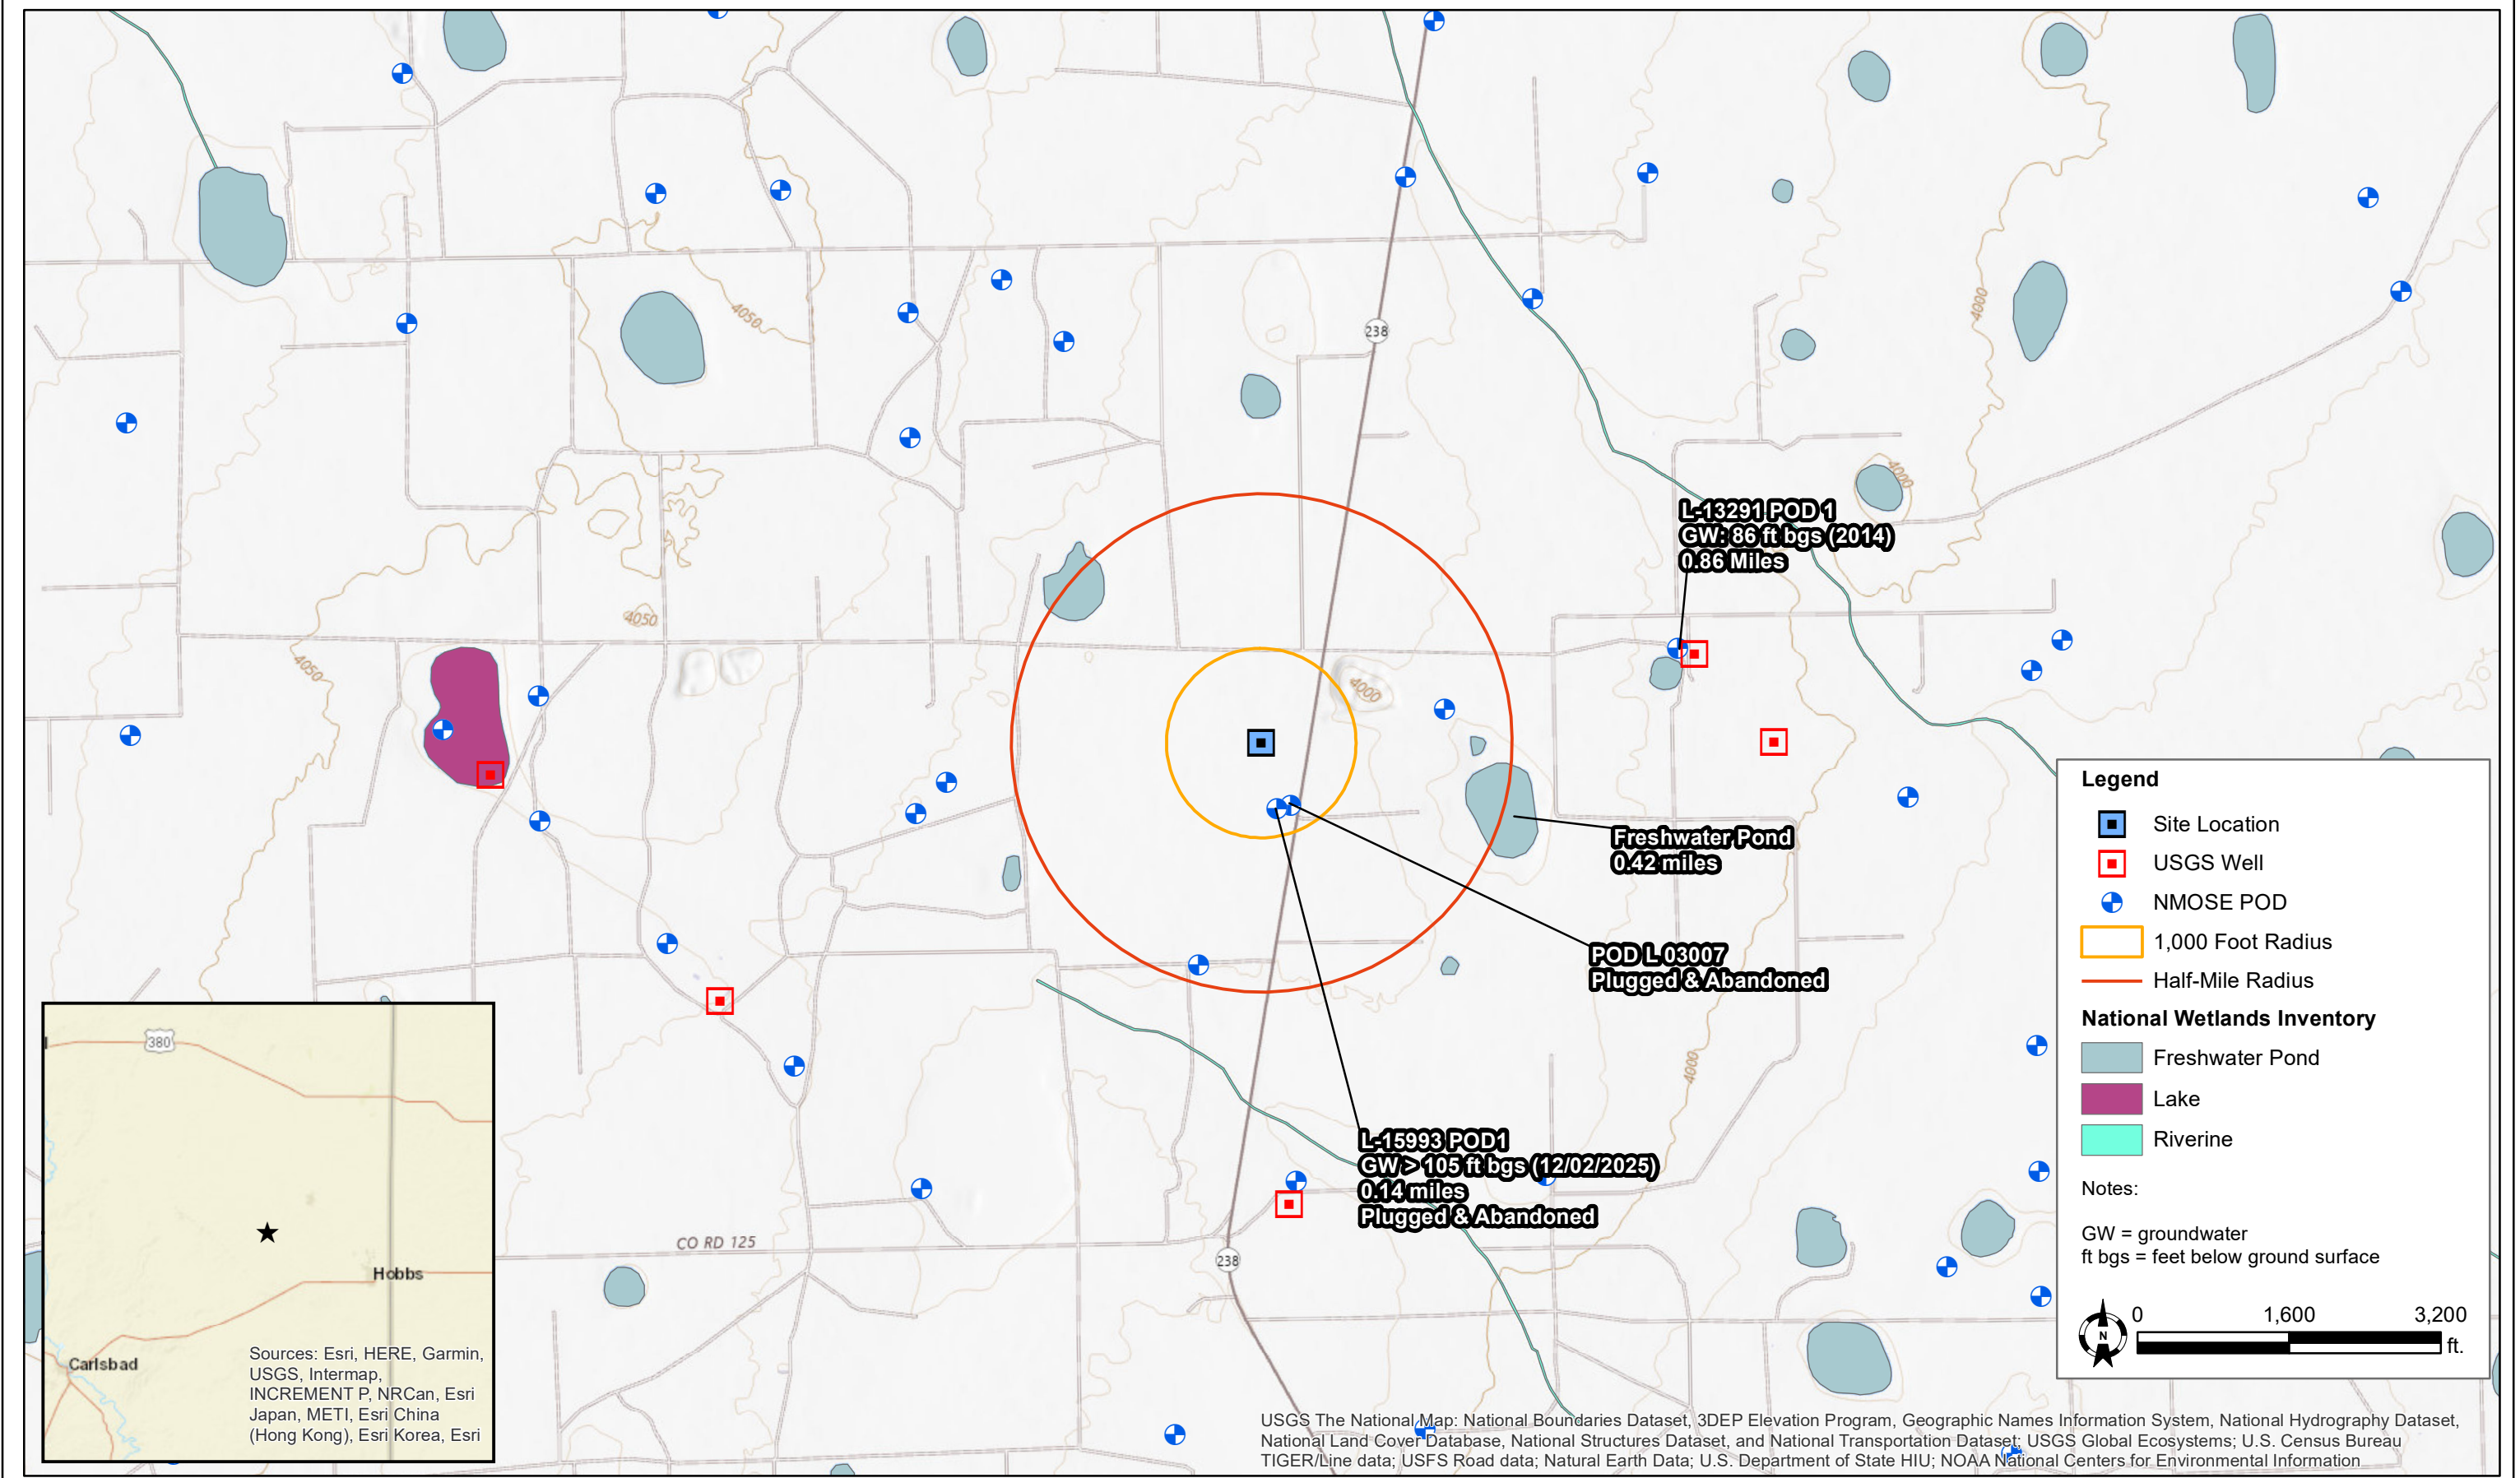

DATE: May 2026
DESIGNED BY: B. Dennis
DRAWN BY: C. Flores




Tasman, Inc.
2620 W Marland Blvd.
Hobbs, NM 88240

DCP Operating Company LP
UU Line Leak - nAPP2218244166
UL "B", Sec. 13, T17S, R34E
Lea County, New Mexico

Site Location & Characteristics
Map

Figure
1

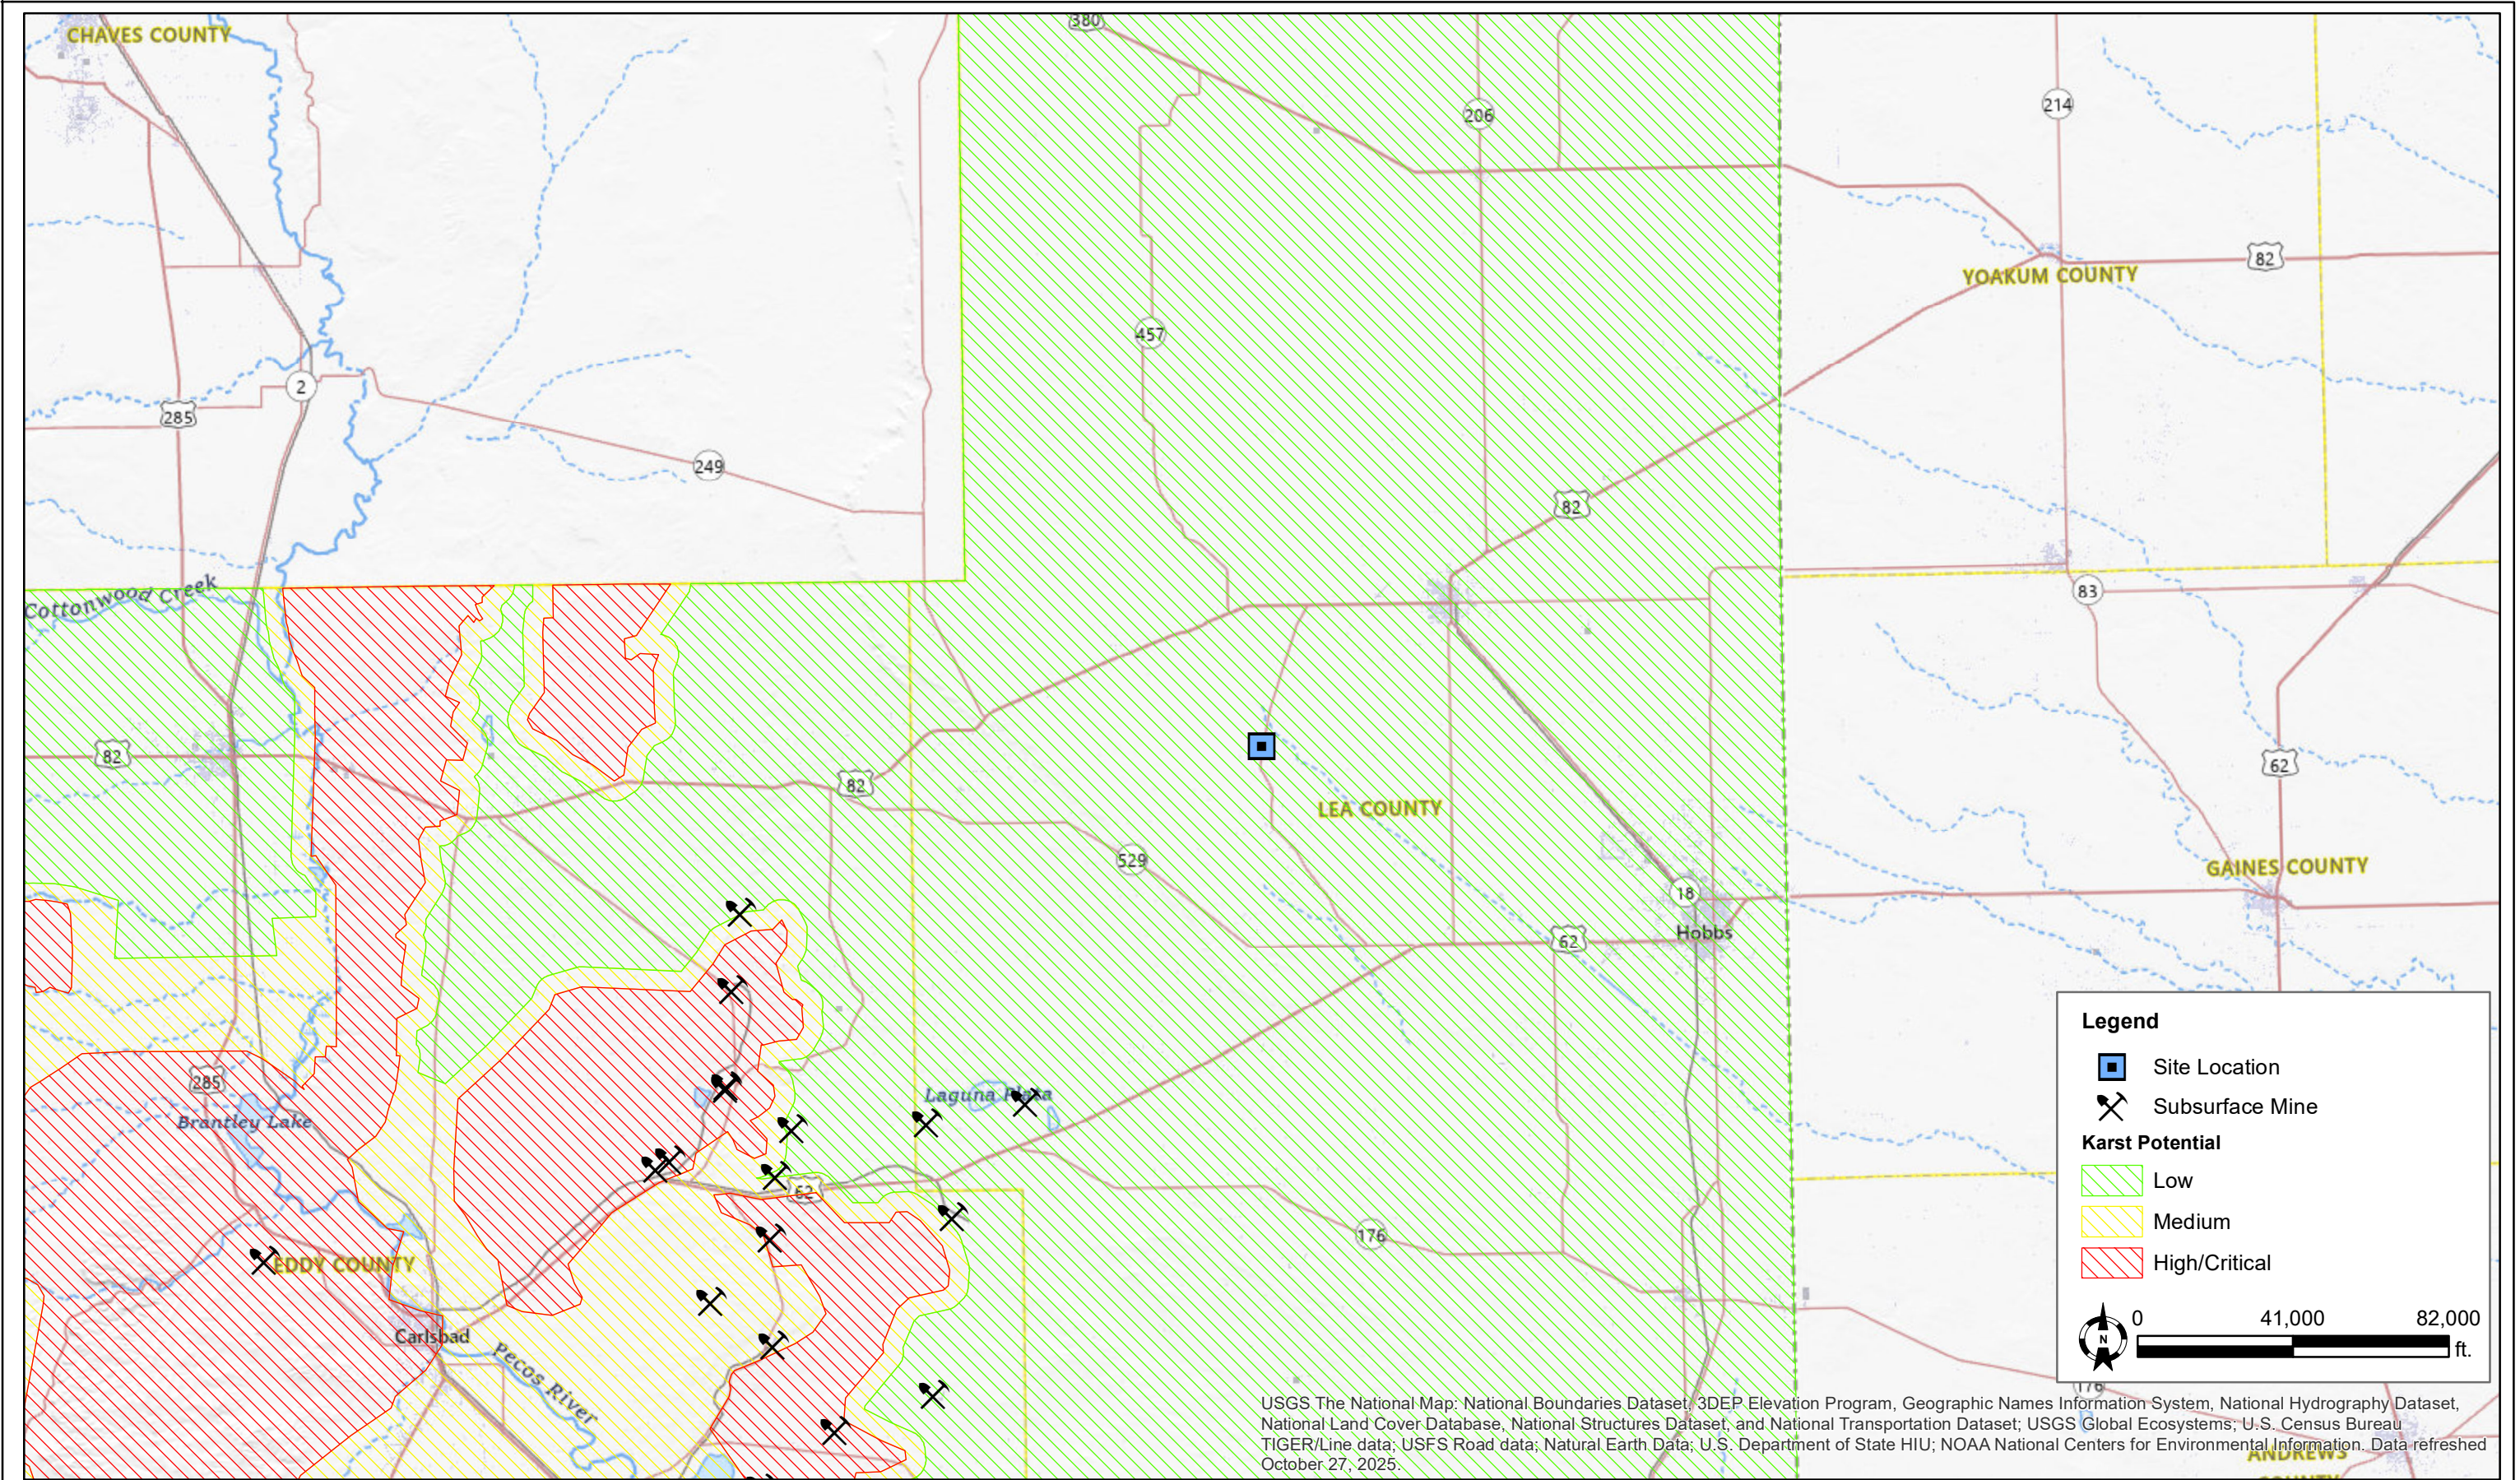

DATE:	January 2026
DESIGNED BY:	C. Flores
DRAWN BY:	C. Flores



Tasman, Inc.
2620 W. Marland Blvd.
Hobbs, NM 88240

DCP Operating Company LP
UU Line Leak - nAPP2218244166
UL "B", Sec. 13, T17S, R34E
Lea County, New Mexico

Karst Potential & Subsurface
Mine Map

Figure
2



DATE:	February 2026
DESIGNED BY:	C. Flores
DRAWN BY:	C. Flores



Tasman, Inc.
2620 W. Marland Blvd.
Hobbs, NM 88240

DCP Operating Company, LP
UU Line Leak - nAPP2218244166
UL "B", Sec. 13, T17S, R34E
Lea County, New Mexico


Surface Water Map

Figure
3

National Flood Hazard Layer FIRMMette



103°31'5"W 32°50'48"N



1:6,000

103°30'28"W 32°50'18"N

Basemap Imagery Source: USGS National Map 2023

Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

SPECIAL FLOOD HAZARD AREAS		Without Base Flood Elevation (BFE) <i>Zone A, V, A99</i>
		With BFE or Depth <i>Zone AE, AO, AH, VE, AR</i>
		Regulatory Floodway
OTHER AREAS OF FLOOD HAZARD		0.2% Annual Chance Flood Hazard, Areas of 1% annual chance flood with average depth less than one foot or with drainage areas of less than one square mile <i>Zone B</i>
		Future Conditions 1% Annual Chance Flood Hazard <i>Zone X</i>
		Area with Reduced Flood Risk due to Levee. See Notes. <i>Zone X</i>
		Area with Flood Risk due to Levee <i>Zone D</i>
OTHER AREAS		NO SCREEN Area of Minimal Flood Hazard <i>Zone X</i>
		Effective LOMRs
GENERAL STRUCTURES		Area of Undetermined Flood Hazard <i>Zone D</i>
		Channel, Culvert, or Storm Sewer
OTHER FEATURES		Levee, Dike, or Floodwall
		20.2 Cross Sections with 1% Annual Chance Water Surface Elevation
		17.5 Cross Sections with 1% Annual Chance Water Surface Elevation
		Coastal Transect
		Base Flood Elevation Line (BFE)
		Limit of Study
		Jurisdiction Boundary
		Coastal Transect Baseline
		Profile Baseline
		Hydrographic Feature
MAP PANELS		Digital Data Available
		No Digital Data Available
		Unmapped

The pin displayed on the map is an approximate point selected by the user and does not represent an authoritative property location.

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards


The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on **1/8/2026 at 6:12 PM** and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.

Released to Imaging: 7/14/2026 8:56:21 AM

Received by OCD: 5/22/2026 1:44:53 PM

Page 14 of 70

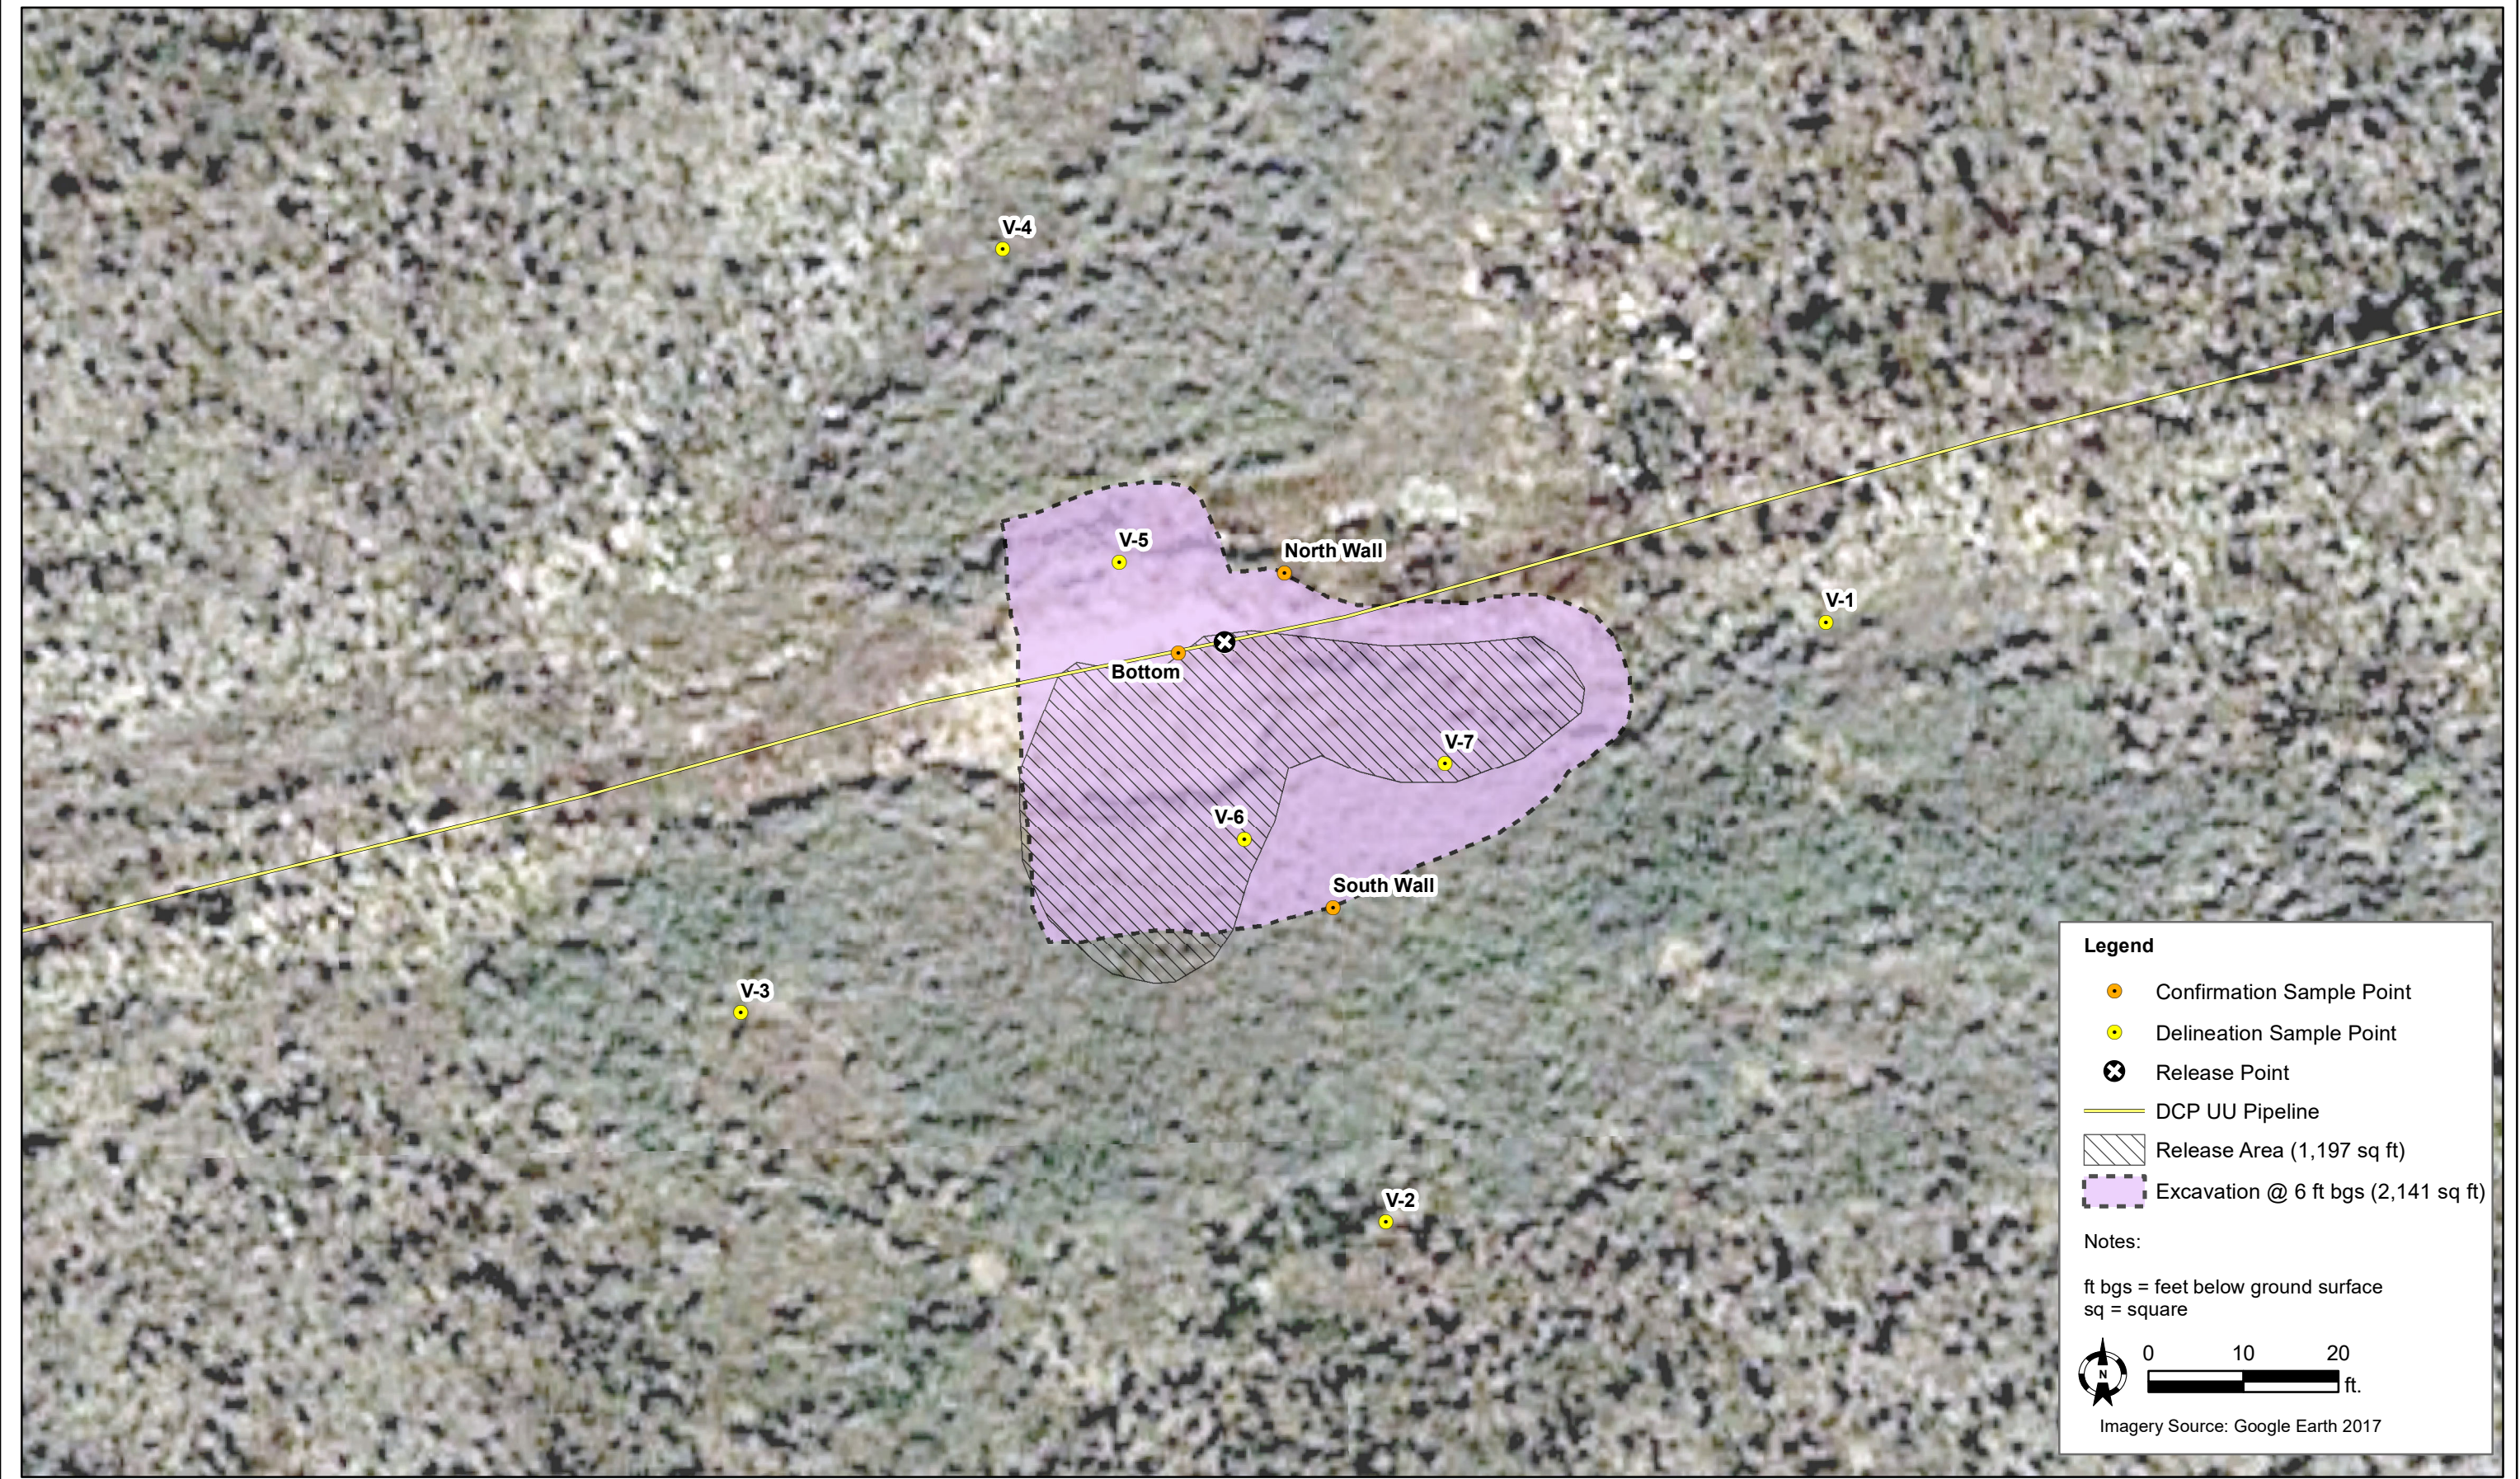

DATE:	January 2026
DESIGNED BY:	C. Flores
DRAWN BY:	C. Flores



Tasman, Inc.
2620 W. Marland Blvd.
Hobbs, NM 88240

DCP Operating Company, LP
UU Line Leak - nAPP2218244166
UL "B", Sec. 13, T17S, R34E
Lea County, New Mexico

Delineation Overview Map

Figure 5

Table

TABLE 1 - SOIL ANALYTICAL SUMMARY - CONFIRMATION AND DELINEATION SOIL SAMPLES

DCP Operating Company, LP

UU Line Leak

NMOCD Incident No. nAPP2218244166

Sample ID	Sample Depth	Sample Date	Soil Status	PID (ppm)	Field Chloride (mg/kg)	Benzene (mg/kg)	Total BTEX ¹ (mg/kg)	TPH ² (mg/kg)				Chloride ³ (mg/kg)
								GRO	DRO	MRO	TOTAL	
2021 Confirmation Samples												
Bottom	6'	9/30/2021	In-Situ	230.7	750	<0.050	5.23	104	1,180	70.1	1,354	896
North Wall	---	9/30/2021	In-Situ	2.8	427	<0.050	<0.300	<10.0	2,140	751	2,891	560
South Wall	---	9/30/2021	In-Situ	212.0	582	<0.050	4.87	69.9	1,370	351	1,791	928
2023 Vertical Installation												
V-1*	Surface - 6"	3/8/2023	In-Situ	9.3	60	---	---	---	---	---	---	---
	1'		In-Situ	2.5	57	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	80.0
	2'		In-Situ	2.6	60	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	80.0
V-2*	Surface - 6"	3/8/2023	In-Situ	2.0	58	---	---	---	---	---	---	---
	1'		In-Situ	2.8	85	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	16.0
	2'		In-Situ	4.8	61	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	80.0
V-3*	Surface - 6"	3/8/2023	In-Situ	2.5	56	---	---	---	---	---	---	---
	1'		In-Situ	1.3	56	---	---	---	---	---	---	---
	2'		In-Situ	0.6	118	---	---	---	---	---	---	---
	3'		In-Situ	1.4	381	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	352
	4'		In-Situ	1.5	287	---	---	---	---	---	---	---
	5'		In-Situ	4.1	254	---	---	---	---	---	---	---
	6'		In-Situ	3.1	342	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	304
V-4*	Surface - 6"	3/8/2023	In-Situ	2.1	83	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	48.0
	1'		In-Situ	2.2	60	---	---	---	---	---	---	---
	1.5'		In-Situ	3.7	56	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	16.0
V-5*	7'	3/8/2023	In-Situ	8.2	57	---	---	---	---	---	---	---
	8'		In-Situ	445.3	57	---	---	---	---	---	---	---
	9'		In-Situ	941.2	59	0.0560	25.3	571	1,990	120	2,681	48.0
	10'		In-Situ	527.3	59	---	---	---	---	---	---	---
	11'		In-Situ	504.0	58	---	---	---	---	---	---	---
	12'		In-Situ	1,596	88	---	---	---	---	---	---	---
	13'		In-Situ	3,157	171	<1.00	358	1,120	1,960	103	3,183	144
	14'		In-Situ	1,194	140	---	---	---	---	---	---	---
	15'		In-Situ	1,681	143	<1.00	235	557	1,170	65.3	1,792	80.0
NMOCD Reclamation Standards ⁴ (Applicable for soils less than 4 ft. below grade surface)				N/A	N/A	10	50	N/A			100	600
NMOCD Remediation and Delineation Standards ⁵ (Applicable for soils greater than 4 ft. below grade surface)				N/A	N/A	10	50	1,000		N/A	2,500	20,000

TABLE 1 - SOIL ANALYTICAL SUMMARY - CONFIRMATION AND DELINEATION SOIL SAMPLES

DCP Operating Company, LP
UU Line Leak
NMOCD Incident No. nAPP2218244166

Sample ID	Sample Depth	Sample Date	Soil Status	PID (ppm)	Field Chloride (mg/kg)	Benzene (mg/kg)	Total BTEX ¹ (mg/kg)	TPH ² (mg/kg)				Chloride ³ (mg/kg)
								GRO	DRO	MRO	TOTAL	
V-6*	7'	3/8/2023	In-Situ	3.4	286	---	---	---	---	---	---	---
	8'		In-Situ	3.4	366	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	416
	9'		In-Situ	0.9	283	---	---	---	---	---	---	---
	10'		In-Situ	0.9	361	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	512
V-7*	7'	3/8/2023	In-Situ	3.6	203	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	192
	8'		In-Situ	0.8	140	---	---	---	---	---	---	---
	9'		In-Situ	1.3	88	---	---	---	---	---	---	---
	10'		In-Situ	2.6	84	<0.050	<0.300	<10.0	<10.0	<10.0	<10.0	48.0
NMOCD Reclamation Standards ⁴ (Applicable for soils less than 4 ft. below grade surface)				N/A	N/A	10	50	N/A			100	600
NMOCD Remediation and Delineation Standards ⁵ (Applicable for soils greater than 4 ft. below grade surface)				N/A	N/A	10	50	1,000		N/A	2,500	20,000

Notes:

1. BTEX = Benzene, toluene, ethylbenzene, and total xylenes by EPA method 8021B
2. TPH = Total petroleum hydrocarbons analyzed by method EPA 8015M (GRO/DRO/MRO)
3. Chloride - Analyzed by EPA method SM4500
4. New Mexico Administrative Code (NMAC) 19.15.29.13(D) - Restoration, Reclamation, and Re-vegetation (Reclamation for areas no longer in use) for soils extending to 4 ft. below grade surface (bgs).
5. New Mexico Oil Conservation Division (NMOCD) Remediation and Delineation Standards (NMAC 19.15.29.12(N))

* = Denotes discrete/grab sample. All other samples were collected as 5-point composites

Bold values denote concentrations above laboratory RL

Red values denote concentrations above NMOCD Action Levels

GRO = Gasoline range organics

DRO = Diesel range organics

MRO = Motor/lube oil range organics

PID = Photoionization detector

--- = Sample was not analyzed for this analyte

<RL = The analyte was not detected above the laboratory reporting limit (RL)

N/A = Not applicable

Ft. = feet

Appendix A – NMOCD Notifications

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 122347

QUESTIONS

Operator: DCP OPERATING COMPANY, LP 6900 E. Layton Ave Denver, CO 80237	OGRID: 36785
	Action Number: 122347
	Action Type: [NOTIFY] Notification Of Release (NOR)

QUESTIONS

Location of Release Source	
<i>Please answer all of the questions in this group.</i>	
Site Name	UU Line
Date Release Discovered	05/19/2021
Surface Owner	Private

Incident Details	
<i>Please answer all of the questions in this group.</i>	
Incident Type	Natural Gas Release
Did this release result in a fire or is the result of a fire	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release	
<i>Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.</i>	
Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Not answered.
Is the concentration of dissolved chloride in the produced water >10,000 mg/l	Not answered.
Condensate Released (bbls) Details	Cause: Corrosion Pipeline (Any) Condensate Released: 12 BBL Recovered: 0 BBL Lost: 12 BBL]
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	The original leak was not thought to have triggered reporting but due to further investigation the overall affects will trigger reporting

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 122347

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 6900 E. Layton Ave Denver, CO 80237	OGRID: 36785
	Action Number: 122347
	Action Type: [NOTIFY] Notification Of Release (NOR)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by 19.15.29.7(A) NMAC	No, minor release.
Reasons why this would be considered a submission for a notification of a major release	
If YES, was immediate notice given to the OCD, by whom	<i>Not answered.</i>
If YES, was immediate notice given to the OCD, to whom	<i>Not answered.</i>
If YES, was immediate notice given to the OCD, when	<i>Not answered.</i>
If YES, was immediate notice given to the OCD, by what means (phone, email, etc.)	<i>Not answered.</i>
<i>With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.</i>	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	<i>Not answered.</i>

Per 19.15.29.8 B. (4) NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see 19.15.29.11(A)(5)(a) NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

ACKNOWLEDGMENTS

Action 122347

ACKNOWLEDGMENTS

Operator: DCP OPERATING COMPANY, LP 6900 E. Layton Ave Denver, CO 80237	OGRID: 36785
	Action Number: 122347
	Action Type: [NOTIFY] Notification Of Release (NOR)

ACKNOWLEDGMENTS

☒	I acknowledge that I am authorized to submit notification of a releases on behalf of my operator.
☒	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to my operator) to track the notification(s) and corrective action(s) for a release, pursuant to NMAC 19.15.29.
☒	I acknowledge that creating a new incident file will require my operator to file subsequent submission(s) of form "C-141, Application for administrative approval of a release notification and corrective action", pursuant to NMAC 19.15.29.
☒	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment.
☒	I acknowledge the fact that the acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment.
☒	I acknowledge the fact that, in addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 122347

CONDITIONS

Operator: DCP OPERATING COMPANY, LP 6900 E. Layton Ave Denver, CO 80237	OGRID: 36785
	Action Number: 122347
	Action Type: [NOTIFY] Notification Of Release (NOR)

CONDITIONS

Created By	Condition	Condition Date
knorman	When submitting future reports regarding this release, please submit the calculations used or specific justification for the volumes reported on the initial C-141.	7/1/2022

Appendix B – Depth to Groundwater Information

Section 1

(A) Owner of well Donnelly Drilling Co.

Street and Number. Box 433

City Artesia State New Mex.

Well was drilled under Permit No. 6-3007 and is located in the

1/4 NW 1/4 NE 1/4 of Section 13 Twp 17 S Rge. 34 E

(B) Drilling Contractor Cayton & Porter License No. WD-183

Street and Number..... Box 1021

City Lovington State New Mex.

Drilling was commenced October 26 1955

Drilling was completed.....October 26 19 55

(Plat of 640 acres)

Elevation at top of casing in feet above sea level..... Total depth of well..... 110

State whether well is shallow or artesian. Shallow Depth to water upon completion 70

Section 2

PRINCIPAL WATER-BEARING STRATA

No.	Depth in Feet		Thickness in Feet	Description of Water-Bearing Formation
	From	To		
1	85	110	25	Water Sand
2				
3				
4				
5				

Section 3

RECORD OF CASING

[illegible]

Section 4

RECORD OF MUDDING AND CEMENTING

Depth in Feet		Diameter Hole in in.	Tons Clay	No. Sacks of Cement	Methods Used
From	To				

Section 5

PLUGGING RECORD

Name of Plugging Contractor..... License No.....

Street and Number _____ City _____ State _____

Tons of Clay used..... Tons of Roughage used..... Type of roughage.....

Plugging method used _____ Date Plugged _____ 19____

Plugging approved by: _____ Cement Plugs were placed as follows:

Basin Supervisor

FOR USE OF STATE ENGINEER-ONLY	
Date Received	FILED NOV 10 1955
File No. <i>L-3007</i>	OFFICE GROUND WATER SUPERVISOR ROSWELL, NEW MEXICO Use <i>20</i>

No.	Depth of Plug		No. of Sacks Used
	From	To	
		NOV 20 1955	
			PM
	7/12/2/25/1	1/12/1/12/3/4/5/6	

Cement Plugs were placed as follows:

Location No. 17 34 13 2/D

LOG OF WELL

The undersigned hereby certifies that, to the best of his knowledge and belief, the foregoing is a true and correct record of the above described well.

Jack Cayton
Well Driller

WELL RECORD

INSTRUCTIONS: This form should be executed in triplicate, preferably typewritten, and submitted to the nearest district office of the State Engineer. All sections, except Section 5, shall be answered as completely and accurately as possible when any well is drilled, repaired or deepened. When this form is used as a plugging record, only Section 1A and Section 5 need be completed.

Section 1

(Plat of 640 acres)

(A) Owner of well Donnelly Drilling Company, Inc.
 Street and Number Box 433
 City Artesia State New Mexico
 Well was drilled under Permit No. L-3007 and is located in the
1/4 NW 1/4 NE 1/4 of Section 13 Twp. 17S Rge. 34E
 (B) Drilling Contractor _____ License No. _____
 Street and Number _____
 City _____ State _____
 Drilling was commenced _____ 19____
 Drilling was completed _____ 19____

Elevation at top of casing in feet above sea level _____ Total depth of well _____
 State whether well is shallow or artesian _____ Depth to water upon completion _____

Section 2

PRINCIPAL WATER-BEARING STRATA

No.	Depth in Feet		Thickness in Feet	Description of Water-Bearing Formation
	From	To		
1				
2				
3				
4				
5				

Section 3

RECORD OF CASING

Dia in.	Pounds ft.	Threads in	Depth		Feet	Type Shoe	Perforations	
			Top	Bottom			From	To

Section 4

RECORD OF MUDDING AND CEMENTING

Depth in Feet		Diameter Hole in in.	Tons Clay	No. Sacks of Cement	Methods Used
From	To				

Section 5

PLUGGING RECORD

Name of Plugging Contractor - Owner-Donnelly Drilling Co., Inc. License No. _____
 Street and Number Box 433 City Artesia State New Mexico
 Tons of Clay used _____ Tons of Roughage used _____ Type of roughage _____
 Plugging method used Bridged at 15' by hand Date Plugged April 28, 1958
 Plugging approved by: _____ Cement Plugs were placed as follows:

Robert C. Hulse
 H. H. Basin Supervisor
 FOR USE OF STATE ENGINEER ONLY
 APR 30 1958
 OFFICE
 GROUND WATER SUPERVISOR
 ROSWELL, NEW MEXICO
 Date Received _____

No.	Depth of Plug		No. of Sacks Used
	From	To	
	0	15	1 sx Acquagel &
			3 sx cement.
			Round cement mound
			as cap

File No. L-3007 Use P. 20 P. Location No. 17.34.13.210

LOG OF WELL

The undersigned hereby certifies that, to the best of his knowledge and belief, the foregoing is a true and correct record of the above described well.

Well Driller-



PLUGGING RECORD



NOTE: A Well Plugging Plan of Operations shall be approved by the State Engineer prior to plugging - 19.27.4 NMAC

I. GENERAL / WELL OWNERSHIP:

State Engineer Well Number: L-15993 - POD1

Well owner: Cross Timbers Energy, LLC

Phone No.: _____

Mailing address: 400W. 7th St.

City: Ft. Worth State: TX Zip code: 76102

II. WELL PLUGGING INFORMATION:

1) Name of well drilling company that plugged well: H&R Enterprises, LLC.

2) New Mexico Well Driller License No.: WD-1862 Expiration Date: 6-16-27

3) Well plugging activities were supervised by the following well driller(s)/rig supervisor(s):
Nathan Smelcer

4) Date well plugging began: 12-8-25 Date well plugging concluded: 12-8-25

5) GPS Well Location: Latitude: 32 deg, 50 min, 25.70 sec
Longitude: 103 deg, 30 min, 44.84 sec, WGS 84

6) Depth of well confirmed at initiation of plugging as: 105' ft below ground level (bgl),
by the following manner: well sounder

7) Static water level measured at initiation of plugging: N/A ft bgl

8) Date well plugging plan of operations was approved by the State Engineer: 10-21-25

9) Were all plugging activities consistent with an approved plugging plan? yes If not, please describe differences between the approved plugging plan and the well as it was plugged (attach additional pages as needed):

USE DII ROSWELL NM
15 DEC '25 AM10:06

- For each interval plugged, describe within the following columns:**

OSE DII ROSWELL NM
15 DEC '25 AM 10:06

MULTIPLY		BY	AND OBTAIN
cubic feet	x	7.4805	= gallons
cubic yards	x	201.97	= gallons

I, James Hawley, say that I am familiar with the rules of the Office of the State Engineer pertaining to the plugging of wells and that each and all of the statements in this Plugging Record and attachments are true to the best of my knowledge and belief.

lieft.



Signature of Well Driller

12-8-25

Date _____



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

STATE ENGINEER OFFICE
ROSWELL, NEW MEXICO

2014 SEP -9 AM 10: 28

1. GENERAL AND WELL LOCATION	OSE POD NUMBER (WELL NUMBER) L 13291 POD 1			OSE FILE NUMBER(S) L 13291				
	WELL OWNER NAME(S) Eidson Ranch			PHONE (OPTIONAL)				
	WELL OWNER MAILING ADDRESS PO Box 1286			CITY STATE ZIP Lovington NM 88260				
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 50.698	SECONDS 4.88	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84			
LONGITUDE 103 29.912 54.72 DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE NE SE SW Sect 7 Township 17S Range 35E								
2. DRILLING & CASING INFORMATION	LICENSE NUMBER W01626		NAME OF LICENSED DRILLER Roy A. Taylor		NAME OF WELL DRILLING COMPANY Eco/Enviro Drilling LLC			
	DRILLING STARTED 8-26-14	DRILLING ENDED 8-26-14	DEPTH OF COMPLETED WELL (FT) 210	BORE HOLE DEPTH (FT) 210	DEPTH WATER FIRST ENCOUNTERED (FT) 86			
	COMPLETED WELL IS: ☐ ARTESIAN ☐ DRY HOLE ☒ SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) 86			
	DRILLING FLUID: ☐ AIR ☒ MUD ☐ ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☒ ROTARY ☐ HAMMER ☐ CABLE TOOL ☐ OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE	CASING INSIDE DIAM (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	170	10	PVC	Glue	5.135	0.214	NA
	170	210	10	PVC	Glue	5.033	0.265	0.032
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	10	210	10	3/8 artesian	66	Hand		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/08/2012)

FILE NUMBER	L 13291	POD NUMBER	1	TRN NUMBER	553072
LOCATION	17S.35E.7.3.4.2			Livestock	

4. HYDROGEOLOGIC LOG OF WELL

CONCLUSION

Appendix C – Photographic Log

DCP Operating Company, LP

UU Line (5-19-2021)
nAPP2218244166



DCP Operating Company, LP


UU Line (5-19-2021)

nAPP2218244166




DCP Operating Company, LP

UU Line (5-19-2021)
nAPP2218244166

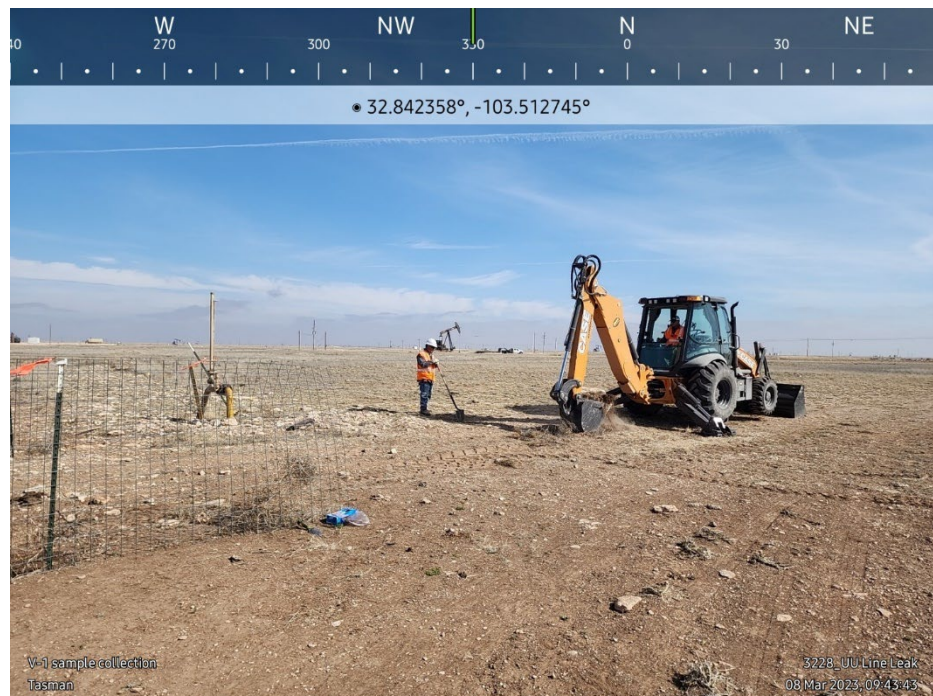

DCP Operating Company, LP

UU Line (5-19-2021)
nAPP2218244166

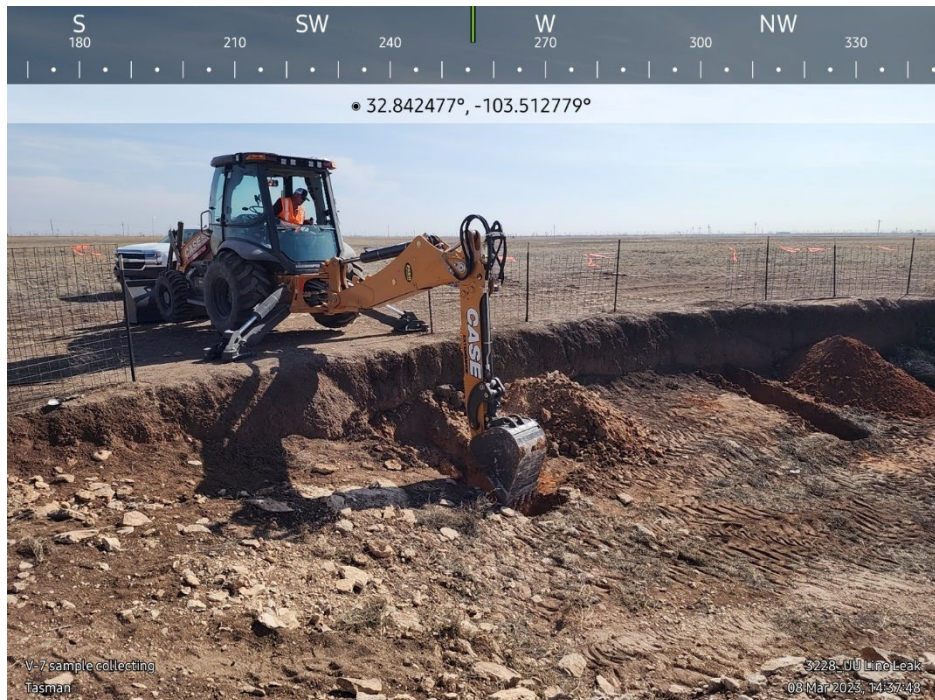

Appendix D – Certified Laboratory Analytical Reports



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

October 05, 2021

KYLE NORMAN

TASMAN GEOSCIENCES

6899 PECOS ST. UNIT C

DENVER, CO 80221

RE: DCP - UU LINE LEAK

Enclosed are the results of analyses for samples received by the laboratory on 09/30/21 15:30.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-21-14. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 09/30/2021
 Reported: 10/05/2021
 Project Name: DCP - UU LINE LEAK
 Project Number: (5 - 19 - 21)
 Project Location: NONE GIVEN

Sampling Date: 09/30/2021
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Tamara Oldaker

Sample ID: 5 PT COMP BOTTOM @ 6' (H212718-01)

BTX 8021B		mg/kg		Analyzed By: MS				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	09/30/2021	ND	2.08	104	2.00	2.59	
Toluene*	0.278	0.050	09/30/2021	ND	2.06	103	2.00	5.23	
Ethylbenzene*	0.732	0.050	09/30/2021	ND	2.07	104	2.00	4.45	
Total Xylenes*	4.22	0.150	09/30/2021	ND	6.29	105	6.00	3.98	
Total BTX	5.23	0.300	09/30/2021	ND					

Surrogate: 4-Bromofluorobenzene (PID) 183 % 69.9-140

Chloride, SM4500Cl-B			mg/kg					Analyzed By: GM	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	896	16.0	10/01/2021	ND	448	112	400	3.64	

TPH 8015M			mg/kg					Analyzed By: MS	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	104	10.0	10/01/2021	ND	199	99.6	200	0.968	
DRO >C10-C28*	1180	10.0	10/01/2021	ND	226	113	200	0.745	
EXT DRO >C28-C36	70.1	10.0	10/01/2021	ND					

Surrogate: 1-Chlorooctane 96.4 % 44.3-133

Surrogate: 1-Chlorooctadecane 93.0 % 38.9-142

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 09/30/2021
 Reported: 10/05/2021
 Project Name: DCP - UU LINE LEAK
 Project Number: (5 - 19 - 21)
 Project Location: NONE GIVEN

Sampling Date: 09/30/2021
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Tamara Oldaker

Sample ID: 5 PT COMP NORTH WALL (H212718-02)

BTEx 8021B		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	10/01/2021	ND	2.00	100	2.00	9.51	
Toluene*	<0.050	0.050	10/01/2021	ND	2.00	99.8	2.00	9.35	
Ethylbenzene*	<0.050	0.050	10/01/2021	ND	2.02	101	2.00	7.62	
Total Xylenes*	<0.150	0.150	10/01/2021	ND	6.09	102	6.00	7.41	
Total BTEx	<0.300	0.300	10/01/2021	ND					

Surrogate: 4-Bromofluorobenzene (PID) 108 % 69.9-140

Chloride, SM4500CI-B		mg/kg		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	560	16.0	10/01/2021	ND	448	112	400	3.64	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	10/01/2021	ND	199	99.6	200	0.968	
DRO >C10-C28*	2140	10.0	10/01/2021	ND	226	113	200	0.745	
EXT DRO >C28-C36	751	10.0	10/01/2021	ND					

Surrogate: 1-Chlorooctane 78.3 % 44.3-133

Surrogate: 1-Chlorooctadecane 109 % 38.9-142

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 09/30/2021
 Reported: 10/05/2021
 Project Name: DCP - UU LINE LEAK
 Project Number: (5 - 19 - 21)
 Project Location: NONE GIVEN

Sampling Date: 09/30/2021
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Tamara Oldaker

Sample ID: 5 PT COMP SOUTH WALL (H212718-03)

BTX 8021B		mg/kg	Analyzed By: MS					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	10/01/2021	ND	2.00	100	2.00	9.51	
Toluene*	0.380	0.050	10/01/2021	ND	2.00	99.8	2.00	9.35	
Ethylbenzene*	0.966	0.050	10/01/2021	ND	2.02	101	2.00	7.62	
Total Xylenes*	3.52	0.150	10/01/2021	ND	6.09	102	6.00	7.41	
Total BTX	4.87	0.300	10/01/2021	ND					

Surrogate: 4-Bromofluorobenzene (PID) 143 % 69.9-140

Chloride, SM4500CI-B		mg/kg	Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	928	16.0	10/01/2021	ND	448	112	400	3.64	

TPH 8015M		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	69.9	10.0	10/01/2021	ND	199	99.6	200	0.968	
DRO >C10-C28*	1370	10.0	10/01/2021	ND	226	113	200	0.745	
EXT DRO >C28-C36	351	10.0	10/01/2021	ND					

Surrogate: 1-Chlorooctane 91.3 % 44.3-133

Surrogate: 1-Chlorooctadecane 104 % 38.9-142

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
 (505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Tasman Geosciences, LLC

Project Manager: Kyle Norman

Address: 2620 W Marland Blvd

City: Hobbs

Phone #: 575-318-5017

Project #:

Project Name: DCP

Project Location: UU Line (5-19-21)

Sampler Name: Becky Griffin

State: NM Zip: 88240

Fax #:

Project Owner: DCP Midstream

BILL TO

P.O. #:

Company: Tasman Geo

Attn: Kyle Norman

Address: 2620 W. Marland

City: Hobbs

State: NM Zip: 88240

Phone #: 575-318-5017

Fax #:

ANALYSIS REQUEST

Chlorides

TPH 8015 M

BTEX

Texas TPH

CompleteCations/Anions

TDS

HOLD

RUSH

FOR LAB USE ONLY

Lab I.D.

Sample I.D.

H22718

1 5 Pt Comp Bottom @ 6'
 2 5 Pt Comp North Wall
 3 5 Pt Comp South Wall

(G)RAB OR (C)OMP	# CONTAINERS	MATRIX						PRESERV.		SAMPLING	
		GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	DATE	TIME
	1			✓				✓		9/30/21	07:00
	1			✓				✓		9/30/21	07:20
	1			✓				✓		9/30/21	07:40

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By:

Date: 9-30-21
 Time: 1530

Received By:

Relinquished By:

Date:
 Time:

Received By:

Delivered By: (Circle One)

Sampler - UPS - Bus - Other:

-6.9°C - 0.52
 -7.4°C #13

Sample Condition
 Cool Intact
☒ Yes ☐ No

CHECKED BY:
 (Initials)

Phone Result: ☐ Yes ☒ No Add'l Phone #:
 Fax Result: ☐ Yes ☒ No Add'l Fax #:

REMARKS:

email results to: knorman@tasman-geo.com,
 bggriffin@tasman-geo.com, Cook, JohnW
 <JWCook@dcpmidstream.com> Hyman, Albert L
 <ALHyman@dcpmidstream.com> Hyman, Janice L
 <JHyman@dcpmidstream.com>

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

March 15, 2023

KYLE NORMAN

TASMAN GEOSCIENCES

6899 PECOS ST. UNIT C

DENVER, CO 80221

RE: 3228_UU LINE LEAK

Enclosed are the results of analyses for samples received by the laboratory on 03/10/23 16:55.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-22-15. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive, flowing style.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 1 @ 1' (H231124-01)

BTEx 8021B			mg/kg							
			Analyzed By: JH/							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTEX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 117 % 71.5-134

Chloride, SM4500Cl-B			mg/kg							
			Analyzed By: GM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	03/14/2023	ND	416	104	400	3.77		

TPH 8015M			mg/kg							
			Analyzed By: MS							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	173	86.3	200	0.630		
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	165	82.6	200	2.66		
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND						

Surrogate: 1-Chlorooctane 84.8 % 48.2-134

Surrogate: 1-Chlorooctadecane 91.6 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 1 @ 2' (H231124-02)

BTEx 8021B		mg/kg		Analyzed By: JH/						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTEX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 117 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	03/14/2023	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 76.1 % 48.2-134

Surrogate: 1-Chlorooctadecane 86.9 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 2 @ 1' (H231124-03)

BTEx 8021B			mg/kg							
			Analyzed By: JH/							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTEX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 119 % 71.5-134

Chloride, SM4500Cl-B			mg/kg							
			Analyzed By: GM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M			mg/kg							
			Analyzed By: MS							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5		
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5		
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND						

Surrogate: 1-Chlorooctane 90.4 % 48.2-134

Surrogate: 1-Chlorooctadecane 103 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 2 @ 2' (H231124-04)

BTEx 8021B		mg/kg		Analyzed By: JH/					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2	
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0	
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1	
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3	
Total BTEX	<0.300	0.300	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 117 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 76.7 % 48.2-134

Surrogate: 1-Chlorooctadecane 84.4 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 3 @ 3' (H231124-05)

BTX 8021B			mg/kg							
			Analyzed By: JH/							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 116 % 71.5-134

Chloride, SM4500CI-B			mg/kg							
			Analyzed By: GM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	352	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M			mg/kg							
			Analyzed By: MS							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5		
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5		
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND						

Surrogate: 1-Chlorooctane 65.9 % 48.2-134

Surrogate: 1-Chlorooctadecane 71.3 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 3 @ 6' (H231124-06)

BTEx 8021B		mg/kg		Analyzed By: JH/						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTEx	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 120 % 71.5-134

Chloride, SM4500CI-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	304	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 83.3 % 48.2-134

Surrogate: 1-Chlorooctadecane 93.5 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 4 @ 0-0.5 (H231124-07)

BTEx 8021B		mg/kg		Analyzed By: JH/						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTEX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 120 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 79.5 % 48.2-134

Surrogate: 1-Chlorooctadecane 93.0 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 4 @ 1.5' (H231124-08)

BTX 8021B			mg/kg							
			Analyzed By: JH/							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2		
Toluene*	<0.050	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0		
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1		
Total Xylenes*	<0.150	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3		
Total BTX	<0.300	0.300	03/15/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 119 % 71.5-134

Chloride, SM4500CI-B			mg/kg							
			Analyzed By: GM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16.0	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M			mg/kg							
			Analyzed By: MS							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5		
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5		
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND						

Surrogate: 1-Chlorooctane 65.1 % 48.2-134

Surrogate: 1-Chlorooctadecane 72.7 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 5 @ 9' (H231124-09)

BTEx 8021B		mg/kg	Analyzed By: JH/					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	0.056	0.050	03/15/2023	ND	1.81	90.4	2.00	24.2	
Toluene*	1.27	0.050	03/15/2023	ND	1.80	89.8	2.00	24.0	
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	1.81	90.6	2.00	22.1	
Total Xylenes*	23.9	0.150	03/15/2023	ND	5.72	95.3	6.00	21.3	GC-NC1
Total BTEX	25.3	0.300	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 895 % 71.5-134

Chloride, SM4500Cl-B		mg/kg	Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	48.0	16.0	03/14/2023	ND	432	108	400	3.77	

TPH 8015M		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	571	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	1990	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	120	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 113 % 48.2-134

Surrogate: 1-Chlorooctadecane 102 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 5 @ 13' (H231124-10)

BTX 8021B		mg/kg	Analyzed By: JH/					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<1.00	1.00	03/15/2023	ND	1.81	90.4	2.00	24.2	
Toluene*	13.2	1.00	03/15/2023	ND	1.80	89.8	2.00	24.0	
Ethylbenzene*	29.4	1.00	03/15/2023	ND	1.81	90.6	2.00	22.1	
Total Xylenes*	316	3.00	03/15/2023	ND	5.72	95.3	6.00	21.3	
Total BTX	358	6.00	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 216 % 71.5-134

Chloride, SM4500CI-B		mg/kg	Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	144	16.0	03/14/2023	ND	432	108	400	3.77	

TPH 8015M		mg/kg	Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	1120	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	1960	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	103	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 121 % 48.2-134

Surrogate: 1-Chlorooctadecane 91.3 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 5 @ 15' (H231124-11)

BTEx 8021B		mg/kg		Analyzed By: JH/					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<1.00	1.00	03/15/2023	ND	1.98	99.1	2.00	4.54	
Toluene*	15.1	1.00	03/15/2023	ND	2.03	102	2.00	1.65	QM-07
Ethylbenzene*	21.8	1.00	03/15/2023	ND	2.02	101	2.00	2.26	QM-07
Total Xylenes*	198	3.00	03/15/2023	ND	6.10	102	6.00	1.61	QM-07
Total BTEX	235	6.00	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 116 % 71.5-134

Chloride, SM4500CI-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M	mg/kg		Analyzed By: MS						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	557	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	1170	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	65.3	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 82.3 % 48.2-134

Surrogate: 1-Chlorooctadecane 77.4 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 6 @ 8' (H231124-12)

BTEx 8021B		mg/kg		Analyzed By: JH/					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/14/2023	ND	1.98	99.1	2.00	4.54	
Toluene*	<0.050	0.050	03/14/2023	ND	2.03	102	2.00	1.65	
Ethylbenzene*	<0.050	0.050	03/14/2023	ND	2.02	101	2.00	2.26	
Total Xylenes*	<0.150	0.150	03/14/2023	ND	6.10	102	6.00	1.61	
Total BTEX	<0.300	0.300	03/14/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 105 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	416	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 69.9 % 48.2-134

Surrogate: 1-Chlorooctadecane 81.8 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 6 @ 10' (H231124-13)

BTEx 8021B			mg/kg							
			Analyzed By: JH/							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	03/14/2023	ND	1.98	99.1	2.00	4.54		
Toluene*	<0.050	0.050	03/14/2023	ND	2.03	102	2.00	1.65		
Ethylbenzene*	<0.050	0.050	03/14/2023	ND	2.02	101	2.00	2.26		
Total Xylenes*	<0.150	0.150	03/14/2023	ND	6.10	102	6.00	1.61		
Total BTEX	<0.300	0.300	03/14/2023	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 71.5-134

Chloride, SM4500Cl-B			mg/kg							
			Analyzed By: GM							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	512	16.0	03/14/2023	ND	432	108	400	3.77		

TPH 8015M			mg/kg							
			Analyzed By: MS							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5		
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5		
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND						

Surrogate: 1-Chlorooctane 71.5 % 48.2-134

Surrogate: 1-Chlorooctadecane 81.8 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 7 @ 7' (H231124-14)

BTEx 8021B		mg/kg		Analyzed By: JH/					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/15/2023	ND	1.98	99.1	2.00	4.54	
Toluene*	<0.050	0.050	03/15/2023	ND	2.03	102	2.00	1.65	
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	2.02	101	2.00	2.26	
Total Xylenes*	<0.150	0.150	03/15/2023	ND	6.10	102	6.00	1.61	
Total BTEx	<0.300	0.300	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500CI-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	192	16.0	03/14/2023	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 64.3 % 48.2-134

Surrogate: 1-Chlorooctadecane 72.9 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

TASMAN GEOSCIENCES
 KYLE NORMAN
 6899 PECOS ST. UNIT C
 DENVER CO, 80221
 Fax To:

Received: 03/10/2023
 Reported: 03/15/2023
 Project Name: 3228_UU LINE LEAK
 Project Number: 3228
 Project Location: NOT GIVEN

Sampling Date: 03/08/2023
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 7 @ 10' (H231124-15)

BTEx 8021B		mg/kg		Analyzed By: JH/					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	03/15/2023	ND	1.98	99.1	2.00	4.54	
Toluene*	<0.050	0.050	03/15/2023	ND	2.03	102	2.00	1.65	
Ethylbenzene*	<0.050	0.050	03/15/2023	ND	2.02	101	2.00	2.26	
Total Xylenes*	<0.150	0.150	03/15/2023	ND	6.10	102	6.00	1.61	
Total BTEX	<0.300	0.300	03/15/2023	ND					

Surrogate: 4-Bromofluorobenzene (PID) 104 % 71.5-134

Chloride, SM4500Cl-B		mg/kg		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	03/14/2023	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	03/14/2023	ND	235	118	200	19.5	
DRO >C10-C28*	<10.0	10.0	03/14/2023	ND	232	116	200	23.5	
EXT DRO >C28-C36	<10.0	10.0	03/14/2023	ND					

Surrogate: 1-Chlorooctane 82.1 % 48.2-134

Surrogate: 1-Chlorooctadecane 92.5 % 49.1-148

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager

PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
QR-04	The RPD for the BS/BSD was outside of historical limits.
QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
GC-NC1	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are biased high with interfering compounds.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



ARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Company Name: Tasman Geosciences				BILL TO				ANALYSIS REQUEST																				
Project Manager: Kyle Norman				P.O. #:				TPH 8015 Ext BTEX Chlorides 24-hr Rush																				
Address: 2620 W. Marland Blvd.				Company: Tasman Geo																								
City: Hobbs		State: NM Zip: 88240		Attn: Kyle Norman																								
Phone #: 575-318-5017		Fax #:		Address: 2620 W. Marland																								
Project #: 3228		Project Owner: DCP Midstream		City: Hobbs																								
Project Name: 3228_UU Line Leak				State: NM Zip: 88240																								
Project Location:				Phone #: 575-318-5017																								
Sampler Name: Chris Flores				Fax #:																								
FOR LAB USE ONLY																												
Lab I.D.		Sample I.D.		(G)RAB OR (C)OMP	# CONTAINERS	MATRIX					PRESERV.		SAMPLING															
						GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER													DATE	TIME
1 2 3 4 5 6 7 8 9 10		V-1 @ 0-0.5' V-1 @ 2' V-2 @ 0-0.5-2' V-2 @ 2' V-3 @ 3' V-3 @ 6' V-4 @ 0-0.5 V-4 @ 1.5' V-5 @ 9' V-5 @ 13'		3/13/23 3/13/23	G		X						X		3/08/23	0840	X	X	X									
PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.																												
Relinquished By:				Date: 3/10/23		Received By:				Phone Result: ☐ Yes ☒ No				Add'l Phone #:														
				Time: 11:55						Fax Result: ☐ Yes ☒ No				Add'l Fax #:														
Relinquished By:				Date:		Received By:				REMARKS: email results: knorman@tasman-geo.com; bdennis@tasman-geo.com; lflores@tasman-geo.com;																		
				Time:																								
Delivered By: (Circle One) Sampler - UPS - Bus - Other: -9.7: c-o-u: -10.3: #13						Sample Condition Cool Intact ☒ Yes ☐ No ☐ Yes ☐ No						CHECKED BY: (Initials) 																



ARDINAL LABORATORIES

101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603
(505) 393-2326 FAX (505) 393-2476 (325) 673-7001 FAX (325) 673-7020

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

[illegible]

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2476

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 587653

QUESTIONS

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2218244166
Incident Name	NAPP2218244166 UU LINE @ B-13-17S-34E
Incident Type	Natural Gas Release
Incident Status	Remediation Plan Received

Location of Release Source

Please answer all the questions in this group.

Site Name	UU LINE
Date Release Discovered	05/19/2021
Surface Owner	Private

Incident Details

Please answer all the questions in this group.

Incident Type	Natural Gas Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Not answered.
Is the concentration of chloride in the produced water >10,000 mg/l	Not answered.
Condensate Released (bbls) Details	Cause: Corrosion Pipeline (Any) Condensate Released: 12 BBL Recovered: 0 BBL Lost: 12 BBL.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	The original leak was not thought to have triggered reporting but due to further investigation the overall affects will trigger reporting

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 587653

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	No
Reasons why this would be considered a submission for a notification of a major release	Unavailable.
With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Becky Hesslen Title: Sr Specialist, Remediation Management Email: becky.l.hesslen@p66.com Date: 05/22/2026
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 587653

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Site Characterization	
<i>Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Greater than 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between 1000 (ft.) and ½ (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between ½ and 1 (mi.)
Any other fresh water well or spring	Between ½ and 1 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 1000 (ft.) and ½ (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Greater than 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	Yes

Remediation Plan	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)	
Chloride (EPA 300.0 or SM4500 Cl B)	928
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	3183
GRO+DRO (EPA SW-846 Method 8015M)	3080
BTEX (EPA SW-846 Method 8021B or 8260B)	358
Benzene (EPA SW-846 Method 8021B or 8260B)	0
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	04/27/2026
On what date will (or did) the final sampling or liner inspection occur	05/15/2026
On what date will (or was) the remediation complete(d)	05/25/2026
What is the estimated surface area (in square feet) that will be reclaimed	2500
What is the estimated volume (in cubic yards) that will be reclaimed	370
What is the estimated surface area (in square feet) that will be remediated	2500
What is the estimated volume (in cubic yards) that will be remediated	400
<i>These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.</i>	
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 587653

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fEEM0112342028 LEA LAND LANDFILL
OR which OCD approved well (API) will be used for off-site disposal	Not answered.
OR is the off-site disposal site, to be used, out-of-state	Not answered.
OR is the off-site disposal site, to be used, an NMED facility	Not answered.
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	Not answered.
(In Situ) Soil Vapor Extraction	Not answered.
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	Not answered.
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	Not answered.
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	Not answered.
Ground Water Abatement pursuant to 19.15.30 NMAC	Not answered.
OTHER (Non-listed remedial process)	Not answered.
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: Becky Hesslen Title: Sr Specialist, Remediation Management Email: becky.l.hesslen@p66.com Date: 05/22/2026
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 587653

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Deferral Requests Only	
<i>Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.</i>	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 587653

QUESTIONS (continued)

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	581749
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	05/07/2026
What was the (estimated) number of samples that were to be gathered	6
What was the sampling surface area in square feet	1200

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	No
--	----

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 587653

CONDITIONS

Operator: DCP OPERATING COMPANY, LP 2331 Citywest Blvd Houston, TX 77042	OGRID: 36785
	Action Number: 587653
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

CONDITIONS

Created By	Condition	Condition Date
nvelez	The remediation plan is approved as written. DCP Operating has 90-days (October 13, 2026) to submit to OCD its appropriate or final remediation closure report.	7/14/2026