Received by OCD: 10/8/2026 9:35:09 AM

U.S. Department of the Interior
BUREAU OF LAND MANAGEMENT

Sundry Print Report

10/08/2026

Well Name: SD WE 15 FED P9

Well Location: T26S / R32E / SEC 15 / SESE / 32.035506 / -103.658314

County or Parish/State: LEA / NM

Well Number: 7H

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM118722

Unit or CA Name:

Unit or CA Number:

US Well Number: 300254364200S1

Operator: CHEVRON USA INCORPORATED

Notice of Intent

Sundry ID: 2935885

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 10/04/2026

Time Sundry Submitted: 06:30

Date proposed operation will begin: 10/16/2026

Procedure Description: Procedure, current WBD and proposed WBD attached

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

BLM_NOI_P_A_Packet_20261004182951.pdf

CONFIDENTIAL

Released to Imaging: 10/16/2026 1:03:22 PM

Well Name: SD WE 15 FED P9

Well Location: T26S / R32E / SEC 15 / SESE / 32.035506 / -103.658314

County or Parish/State: LEA / NM

Well Number: 7H

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM118722

Unit or CA Name:

Unit or CA Number:

US Well Number: 300254364200S1

Operator: CHEVRON USA INCORPORATED

Conditions of Approval

Specialist Review

Combined_COA_Inlcude_LPC_Habitat_and_Non_LPC_Habitat__General_Plug___Abandonment_and_Reclaimation__20261008075208.pdf

Revised_Diagram_20261008075208.pdf

SD_WE_15_Fed_P9_7H_20261008075208.pdf

Revised_Procedure_20261008075208.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: STEFANI HILL

Signed on: OCT 04, 2026 06:30 PM

Name: CHEVRON USA INCORPORATED

Title: Well Lifecycle Management Engineer - NM

Street Address: 6301 DEAUVILLE BLVD

City: MIDLAND **State:** TX

Phone: (281) 753-5500

Email address: STEFANI.HILL@CHEVRON.COM

Field

Representative Name:

Street Address:

City: **State:** **Zip:**

Phone:

Email address:

BLM Point of Contact

BLM POC Name: LONG VO

BLM POC Title: Petroleum Engineer

BLM POC Phone: 5759885402

BLM POC Email Address: LVO@BLM.GOV

Disposition: Approved

Disposition Date: 10/08/2026

Signature: Long Vo

Released to Imaging: 10/16/2026 1:03:22 PM

Form 3160-5
(October 2024)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0220
Expires: October 31, 2027

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE *- Other instructions on page 2*

5. Lease Serial No.

6. If Indian, Allottee or Tribe Name

7. If Unit of CA/Agreement, Name and/or No.

1. Type of Well
☐ Oil Well ☐ Gas Well ☐ Other

8. Well Name and No.

2. Name of Operator

9. API Well No.

3a. Address

3b. Phone No. *(include area code)*

10. Field and Pool or Exploratory Area

4. Location of Well *(Footage, Sec., T.,R.,M., or Survey Description)*

11. Country or Parish, State

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	☐ Well Integrity
☐ Subsequent Report	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon	
☐ Final Abandonment Notice	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be perfonned or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that the site is ready for final inspection.)

14. I hereby certify that the foregoing is true and correct. Name *(Printed/Typed)*

Title

Signature

Date

THE SPACE FOR FEDERAL OR STATE OFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.
AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.
PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.
ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.
EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:
The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.
Response to this request is mandatory.
The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect ofthis form to U.S. Department ofthe Interior, Bureau ofLand Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

Additional Information

Location of Well

0. SHL: SESE / 12 FSL / 1421 FEL / TWSP: 26S / RANGE: 32E / SECTION: 15 / LAT: 32.035506 / LONG: -103.658314 (TVD: 0 feet, MD: 0 feet)

PPP: NWNE / 180 FNL / 990 FEL / TWSP: 26S / RANGE: 32E / SECTION: 15 / LAT: 32.049681 / LONG: -103.656866 (TVD: 8992 feet, MD: 9104 feet)

BHL: NWNE / 180 FNL / 990 FEL / TWSP: 26S / RANGE: 32E / SECTION: 15 / LAT: 32.049681 / LONG: -103.656866 (TVD: 9058 feet, MD: 13955 feet)

1. MIRU Rig and spot surface equipment.
2. NDWH and NUBOP. Test BOPE.
3. MIRU WL. Perform RCBL, report back to engineer and BLM.
4. RIH w/ tubing lightly tag CIBP circulate wellbore clean. Pressure test casing to 500psi ensure casing holding and not leaking.
5. Upgrade/Spot above CIBP w/ 55sx class H f/ 8,706'-8,171'
    a. No WOC/Tag required with a passing casing test
6. Spot & Go Brushy canyon w/ 30sx class C f/ 7,400'-7,100'.
7. Spot & Go Cherry Canyon w/ 30sx class C f/ 5,700-5,400'.
8. Spot Lamar/Bell/Intermediate Shoe w/ 30sx class C f/4,700'-4,400'.
    a. WOC & Tag Plug
9. Spot & Go Castile w/ 25sx class C f/ 2,825'-2,575'.
10. Cut/pull casing 800'. POOH and LD. Attempt to circulate backside clean
11. Run CBL on intermediate casing report back to engineer and BLM.
12. Spot stump/surface shoe plug w/ 95sx class C f/ 900'-550'.
    a. WOC & Tag Plug
13. Spot surface plug f/ 250-0 w/ class C 90sx.
    a. Visually confirm cement to surface.
14. Handover to prep to cut wellhead.

Field: Salado Draw
Lease: SD WE 15 FEDERAL P9 #007H
Location: O-15-26S-32E / 12 FSL & 1421 FEL
County: Lea **St:** NM

API: 300-254-3642
Refno: PK8757
Prod Formation: Bone Spring
Status: TA'd
R111-P: No

Spud Date: 4/20/2017
TD Date: 5/13/2017
Completed Date: 8/18/2017
Ground Level: 3158'
KB: 33'
Fresh Water: 200'

Current WBD

Surface Csg.

Size:	13 3/8 (12.615)
Wt.:	54.5#
Set @:	651'
Sxs cmt:	827
Circ:	Yes (498sx)
TOC:	0
Hole Size:	17.50


Intermediate Csg.

Size:	9 5/8 (8.835)
Wt.:	40#
Set @:	4,512'
Sxs Cmt:	1494
Circ:	Yes (347sx)
TOC:	0
Hole Size:	12.25

Production Csg.

Size:	5 1/2 (4.778)
Wt.:	20#
Set @:	13,958'
Sxs Cmt:	2612
Circ:	Yes (87sx)
TOC:	904
Hole Size:	8.75

Formation Name	Formation Top
Surface	0
Rustler	593
Castile	2717
Lamar	4545
Bell Canyon	4578
Cherry Canyon	5572
Brushy Canyon (Top Oil)	7212
Bone Spring	8809
Upper Avalon	8865
CIBP	8706
Top Perfs	9308
Bottom Perfs	13789

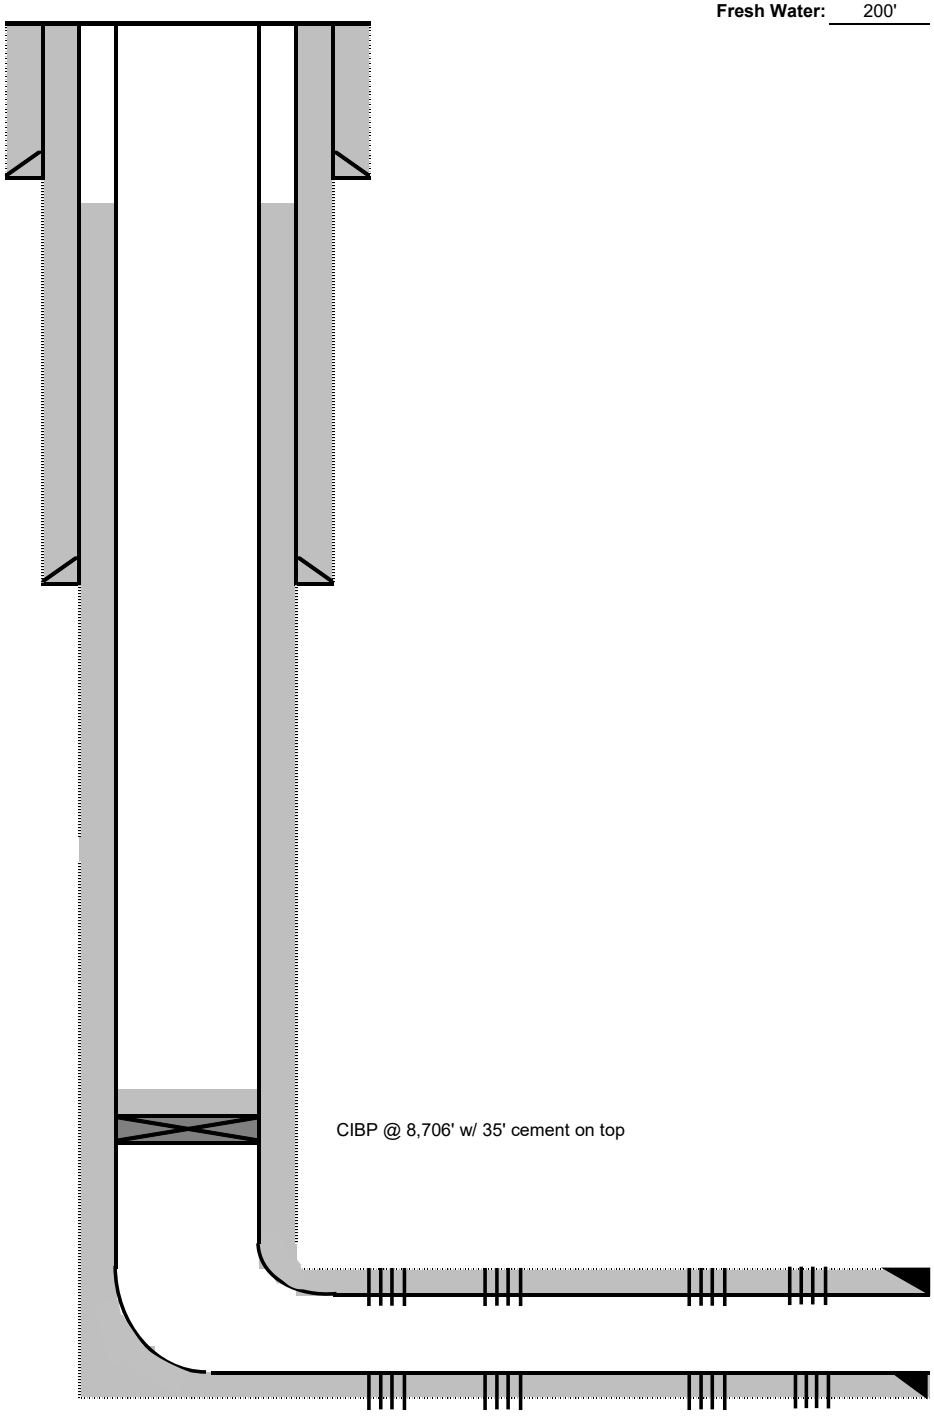

Field: Salado Draw
Lease: SD WE 15 FEDERAL P9 #007H
Location: O-15-26S-32E / 12 FSL & 1421 FEL
County: Lea **St:** NM

API: 300-254-3642
Refno: PK8757
Prod Formation: Bone Spring
Status: TA'd
R111-P: No

Spud Date: 4/20/2017
TD Date: 5/13/2017
Completed Date: 8/18/2017
Ground Level: 3158'
KB: 33'
Fresh Water: 200'

Surface Csg.

Size:	13 3/8 (12.615)
Wt.:	54.5#
Set @:	651'
Sxs cmt:	827
Circ:	Yes (498sx)
TOC:	0
Hole Size:	17.50

Intermediate Csg.


Size:	9 5/8 (8.835)
Wt.:	40#
Set @:	4,512'
Sxs Cmt:	1494
Circ:	Yes (347sx)
TOC:	0
Hole Size:	12.25

Production Csg.

Size:	5 1/2 (4.778)
Wt.:	20#
Set @:	13,958'
Sxs Cmt:	2612
Circ:	Yes (87sx)
TOC:	904
Hole Size:	8.75

Formation Name	Formation Top
Surface	0
Rustler	593
Castile	2717
Lamar	4545
Bell Canyon	4578
Cherry Canyon	5572
Brushy Canyon (Top Oil)	7212
Bone Spring	8809
Upper Avalon	8865
CIBP	8706
Top Perfs	9308
Bottom Perfs	13789

Proposed WBD

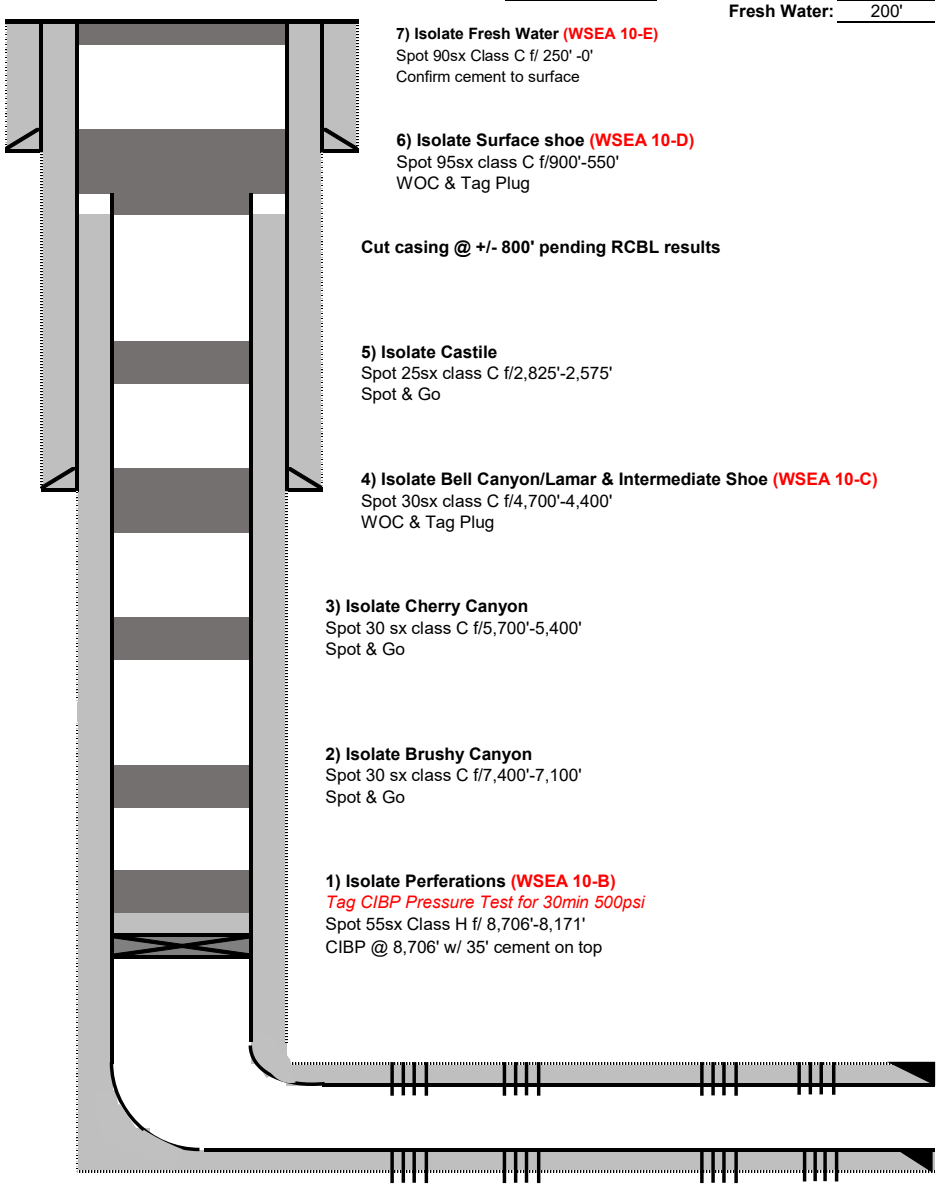

7) Isolate Fresh Water (WSEA 10-E)
Spot 90sx Class C f/ 250' -0'
Confirm cement to surface

6) Isolate Surface shoe (WSEA 10-D)
Spot 95sx class C f/900'-550'
WOC & Tag Plug

Cut casing @ +/- 800' pending RCBL results

5) Isolate Castile
Spot 25sx class C f/2,825'-2,575'
Spot & Go

4) Isolate Bell Canyon/Lamar & Intermediate Shoe (WSEA 10-C)
Spot 30sx class C f/4,700'-4,400'
WOC & Tag Plug

3) Isolate Cherry Canyon
Spot 30 sx class C f/5,700'-5,400'
Spot & Go

2) Isolate Brushy Canyon
Spot 30 sx class C f/7,400'-7,100'
Spot & Go

1) Isolate Perferations (WSEA 10-B)
Tag CIBP Pressure Test for 30min 500psi
Spot 55sx Class H f/ 8,706'-8,171'
CIBP @ 8,706' w/ 35' cement on top

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

Permanent Abandonment of Federal Wells
Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Lea County and Eddy County, please email notifications to: BLM_NM_CFO_PluggingNotifications@BLM.GOV. The Lea and Eddy County inspector on call phone, 575-361-2822, will remain active as a secondary contact.

Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**
Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Above Ground Level Marker: If outside of Lesser Prairie-Chicken Habitat an above ground level marker shall be utilized. All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within fourteen (14) calendar days of the well being plugged. If the cut off cannot be done by the 14th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**
The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

Below Ground Level Marker: If within Lesser Prairie-Chicken Habitat a below ground level marker shall be utilized. All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within fourteen (14) calendar days of the well being plugged. If the cut off cannot be done by the 14th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**
Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

Operator to verify the ground marker type with the BLM before setting dry hole Marker.

Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file via the AFMSS 2 WISx Module a Subsequent Report of Plugging and Abandonment to BLM. Please include the following information:

-The report should give in detail the manner in which the plugging work was carried out, the Extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left In the well.
-The final copy of CBL.
-Any email correspondence regarding changes to originally approved procedure.
-Show date well was plugged.

Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted.

United States Department of the Interior

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm

In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo “interim” reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo “final” reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines **(Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don’t wait till the last day and try to get them to remove infrastructure).** Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. **This will apply to well pads, facilities, and access roads.** Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.

The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and

access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.

It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.

At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:
BLM_NM_CFO_Construction_Reclamation@blm.gov

Released to Imaging: 10/16/2026 1:03:22 PM

Received by OCD: 10/8/2026 9:35:09 AM

PROPOSED P&A WELLBORE DIAGRAM - PRINT PAGE 2 OF 2 - HORIZONTAL


REVISED 3:53 PM, Oct 07, 2026

Outside of Lesser Prairie Chicken Area | **Cave/Karst/Potash: Medium**

Lease Name:	NMNM118722	**State:**	New Mexico
Operator:	CHEVRON USA INCORPORATED	**Current profile:**	Horizontal (schematic)
Well Name/No.:	SD WE 15 Fed P9 7H	**KOP (MD):**	8667'
Location (S-T-R):	15-26-32	**TD MD:**	13958'
County:	Lea	**TD TVD:**	9059'
Sundry ID:	2935885		

PROPOSED P&A OPERATIONS - PRINT PAGE 2 OF 2

MATCHED CURRENT CASING / HATCHED EXISTING CEMENT + PLANNED OPERATION CHANGES

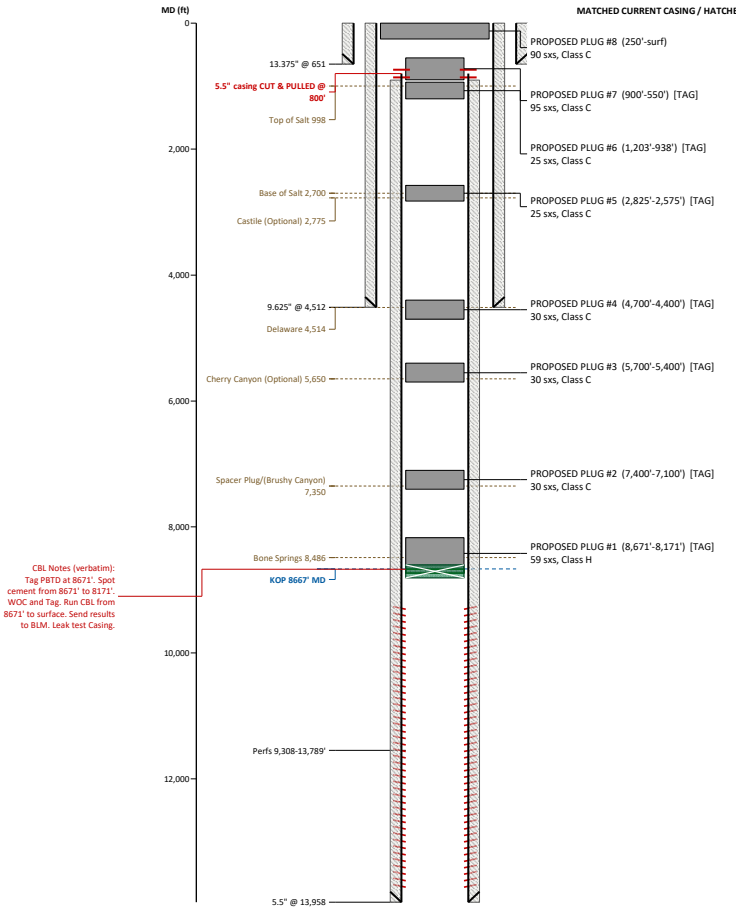

PROPOSED OPERATIONS / TAGS - QUICK LOOKUP

Operation	Depth / interval	Related
TAG instruction (see Notes)	550'	Plug #7
TAG instruction (see Notes)	938'	Plug #6
TAG instruction (see Notes)	2575'	Plug #5
TAG instruction (see Notes)	4400'	Plug #4
TAG instruction (see Notes)	5400'	Plug #3
TAG instruction (see Notes)	7100'	Plug #2
TAG instruction (see Notes)	8171'	Plug #1

CURRENT / EXISTING BARRIERS - NOT PROPOSED

CEMENT PLUGS (SHALLOWEST TO DEEPEST):
EXISTING PLUG 1: TOP 8671' / BOTTOM 8706' MD
Existing/set plug; quantity not entered
CIBPs (SHALLOWEST TO DEEPEST):
CURRENT / EXISTING CIBP @ 8,706'

Casing 1 - 13.375"

Hole Size: 17.5"
Csg Size: 13.375" (ID 12.615")
Top: Surface
Set @: 651'
Existing cement behind casing:
651' to surface (circulated)

Casing 2 - 9.625"

Hole Size: 12.25"
Csg Size: 9.625" (ID 8.835")
Top: Surface
Set @: 4,512'
Existing cement behind casing:
4,512' to surface (circulated)

Casing 3 - 5.5" [CUT/PULLED]

Hole Size: 8.75"
Csg Size: 5.5" (ID 4.778")
Top of remaining casing: 800'
Set @: 13,958'
Cut & pulled @: 800'
Existing cement behind casing:
13,958' to 904'

PBTD (MD):	8,671'	**KOP (MD):**	8667'	**Created:**	10/07/2026
TD MD:	13958'	**TD TVD:**	9059'	**Prepared by:**	Long Vo

APPROVED by Long Vo
Petroleum Engineer (LVO@BLM.GOV)
Carlsbad Field Office
575-988-5402 or 575-234-5936 Alternate Number (Prefer)

Lea and Eddy County Notification:
BLM_NM_CFO_PluggingNotifications@BLM.GOV
Secondary Contact: 575-361-2822

LEGEND

- PROPOSED P&A CEMENT PLUG inside casing / hole
- Hatched existing cement behind casing
- Proposed squeezed / circulated cement
- CURRENT / EXISTING CIBP (green)
- PROPOSED CIBP (orange)
- DV tool (differential valve)
- CURRENT / EXISTING plug (already set)
- Producing perforations
- Perf & squeeze / attempt squeeze
- Perf & circulate
- Casing cut / pulled
- [TAG] = tag required; [PET] = verify cement
- Current/existing plugs are omitted from the procedure
- CIBP color indicates current versus proposed status

Sundry ID	2935885							
Already Set?	Plug Type	Top	Bottom	Length	Tag	Sacks	Cement Class	Notes
	Surface Plug	0.00	100.00	100.00	Tag/Verify	90.00	C	Spot cement from 250' to surface.
	13.375 inch- Shoe Plug	594.49	701.00	106.51	Tag/Verify	95.00	C	Spot cement from 900' to 550'. WOC and Tag.
	Top of Salt @ 998	938.02	1048.00	109.98	Tag/Verify	25.00	C	Spot cement from 1203' to 938'. WOC and Tag. Conduct free point test. Cut and pull 5.5" casing at 800'.
	Base of Salt @ 2700	2623.00	2750.00	127.00	Tag/Verify			
	Castile (Optional) @ 2775	2697.25	2825.00	127.75	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	25.00	C	Spot cement from 2825' to 2575'. WOC and Tag.
	9.625 inch- Shoe Plug	4416.88	4562.00	145.12	Tag/Verify	30.00	C	Spot cement from 4700' to 4400'. WOC and Tag.
	Delaware @ 4514	4418.86	4564.00	145.14	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	30.00	C	Spot cement from 5700' to 5400'. WOC and Tag.

Cherry Canyon (Optional) @ 5650	5543.50	5700.00	156.50	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	30.00	C	Spot cement from 7400' to 7100'. WOC and Tag.
Spacer Plug/(Brushy Canyon) @ 7350	7226.50	7400.00	173.50	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
Bonesprings @ 8486	8171.00	8536.00	365.00	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	59.00	H	Tag PBTD at 8671'. Spot cement from 8671' to 8171'. WOC and Tag. Run CBL from 8671' to surface. Send results to BLM. Leak test Casing.

	KOP @ 8667	8530.33	8717.00	186.67	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
Yes	CIBP Plug	8671.00	8706.00	35.00	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
	Perforations Plug (If No CIBP)	9258.00	13839.00	4581.00	Tag/Verify			
	5.5 inch- Shoe Plug	13768.42	14008.00	239.58	Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.
Class H >7500'
Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater
R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx
Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Requirement:	Top of Salt to surface		
	Medium		
Wild Life	Outside of Lesser Prairie Chicken Area		
13.375 inch- Shoe Plug @	**651.00**		0.00
9.625 inch- Shoe Plug @	**4512.00**		0.00
5.5 inch- Shoe Plug @	**13958.00**	TOC @	904.00
	0.00		0.00
	0.00		0.00
	0.00		0.00
		Perforations	
Perforatons Top @	**9308.00**	Bottom @	**13789.00**
	0.00		0.00
	0.00		0.00
	0.00		0.00
	0.00		0.00
	0.00		0.00
	0.00	CIBP @	8706.00
	0.00		0.00
	0.00		0.00
	0.00		0.00
	0.00		0.00
	0.00		0.00

SD WE 15 Fed P9 7H - P&A Procedure

Location (S-T-R): 15-26-32
Operator: CHEVRON USA INCORPORATED
County/State: Lea Lease: NMNM118722
Sundry ID: 2935885
Outside of Lesser Prairie Chicken Area | Cave/Karst/Potash: Medium
REVISED 3:50 PM, Oct 07, 2026

1.00 Notify Regulatory Agency (BLM) a minimum of 24 hours prior to commencing work. MIRU well service unit and all necessary safety equipment.
2.00 ND WH, NU BOP. Test BOP per API and manufacturer recommendations.
3.00 PLUG #1: Tag PBTD at 8671'. Spot cement from 8671' to 8171'. WOC and Tag. Run CBL from 8671' to surface. Send CBL to BLM. Leak test Casing. (59 sxs, Class H)
4.00 Circulate plugging mud.
5.00 PLUG #2: Spot cement from 7400' to 7100'. WOC and Tag. (30 sxs, Class C)
6.00 PLUG #3: Spot cement from 5700' to 5400'. WOC and Tag. (30 sxs, Class C)
7.00 PLUG #4: Spot cement from 4700' to 4400'. WOC and Tag. (30 sxs, Class C)
8.00 PLUG #5: Spot cement from 2825' to 2575'. WOC and Tag. (25 sxs, Class C)
9.00 PLUG #6: Spot cement from 1203' to 938'. WOC and Tag. Conduct free point test. Cut and pull 5.5" casing at 800'. (25 sxs, Class C)
10.00 PLUG #7: Spot cement from 900' to 550'. WOC and Tag. (95 sxs, Class C)
11.00 PLUG #8: Spot cement from 250' to surface. (90 sxs, Class C)
12.00 REVIEW REQUIRED - CBL Notes were retained without rewriting. Confirm every explicit CBL start depth and the full CBL/RDMO sequence.
13.00 Cut off WH 3' below surface (or base of cellar, whichever is deeper). Notify BLM by phone a minimum of 4 hours prior to cut off to verify cement to surface in casing and all annuluses. Weld on P&A marker per COA.
14.00 Cut off anchors 3' below surface and clean location.

Note: Cement volumes are estimates and are not final. Unless specifically approved, no plug except the surface plug shall be less than 25 sacks. Minimum WOC time for any plug requiring a tag: 4 hrs Class C (or accelerated), 6 hrs Class H. Mud shall be placed between all plugs.

APPROVED by Long Vo
Petroleum Engineer (LVO@BLM.GOV)
Carlsbad Field Office
575-988-5402 or 575-234-5936 Alternate Number (Prefer)

Lea and Eddy County Notification:
BLM_NM_CFO_PluggingNotifications@BLM.GOV
Secondary Contact: 575-361-2822

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Operator: CHEVRON U S A INC 6301 Deauville Blvd Midland, TX 79706	OGRID: 4323
	Action Number: 631003
	Action Type: [C-103F] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	10/16/2026
gcordero	Run RCBL with zero psi, keep hole loaded with fluid, log 8671' to Surface.	10/16/2026
gcordero	Run RCBL on 9 5/8" casing with zero psi, keep hole loaded with fluid, log 750' to Surface.	10/16/2026
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	10/16/2026
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	10/16/2026