Santa Fe
077978
Fullerton
Unit

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	Subsequent Report of Sandfrac Treatment X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 22nd, 19 59

Well No. 2 is located 790 ft. from [N/S] line and 790 ft. from [E/W] line of sec. 28

SE/4 SE/4 Sec. 28 (¼ Sec. and Sec. No.) | 28N (Twp.) | 13W (Range) | N.M.P.M. (Meridian)

Wildcat (Field) | San Juan (County or Subdivision) | New Mexico (State or Territory)

RECEIVED
AUG 27 1959
OIL CON. COM.
DIST. 3

The elevation of the derrick floor above sea level is 5956 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

6-20-59 TD 6280'. Cleaned out to 6204'. Perforated 6155-61' with 4 shots per foot. Sandfraced with 83,500 gallons water and 75,000# sand, flushed with 20,000 gallons water. Breakdown pressure 4100#, broke to 1600#. Maximum treating pressure 4450#, average treating pressure 3950#, final pressure after pumps shut down 1850#. Shut well in to bleed off pressure.

6-21-59 CP 325#. Set Guiberson bridge plug at 6135-37'. Perforated 6111-25' with 4 shots per foot. Possibility of slight communication as pressure built up to 25# and well flowed at approximate rate of 10 barrels water per hour. Sandfraced with 65,000 gallons water and (continued)

*It must receive approval in writing by the Geological Survey before operations may be commenced.

Page #1

By

Title

Form 9-331a
(Feb. 1951)

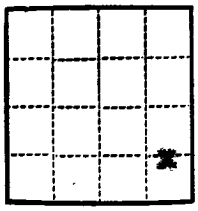

Budget Bureau No. 42-R358.4.
Approval expires 6-30-52.

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office 077978
Lease No. Fullerton
Unit

Page #2

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		~~Subsequent Report of Sandfrac~~ Treatment	X
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 22nd, 19 59

Well No. ..... is located ..... ft. from {N/S} line and ..... ft. from {E/W} line of sec.

..... (¼ Sec. and Sec. No.) ..... (Twp.) ..... (Range) ..... (Meridian)

..... (Field) ..... (County or Subdivision) ..... (State or Territory)

RECEIVED
JUL 27 1959
OIL CON. COM.
DIST. 3

The elevation of the derrick floor above sea level is ..... ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

65,000# sand, flushed with 9,000 gallons water. Breakdown pressure with one truck 1700#. Maximum treating pressure 4650#, minimum 3900#, average injection rate 55.3 barrels per minute.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company BENSON-MONTIN-GREER DRILLING CORP.

Address 158 Petroleum Center Building

Farmington, New Mexico

By .....

Title Vice-President

U. S. GOVERNMENT PRINTING OFFICE: 1958 O -463339