ConocoPhillips

Schematic - Current

SAN JUAN 30-5 UNIT #38P API # 30-039-30892

District	Field Name	API / UWI	County	State/Province
NORTH	MV/DK COM	3003930892	RIO ARRIBA	NEW MEXICO

Original Spud Date	Surface Legal Location	East/West Distance (ft)	East/West Reference	North/South Distance (ft)	North/South Reference
7/13/2010	018-030N-005W-O	1,695.00	FEL	975.00	FSL

Well Config: DEVIATED - Original Hole, 11/10/2010 7:20:40 AM

ftKB (MD)	Schematic - Actual
0	
16	3-1, Casing Hanger, 4 1/2, 4.000, 16, 1.0
17	2-1, Casing Hanger, 7, 6.366, 16, 1.0
19	1-1, Casing Hanger, 9 5/8, 9.001, 16, 3.3
25	2-2, Casing Pup Joint, 7, 6.366, 17, 8.0
60	3-2, Casing Pup Joint, 4 1/2, 4.000, 17, 42.8
231	1-2, Casing Joints, 9 5/8, 9.001, 19, 211.9
232	1-3, Sawtooth Collar, 9 5/8, 9.001, 231, 0.8
236	
2,382	
2,935	2-3, Casing Joints, 7, 6.366, 25, 2,910.0
2,938	2-4, Stage Tool, 7, 6.366, 2,935, 3.1
3,804	2-5, Casing Joints, 7, 6.366, 2,938, 865.6
3,804	2-6, Float Collar, 7, 6.366, 3,804, 0.7
3,847	2-7, Casing Joints, 7, 6.366, 3,804, 42.5
3,848	2-8, Float Shoe, 7, 6.366, 3,847, 0.8
3,855	1-1, Tubing, 2 3/8, 1.995, 16, 8,003.6
4,144	3-3, Casing Joints, 4 1/2, 4.000, 60, 4,084.1
4,154	3-4, Marker Joint, 4 1/2, 4.000, 4,144, 10.0
4,546	
4,713	4,546-5,017, 10/15/2010
5,017	
5,216	
5,276	5,276-5,666, 10/14/2010
5,666	
5,705	5,705-6,199, 10/14/2010
6,199	
7,756	3-5, Casing Joints, 4 1/2, 4.000, 4,154, 3,602.1
7,766	3-6, Marker Joint, 4 1/2, 4.000, 7,756, 10.0
8,020	1-2, Pup Jt/ Marker, 2 3/8, 1.995, 8,020, 2.1
8,022	
8,037	1-3, Tubing, 2 3/8, 1.995, 8,022, 30.3
8,052	1-4, F Nipple, 2 3/8, 1.780, 8,052, 0.9
8,053	1-5, Expendable check, 2 3/8, 1.995, 8,053, 0.8
8,054	8,037-8,131, 10/13/2010
8,131	
8,146	
8,178	3-7, Casing Joints, 4 1/2, 4.000, 7,766, 411.8
8,178	3-8, Float Collar, 4 1/2, 4.000, 8,178, 0.6
8,179	3-9, Float Shoe, 4 1/2, 4.000, 8,178, 0.6
8,180	

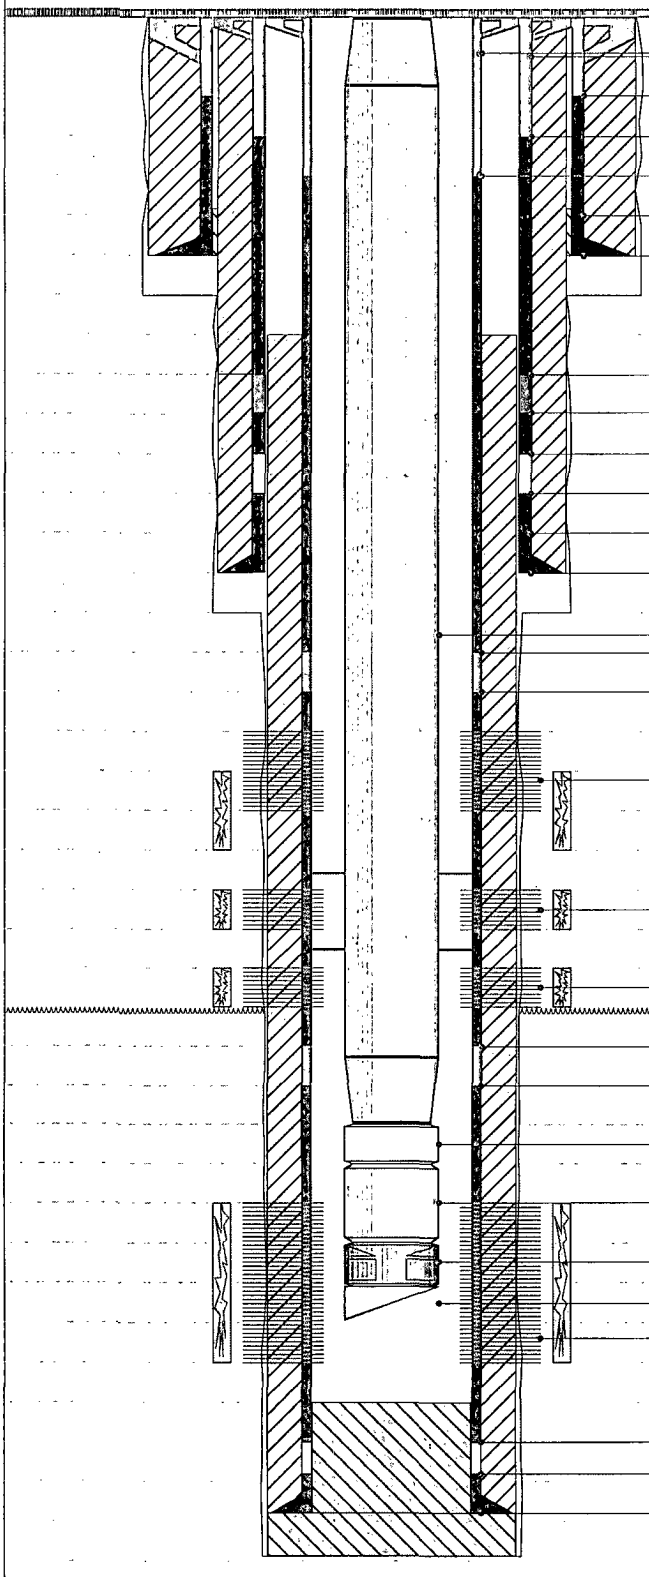

RCVD NOV 19 '10
OIL CONS. DIV.
DIST. 3

 Report Printed: 11/10/2010