PLUGGING & ABANDONMENT WORKSHEET (2 STRING CSNG)

OPERATOR Texaco Exploration & Production

LEASENAME Central Vacuum UNIT WELL # 116

SECT 6 TWN 18S RNG 35E

FROM 990 N/S L 870 E/W L

TD: 4730 FORMATION @ TD Grayburg

PBTD: ____ FORMATION @ PBTD San Andres

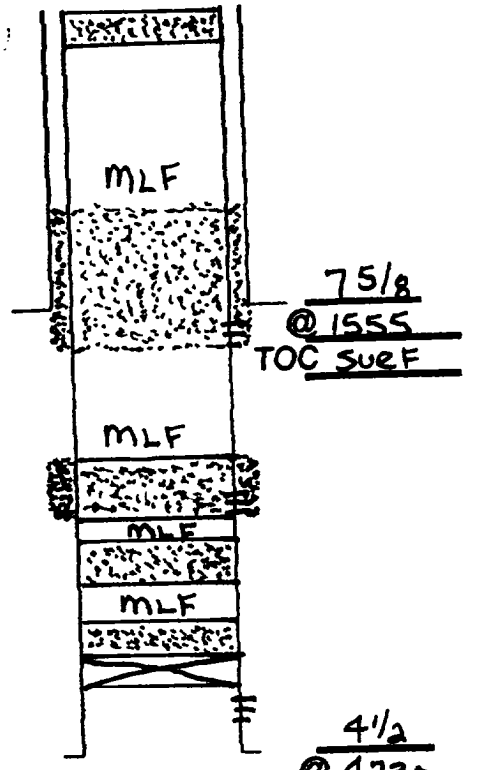

7 5/8 @ 1555 TOC surf

4 1/2 @ 4730 TOC 2750

TD 4730

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	7 5/8	1555	surf	circ
INTMED 1				
INTMED 2				
PROD	4 1/2	4730	2750	calc

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL @		TOP - BOTTOM
		PERFS	4637 - 4705
INTMED 1		OPENHOLE	-
INTMED 2			
PROD			

*REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)	*
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPITAN REEF	*
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
GLORIETA	*
BLINEBRY	
TUBB	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
MISS	
DEVONIAN	

PLUG	TYPE PLUG	SACKS CMNT	DEPTH
EXAMPLES			
PLUG #1	OH	35 SXS	6400'
PLUG #2	SHOE	50 SXS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #3	CIBP	25 SXS	4800'
PLUG #4	STUB	50 SXS	3600'-3700'
PLUG #5	RETNR SQZ	200 SXS	400'
PLUG #6	SURF	10 SXS	0-10'
PLUG #1	Grayburg	25 SX	4600 - 4400
PLUG #2	Queen	25 SX	3800-3600
PLUG #3	Yates	50 SX	2800-2600
PLUG #4	7 5/8 S	125 SX	1605-1200
PLUG #5	surf	10 SX	10'-SURF
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG			
PLUG			